E & A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599 www.eacg.com

E & A CONSULTING GROUP, INC.

Zachary A. Jilek, CPESC, CISEC Environmental Services Dept. Manager

Engineering Answers

		E&A	- P2017.550.000		
Inspector: Bryce Wright					Stage
Project Name:		1)	1		
For Week Ending:			2/12/2022		68046
Project Location:	S 114th	Street and Schra	ım Road, Papillion, NE (S	Sarpy County)	
Grading:	100%	1			
Sanitary Sewer:	90%	,			
Storm Sewer:	80%	,			
Paving:	85%				
Seeding:	90%				
Utilities:	50%				
Overall Development:	20%	1			
RAIN FALL AMOUNTS	Amount in tenths	Date inspected	Weather Conditions	Time	
					Week 1
Sunday:	0.00"				
Monday:	0.00"				
Tuesday:	0.00"	2/8/22	Sunny 60	3:20 PM	
Wednesday:	0.00"				
Thursday:	0.02"				
Friday:	0.22"				
Saturday:	0.00"				
Complaints:	None				

Construction Sequencing:

Which portion(s) (i.e. drainage basins) of the site have had a temporary or permanent cessation of grading, earthwork, or ground disturbance in the last 14 days?

Rough grading began in drainage area B, C, and D (10/31/19). Rough grading began in drainage area A (11/7/19). Rough grading complete in drainage area A, B, C, and D (12/3/19). Ground disturbance for Basin A excavation began (1/16/2020). Ground disturbance for Basin A excavation complete (2/20/20). Ground disturbance for Basin F excavation began (2/20/20). Ground disturbance for Basin A and B excavation began (2/27/20). Large portion of the site south of SB B regraded (3/5/20). Large portion of site south of the wetland regraded (4/2/20). Northeast portion of the site mass excavation began (4/2/20). Large portion of the site west of SB F regraded (4/9/20). Large portion of the site north of SB F regraded (5/6/20). Grading on section 1 complete (6/19/20). Paving in progress (9/15/21). Sidewalk paving along Schram Rd. (11/23/21). Home building began (12/15/21).

Which portion(s) (i.e. drainage basins) of the site do not have grading, earthwork, or ground disturbance scheduled in the next 14 days?

Rough grading began in drainage area B, C, and D (10/31/19). Rough grading began in drainage area A (11/7/19). Rough grading complete in drainage area A, B, C, and D (12/3/19). Ground disturbance for Basin A excavation began (1/16/2020). Ground disturbance for Basin A excavation complete (2/20/20). Ground disturbance for Basin F excavation began (2/20/20). Ground disturbance for Basin A and B excavation began (2/27/20). Large portion of the site south of SB B regraded (3/5/20). Large portion of site south of the wetland regraded (4/2/20). Northeast portion of the site mass excavation began (4/2/20). Large portion of the site west of SB F regraded (4/9/20). Large portion of the site north of SB F regraded (5/6/20). Grading on section 1 complete (6/19/20). Paving in progress (4/28/21). Paving ceased (8/2/21). Excavation for utility installation (8/2/21). Paving in progress (9/15/21). Sidewalk paving along Schram Rd. (11/23/21). Home building began (12/15/21).

What temporary or permanent stabilization measures listed in this section are being implemented?

Existing vegetation (10/31/19). Drainage Basin B, C, and F seeded (7/7/20). Drainage Basin A seeded (7/21/20). Outlot 'A' seeded (8/2/21). Seed and mat along Schram road (8/25/21). Drill seeding of the entire site (11/8/21).

Checklist Questions:

Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?

No

Create Corrective Action?

No - See BMP Section

Have disturbed areas bee are adequate or needed t		se stabilized as requ	ired? List inactive portion	ns of the project and if	stabilization measure					
Yes	•									
Create Corrective Action	?									
V/A										
Are weste materials (concrete construction material, hazardous, etc.) being managed properly?										
Are waste materials (concrete, construction material, hazardous, etc.) being managed properly? Yes										
es Create Corrective Action?										
N/a	ACCONTOURS ACTION									
Are construction entranc	es and adjacent stree	ets being maintained	adequately?							
No Create Corrective Action	<u> </u>									
No - See BMP Section	f									
140 OGC DIVIL OCCURNI										
Is dust associated with the	ne construction activi	ty adequately contro	olled on the site?							
Yes										
Create Corrective Action	?									
N/A										
Comments:										
Comments:										
Site was active for utility in	stallation and home bu	ilding during the curre	ent inspection.							
Findings / Corrective Act		J 3 3.10 03110	-1							
Findings / Corrective Act										
Some maintenance is requ		n.								
		Phase I								
Unique Name	Туре	Location	Projected Install Date	Status	Maintenance					
omquo riamo	Construction	Location	i rojostou motum buto	Otatao	mamonano					
CE 01	Entrance	AA15	11/7/2019	Active	Yes					
Current Condition:	Poor Condition - 25%	effective - Ruff Gradin	ng installed a construction	entrance prior to the 11/	7/19 inspection.					
	Rock needs to be add	led to the construction	entrance.							
			informed to complete by 1							
			Ruff Grading and Graves							
			0, 3/6/20, 3/13/20, 3/27/20,							
		The state of the s	34), 6/12/20, 6/17/20, 7/8/2							
			8/20, 10/14/20, 11/28/20, 1/ CIR#15034), 10/22/21, 10/							
	(CIR #15550), 1/24/22			21/21, 11/2/21 (OIIX #13	322), 12/2/21, 12/1/21					
	Construction	1			ı					
CE 02	Entrance	N2		Removed						
Current Condition:			entrance prior to the inspe							
Current Condition.	Construction	Paved the	entrance prior to the mape	0110110110/10/21.	1					
CE 03	Entrance	D2		Removed						
Current Condition:			Road Improvement project		has been removed prior to					
	the inspection on 7/7/			. ,	'					
	Construction									
CE 04	Entrance	O3		Removed						
Current Condition:	Removed - Due to the start of the Schram Road Improvement project the temporary entrance has been removed prior to									
	the inspection on 7/30)/20.								
	Construction									
CE 05	Entrance	AA8	9/22/2021	Active	No					
Current Condition:		% effective - TAB Cor	struction installed the cons	struction entrance prior to	o the inspection on					
	9/22/21.									
CW 01	Concrete Washout	S 11	4/28/2021	Pending	No					
Current Condition:	Pending - TAB Construction installed a concrete washout prior to the inspection on 4/30/21. TAB Construction installed									
				a second concrete washout in the northeast section of the site prior to the inspection on 9/22/21. TAB Construction						
	a second concrete wa	shout in the northeas	t section of the site prior to		1. TAB Construction					
	a second concrete wa removed the concrete	shout in the northeas washout pit in the mi	t section of the site prior to ddle of the site prior to the		1. TAB Construction					
	a second concrete wa removed the concrete	shout in the northeas washout pit in the mi washout prior to the	t section of the site prior to		1. TAB Construction					
	a second concrete wa removed the concrete removed the concrete	shout in the northeas washout pit in the mi washout prior to the NW corner of site	t section of the site prior to ddle of the site prior to the inspection on 12/15/21.	inspection on 10/13/21.	21. TAB Construction TAB Construction					
D 01	a second concrete wa removed the concrete removed the concrete Diversion	shout in the northeas washout pit in the mi washout prior to the NW corner of site (SW of SB D)	t section of the site prior to ddle of the site prior to the inspection on 12/15/21. 1/31/2020	inspection on 10/13/21. Pending	21. TAB Construction TAB Construction No					
D 01 Current Condition:	a second concrete wa removed the concrete removed the concrete Diversion	shout in the northeas washout pit in the mi washout prior to the NW corner of site (SW of SB D)	t section of the site prior to ddle of the site prior to the inspection on 12/15/21.	inspection on 10/13/21. Pending	21. TAB Construction TAB Construction No					
	a second concrete wa removed the concrete removed the concrete Diversion	shout in the northeas washout pit in the mi washout prior to the NW corner of site (SW of SB D) ill be installed as nece	t section of the site prior to ddle of the site prior to the inspection on 12/15/21. 1/31/2020	inspection on 10/13/21. Pending	21. TAB Construction TAB Construction No					
	a second concrete wa removed the concrete removed the concrete Diversion	shout in the northeas washout pit in the mi washout prior to the NW corner of site (SW of SB D)	t section of the site prior to ddle of the site prior to the inspection on 12/15/21. 1/31/2020	inspection on 10/13/21. Pending	21. TAB Construction TAB Construction No					

Current Condition:	Fair Condition - Ruff Grading installed the diversion prior to inspection on 11/22/19. Ruff Grading cleaned out and redefined the diversion prior to the 2/27/20 inspection. Ruff Grading reinstalled the diversion prior to the inspection on 3/20/20. Ruff Grading reinstalled the diversion prior to the inspection on 5/6/20. Ruff grading removed the southern portion of the diversion prior to the 5/18/20 inspection. Ruff Grading reinstalled the southern portion of the diversion prior to the 5/27/20 inspection. Ruff Grading redefined/cleaned out the diversion prior to the inspection on 6/1/20. Ruff Grading removed the diversion prior to the inspection on 6/16/20. Ruff Grading reinstalled the diversion prior to the inspection on 6/19/20.						
		be redefined/reinstalle	, and the second	as of the last inspection	No response received as		
	Graves Development was informed to complete by 8/19/20. Not done as of the last inspection. No response received as of the last inspection. Graves Development and TAB Construction were reminded on 10/14/20, 11/28/20, 1/21/21, 2/26/21, 3/16/21, 5/12/21, 6/17/21, 7/2/21, 7/17/21, 8/27/21, 9/23/21 (CIR#15034), 10/22/21, 11/2/21 (CIR #15322), 12/2/21, 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22						
D 03	Diversion	NW corner of site (Southeast of SB B)	11/22/2019	Active	Yes		
Current Condition:	the basin prior to the removed prior to the inspection on 4/9/20. Grading reinstalled th diversion prior to the	Fair Condition - Ruff Grading installed the diversion prior to inspection on 11/22/19. Ruff Grading redefined/deepened the basin prior to the inspection on 11/26/19. Ruff Grading cleaned out/redefined/ reinstalled the diversion where full and removed prior to the inspection on 3/20/20. Ruff Grading reinstalled/redefined the diversion leading into SB A during the inspection on 4/9/20. Ruff grading removed the southern portion of the diversion prior to the 5/18/20 inspection. Ruff Grading reinstalled the southern portion of the diversion prior to the 5/27/20 inspection. Ruff Grading removed the diversion prior to the inspection on 6/16/20. Ruff Grading reinstalled the diversion prior to the inspection on 6/19/20.					
	The diversion should be redefined/reinstalled leading into SB A. TAB Construction was informed to complete by 10/20/20. Not done as of the last inspection. No response received as of the last inspection. TAB Construction was reminded on 11/28/20, 1/21/21, 2/26/21, 3/16/21, 5/12/21, 6/17/21, 7/2/21, 7/17/21, 8/27/21, 9/23/21 (CIR#15034), 10/22/21, 11/2/21 (CIR #15322), 12/2/21, 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22						
D 04	Diversion	N perimeter of site (East of SB B)	11/22/2019	Active	No		
Current Condition:	Good Condition - Rut cleaned out/redefined	ff Grading installed a te d the diversion prior to t	mporary diversion into SE	. Ruff Grading reinstalled	d the diversion prior to the		
D 05	Diversion	SE corner of site (Northwest of SB F)		Removed			
Current Condition:		rsion was removed for usen does not need to be		/21 inspection. Due to t	he completion of paving in		
D 06	Diversion	NE corner of site (South of SB C)		Removed			
Current Condition: D 07	Removed - Diversion Diversion	NE corner of site (South of SB C)	he SWPPP modification of	n 12/10/19. Removed			
Current Condition:		ade in the area, diversi	on is no longer needed a				
D 08	Diversion	NE corner of site (North of SB C)		Removed			
Current Condition:		ade in the area, diversi	ion is no longer needed a		· T		
D 09	Diversion	N perimeter of site (East of SB B)		Removed			
Current Condition:	Removed - Diversion was renamed during the SWPPP modification on 12/10/19. D 09 was renamed and is not						
D 10	to as D 04 in the E&A Diversion	 	4/16/2020	Active	No		
Current Condition:	Diversion South of SB A 4/16/2020 Active No Good Condition - Ruff Grading installed a temporary diversion into SB A prior to the inspection on 4/16/20. Ruff Grading removed the diversion prior to the inspection on 6/16/20. Ruff Grading reinstalled the diversion prior to the inspection on 6/19/20. TAB Construction redefined the diversion prior to the inspection on 10/20/21.						
EM 04	Erosion Control	Northwest corner of	4/04/0000	Don die e	NI-		
EM 01 Current Condition:		2/21 inspection; however			No vil earthwork is complete in tion of the area will no be		
EM 02	Erosion Control	Northwest corner of	1/31/2020	Panding	No		
Current Condition:	Matting site (West of D 2) 1/31/2020 Pending No Pending - Erosion control matting will be installed once earthwork in the area is complete. Civil earthwork is complete in the area as of the 8/2/21 inspection; however, due to the future lot construction, final stabilization of the area will no be recommended at this time.						
EM 03	Erosion Control Matting	Southeast corner of site (South of D 5)		Removed			

FT 1	Fuel Tank	East of CE 2		Removed				
Current Condition:			I the fuel tank prior to the i		. <u>l</u>			
FT 2	Fuel Tank	South of CE 2	9/3/2021	Pending	No			
Current Condition:	Pending - TAB Construction removed the fuel tank prior to the inspection on 6/16/21. TAB Construction brought a fuel tank with secondary containment on site prior to the inspection on 9/3/21. TAB Construction removed the fuel tank prior to the inspection prior to the inspection on 12/15/21. TAB Construction brought a fuel tank on site prior to the inspection on 12/29/21. TAB Construction removed the fuel tank prior to the inspection on 1/5/22.							
Lot 1	Individual Lot	Lot 1	12/21/2021	Pending	Yes			
Current Condition:	removed the dirt pile f Silt fence should be in Bridgewater Homes w	rom the ROW prior to estalled along the rear	to the inspection on 1/5/22. To the lot when weather a sete by 1/31/22. Not done a	llows. as of the last inspection.				
Lot 2 Current Condition:	Individual Lot	Lot 2	2/2/2022	Active	No No lirt pile was observed in the			
	ROW but the lot was l recommendations.	being actively excava	ted at the time. E&A inspe	ctor will continue to mon	itor for removal and BMP			
Lot 19	Individual Lot	Lot 19	2/2/2022	Active	No No			
Current Condition:	ROW but the lot was l recommendations.	being actively excava	ted at the time. E&A inspe	ctor will continue to mon				
Lot 20 Current Condition:	Individual Lot	Lot 20	12/15/2021 vation on the lot prior to the	Pending 40/45/04	Yes			
	the ROW prior to the Silt fence should be in	installed and secured a portable toilet prior to the inspection on 12/29/21. Bridgewater Homes removed the dirt pile from the ROW prior to the inspection on 1/5/22. Silt fence should be installed along the rear of the lot when weather allows. Bridgewater Homes was informed to complete by 1/31/22. Not done as of the last inspection.						
PB 1	Portable Bathroom	East of CE 2	12/15/2021	Active	No			
Current Condition:	Good Condition - an υ	ınknown builder instal	led and secured a portable	e toilet on lot 1 prior to th				
PB 2	Portable Bathroom	South of CE 2	portable toilet prior to the	Removed	D. Competence tipe of the stable of			
Current Condition:	and secured a portabl	e toilet in the northea coilet prior to the inspe	st corner of the site prior to the ection on 9/3/21. TAB cons	o the inspection on 8/17/	21. TAB Construction			
SB A Current Condition:	installed the riser, out basin outfall prior to the installation. The E&A	fall, and baffle for the ne inspection on 3/12/ inspector repaired the	3/12/2020 egan excavation of the bas basin prior to the inspection 20. As of the 3/12/20 inspection and the inspection on 8/1 aring the inspection on 8/1	on on 3/5/20. Ruff Gradin ection Ruff Grading has the inspection on 5/13/20	ng installed Rip Rap at the completed basin			
SB B	Sediment Basin	site (East of SB A)	3/12/2020	Active	Yes			
Current Condition:	observed installing the outfall pipe for the bas inspection on 3/12/20 the basin prior to the inspection on the inspection on 3/12/20 the basin prior to the inspection was TAB Construction was	e riser, basin outfall, a sin prior to the 3/5/20 . As of the 3/12/20 ins nspection on 7/27/21 buried during sewer	The E&A inspector repair work in the area and should by 9/9/20. Not done as o	20 inspection. Ruff Gradin installed Rip Rap at the bi- completed basin installar inted the cleanout mark of ld be cleaned off.	ng installed the riser and asin outfall prior to the tion. Hausman cleaned out on the riser on 7/29/21.			
	· ·		· · · · · · · · · · · · · · · · · · ·		3/16/21, 5/12/21, 6/17/21, 7/21 (CIR #15550), 1/24/22			
SB C	Sediment Basin	site	11/22/2019	Active	No			
Current Condition:	Good Condition - 31% was observed installir basin installation prior	full - Ruff Grading being the riser, basin outlet to the inspection on	egan excavation of the bas all, inlets, and baffle durin	in prior to inspection on g the 3/5/20 inspection. It repaired the damaged by	11/22/19. Ruff Grading Ruff Grading completed paffle prior to the inspection			
SB D	Sediment Basin	site (North of SB E)		Removed				
Current Condition:		· · · · · · · · · · · · · · · · · · ·	luring the SWPPP modific		•			

		Southeast corner of				
SB E	Sediment Basin	site (South of SB D)		Removed		
Current Condition:		\	Luring the SWPPP modifica			
Current Condition.	Removed - Sediment Basin was removed during the SWPPP modification on 12/10/19. Southeast corner of					
SB F	Sediment Basin	site)	2/20/2020	Active	Yes	
Current Condition:		,				
Surrent Schulton.	Fair Condition - 80% full - Ruff Grading began excavation of the basin prior to the inspection on 2/20/20. Ruff Grading installed the outfall pipe for the basin prior to the 3/5/20 inspection. Ruff Grading was observed installing the riser on to basin during the inspection on 3/12/20. As of the 3/20/20 inspection Ruff Grading has completed basin installation. The E&A inspector repainted the clean out mark on the riser during the inspection on 8/12/20. Caleb Beasley, PE with E&A said basin may be relocated during mass grading in this portion of the site on 7/8/21. The basin is full and needs to be cleaned out. SID was informed to complete by 7/7/21. Not done as of the last inspection. E&A Consulting Group is working on plan for this basin as of 9/15/21. CIR #15034 was received calling out this basin. No plans have been finalized as of 9/23/2					
		Southeast corner of				
		site (NW of SB D				
SB G	Sediment Basin	and E)		Removed		
Current Condition:	Removed - Sediment		uring the SWPPP modification	ation on 12/10/19.		
		Southwest				
SF 01	Silt Fence	perimeter of site	8/6/2020	Pending	No	
Current Condition:	•	2/21 inspection, the a	rea is well vegetated. The	silt fence is not needed	at this time, the inspector	
	will monitor.					
		East perimeter of				
SF 02	Silt Fence	site	10/31/2019	Active	Yes	
Current Condition:	Fair Condition - Ruff Grading installed the silt fence prior to the 10/31/19 inspection. Ruff Grading repaired/retied the damaged silt fence south of CE 01 prior to the inspection on 4/16/20. Ruff Grading removed a portion of silt fence east of SB C prior to the inspection on 6/1/20. Ruff Grading removed the majority of silt fence prior to the inspection on 6/10/20. Due to grade in the area, silt fence reinstallation is not recommended at this time. E&A inspector will continue to monitor. Ruff Grading reinstalled a small portion of silt fence east of SB C prior to the inspection on 6/10/20. Minor damage was observed on the silt fence to the south of CE 01 during the 12/2/20 inspection. E&A inspector will continue to monitor. Due to vegetation growth in the area, a J-hook is no longer needed north of CE 01 as of the 8/2/21 inspection. Commercial Seeding removed the silt fence south of SB C prior to the inspection on 11/9/21. Commercial Seeding installed silt fence on either side of CE 5 prior to the inspection on 11/8/21. Silt fence should be reinstalled south of CE 1. Graves Development was informed to complete by 6/23/21. Not done as of the last inspection. Graves Development was reminded on 7/2/21, 7/17/21, 8/10/21, 8/26/21 (CIR #14825), 9/2/21, 9/16/21, 9/23/21 (CIR#15034), 10/22/21, 10/27/21, 11/2/21 (CIR #15322), 12/2/21, 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22					
		Northwestern				
SF 03	Silt Fence	perimeter of site	10/31/2019	Active	Yes	

Current Condition: Fair Condition - Ruff Grading installed the silt fence prior to the 10/31/19 inspection. Per conversation with Caleb Beasley and Ruff Grading the portion of the silt fence that runs north to south just west of SB A is not needed at this time due to drainage in the area running towards SB A and away from adjoining property. The silt fence running north to south just west of SB A was removed prior to inspection on 11/14/19. The silt fence east of SB A was repaired/reinstalled prior to inspection on 11/14/19. Ruff Grading repaired, retied, trenched in, reinstalled, and cleaned out multiple damaged portions of silt fence prior to the inspection on 4/16/20. Due to the start of the Schram Road Improvement project on 6/16/20, any portion of SF 3 north of SB A and SB B will no longer receive maintenance recommendations. The silt fence at the base of the outfall for SB A was removed prior to the inspection on 7/1/20. The silt fence north of SB A and B was removed prior to the 7/15/20 inspection due to the grading start of the Schram Road Improvement Project directly north of the site. E&A inspector will continue to monitor for reinstallation need. TAB Construction reinstalled some of the silt fence that was removed for sewer installation prior to the inspection on 11/10/20. Hausman was removing all silt from the wetlands and from around the inlet during the inspection on 7/27/21. As of the 8/2/21 inspection, all findings for silt fence maintenance in the area of the wetlands have been combined into 1.) Silt fence should be maintained in the area surrounding the wetlands. 2.) The silt fence should be repaired/reinstalled where removed for sewer installation. 3.) The silt fence should be reinstalled where blown out. 1.) Ruff Grading and Graves Development was informed to complete by 3/19/20. Not done as of the last inspection. No response received as of the last inspection. Ruff Grading and Graves Development was reminded on 3/27/20, 4/3/20, 4/10/20, 4/17/20, 4/28/20, 5/7/20, 5/14/20, 5/19/20, 5/28/20, 6/2/20, 6/5/20 (CIR #12184), 6/12/20, 6/17/20, 7/8/20, 7/16/20 (CIR #12492), 7/31/20, Graves Development was reminded on 8/5/20, 8/13/20, 10/14/20, 11/28/20, 1/21/21, 2/26/21, 3/16/21, 5/12/21, 6/17/21, 7/2/21, 7/17/21, 8/10/21, 8/26/21 (CIR #14825), 9/2/21, 9/16/21, 9/23/21 (CIR#15034), 10/22/21, 10/27/21, 11/2/21 (CIR #15322), 12/2/21, 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22 2.) TAB Construction was informed to complete by 9/9/20. Not done as of the last inspection. No response received as of the last inspection. TAB Construction was reminded on 10/14/20, 11/28/20, 1/21/21, 2/26/21, 3/16/21, 5/12/21, 6/17/21, 7/2/21, 7/17/21, 8/27/21, 9/23/21 (CIR#15034), 10/22/21, 10/27/21, 11/2/21 (CIR #15322), 12/2/21, 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22 3.) Graves Construction was informed to complete by 7/7/21. Not done as of the last inspection. Graves Construction was reminded on 7/17/21, 8/10/21, 8/26/21 (CIR #14825), 9/2/21, 9/16/21, 9/23/21 (CIR#15034), 10/22/21, 10/27/21. 11/2/21 (CIR #15322), 12/2/21, 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22 Southwest perimeter of site (East of SF 01) SF 04 8/11/2020 Silt Fence Pending Nο **Current Condition:** Pending - As of the 8/2/21 inspection, the area is well vegetated. The silt fence is not needed at this time, the inspector will monitor. East of SF 4 adjacent to SF 6 SF 05 Silt Fence Removed Removed - Silt fence was removed during the SWPPP modification on 12/10/19. **Current Condition:** East of SF 4 SF 06 Silt Fence adjacent to SF 5 Removed Removed - Silt fence was removed during the SWPPP modification on 12/10/19. **Current Condition:** Central eastern SF 07 Silt Fence perimeter of site Removed Removed - Silt fence was removed during the SWPPP modification on 12/10/19. SF 07 was renamed and is now **Current Condition:** referred to as a part of SF 02 in the E&A inspector's report. North of SB E (Perimeter SF for **SF 08** Silt Fence SBE) Removed **Current Condition:** Removed - Silt fence was removed during the SWPPP modification on 12/10/19. SF 09 Silt Fence Grid F2 9/2/2020 Active **Current Condition:** Fair Condition - Graham Construction installed a silt fence wrap around the grate inlet upstream of the culvert at STA 57+00 prior to the inspection on 9/02/20. Graham maintained the silt fence prior to the 12/9/20 inspection. Maintenance will be sent to Belterra as of 4/2/21. Previously named SF 12 under the Schram Road grading permit. Now under the Belterra permit as of 4/2/21. Hausman was removing all silt from the wetlands and from around the inlet during the inspection on 7/27/21. E&A inspector will continue to monitor for silt fence reinstallation. Hausman cleaned out, repaired, and reinstalled the silt fence around the grate inlet prior to the 8/2/21 inspection. Hausman installed additional high porosity silt fence checks in the area of the grate inlet prior to the 8/2/21 inspection. One of the silt fence checks needs to be repaired. Graves Development was informed to complete by 8/16/21. Not done as of the last inspection. Graves Development was reminded on 9/2/21, 9/16/21, 9/23/21 (CIR#15034), 10/22/21, 10/27/21, 11/2/21 (CIR #15322), 12/2/21, 12/7/21 SF 10 X15-BB15 7/27/2021 Silt Fence Active

Current Condition:	Commercial Seeding r	epaired, cleaned out,		tiple interior streets prior to t ence prior to the inspection			
	Silt fence should be repaired where removed for utility installation. Graves Development was informed to complete by 12/7/21. Not done as of the last inspection. Graves Development was reminded on 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22						
SF 11	Silt Fence	O13-M13	7/27/2021	Active	Yes		
Current Condition:	Fair Condition - Commercial Seeding installed silt fence prior to the inspection on 7/27/21. Silt fence was partially removed for utility work prior to the inspection on 11/16/21. Silt fence should be repaired where removed for utility installation. Graves Development was informed to complete by 12/7/21. Not done as of the last inspection. Graves Development was reminded on 12/7/21 (CIR #15550), 1/24/22 (CIR #15852), 2/10/22						
SF 12	Silt Fence	M14-J15	7/27/2021	Active	No		
Current Condition:	Good Condition - Com repaired the silt fence			he inspection on 7/27/21. C	commercial Seeding		
SF 13	Silt Fence	I15-G16	7/27/2021	Active	No		
Current Condition:	repaired the silt fence	prior to the inspection	n on 11/8/21.	he inspection on 7/27/21. Co	ommercial Seeding		
SF 14	Silt Fence	H8	7/27/2021	Active	No		
Current Condition:	Good Condition - Com	mercial Seeding insta	alled silt fence prior to the	he inspection on 7/27/21.			
SF 15	Silt Fence	H5-J4	7/27/2021	Active	No		
Current Condition:		mercial Seeding insta	alled silt fence prior to the	he inspection on 7/27/21. Co			
SF 16	Silt Fence	O3-P5	7/27/2021	Pending	No		
Current Condition:				ection on 7/27/21. Graves De	-		
SF 17 Current Condition:	inspector will continue Silt Fence	to monitor. O5-P7	7/27/2021	Active Active he inspection on 7/27/21. Co	No		
	repaired the silt fence	prior to the inspection		was partially removed for ut			
STR	Streets	On Site	10/31/2019	Active	Yes		
Current Condition:	on all interior streets of All interior and exterior Graves Development of contracted to clean the	bserved during the instruction of the streets (Schram RD) was informed to complet interior streets on 7, 11, 9/16/21, 9/23/21 (spection on 7/15/21. should be cleaned. plete by 7/19/21. Not do /16/21. Graves Develop CIR#15034), 10/22/21,	one as of the last inspection. Oment was reminded to clear 10/27/21, 11/2/21 (CIR #15)	. Commercial seed was n exterior streets on		
SWPPP Sign 01	SWPPP Signs	(AA15)	10/31/2019	Active CE1 during the inspection of	No No		
Current Condition: Certification Statement:	"I certify, under penalty direction or supervision properly gathered and persons who manage the information submit	y of law, that this doc n in accordance with evaluated the inform the system or those p ted is, to the best of re significant penaltie	ument and all attachme a system designed to a ation submitted. Based persons directly respons my knowledge and belie s for submitting false in	CE1 during the inspection of our service prepared under my assure that qualified personn on my inquiry of the person sible for gathering the information, true, accurate, and compiformation including the possion.	y nel or nation, lete. I		
Inspector Signature:	13	Baya M Waght		Reviewed By:	Cato Sols		