

E & A Consulting Group, Inc.
 10909 Mill Valley Road, Suite 100
 Omaha, NE 68154
 tel 402.895.4700
 fax 402.895.3599
 www.eacg.com



E & A CONSULTING GROUP, INC.

Engineering Answers

Zachary A. Jilek, CPESC, CISEC
 Environmental Services Dept. Manager

E&A- P2017.258.000

| | | |
|------------------------|---|--------------|
| Inspector: Joe Manning | | Stage |
| Project Name: | Ashbury Hills CSW-201802941 / PAP-20180830-4699-GP1 | 1 |
| For Week Ending: | 11/12/2022 | 68046 |
| Project Location: | 120th Street and Schram Road, Papillion, NE (Sarpy County) | |

| | | | | |
|----------------------|-----|--|--|--|
| Grading: | 97% | | | |
| Sanitary Sewer: | 96% | | | |
| Storm Sewer: | 96% | | | |
| Paving: | 96% | | | |
| Seeding: | 90% | | | |
| Utilities: | 90% | | | |
| Overall Development: | 48% | | | |

| RAIN FALL AMOUNTS | Amount in tenths | Date inspected | Weather Conditions | Time | |
|-------------------|------------------|------------------|---------------------|----------------|---------------|
| | | | | | Week 1 |
| Sunday: | 0.00" | | | | |
| Monday: | 0.00" | | | | |
| Tuesday: | 0.00" | | | | |
| Wednesday: | 0.00" | 11/9/2022 | Cloudy 74/50 | 11:40AM | |
| Thursday: | 0.00" | | | | |
| Friday: | 0.00" | | | | |
| Saturday: | 0.00" | | | | |

| | |
|--------------------|------|
| Complaints: | None |
|--------------------|------|

Construction Sequencing:

Which portion(s) (i.e. drainage basins) of the site have had a temporary or permanent cessation of grading, earthwork, or ground disturbance in the last 14 days?

Entire Site: Grading commenced (11/8/18) Grading has begun in Drainage Areas Dev. 2, Dev. 3, and Dev. 4 (11/15/18). Grading has temporarily ceased due to winter conditions. Minor grading/regrading W of SB 3 to redirect water flowing off site to east (4/13/19). Stockpiling in the western portion of Dev 2 (4/24/19). Grading has begun in the western portion of Dev 2 (5/9/19). Stripping/Grading in southern portion of Dev A and throughout Dev 5 (6/13/19). Stripping/Grading in northeastern portion of Dev 2 (6/27/19) Minor regrading/excavation in DEV 3 -School (7/31/19). Excavation in Dev 3 and Dev 4 for sanitary installation (08/08/19). Trenching in Dev 4 for utility installation (09/04/19). Grading has temporarily ceased throughout the site (10/11/19). Grading has resumed for basin installation (10/16/19) Grading has resumed throughout the site (10/22/19). Excavation near SB 4 for basin installation (10/22/19). Excavation along the northern perimeter of the site near 120th St for sanitary tie-in (10/31/19). Stripping/grading in DEV A (10/31/19). Disking occurring in Dev 4 (11/7/19). Sanitary installation in Dev 2/3 (11/7/19). Grading in Dev 5 and Dev A for basin excavation (11/14/19). Fine grading in Dev 4 and Dev 3 in preparation for paving (11/14/19). Grading in Dev A (12/12/19). Grading has temporarily ceased due to winter conditions (1/23/20). Grading has resumed (4/27/20); Backfilling of curbs for paving underway (10/21/2020). Excavation on Lot 110 (12/22/20). Grading on eastern side of Dev 2 (1/12/21). Grading in Dev A, and northern portion of Dev 2 (2/23/21). Excavation by 124th st and Gold Coast Rd (3/4/21). Excavation by 125th and Edward St, and sidewalk pavement near east end of Gold Coast Rd (3/10/21). Utilities were put in the southwest corner of the site (4/21/21). Grading in SW corner of site by Calabretto Building Group (9/8/21). Ground disturbance for sewer installation around Outlot L (7/27/22). Ground disturbance west of SB 4 for sewer installation (10/19/2022).

Which portion(s) (i.e. drainage basins) of the site do not have grading, earthwork, or ground disturbance scheduled in the next 14 days? :

Entire Site: Grading commenced (11/8/18) Grading has begun in Drainage Areas Dev. 2, Dev. 3, and Dev. 4 (11/15/18). Grading has temporarily ceased due to winter conditions. Minor grading/regrading W of SB 3 to redirect water flowing off site to east (4/13/19). Stockpiling in the western portion of Dev 2 (4/24/19). Grading has begun in the western portion of Dev 2 (5/9/19). Stripping/Grading in southern portion of Dev A and throughout Dev 5 (6/13/19). Stripping/Grading in northeastern portion of Dev 2 (6/27/19) Minor regrading/excavation in DEV 3 -School (7/31/19). Excavation in Dev 3 and Dev 4 for sanitary installation (08/08/19). Trenching in Dev 4 for utility installation (09/04/19). Grading has temporarily ceased throughout the site (10/11/19). Grading has resumed for basin installation (10/16/19) Grading has resumed throughout the site (10/22/19). Excavation near SB 4 for basin installation (10/22/19). Excavation along the northern perimeter of the site near 120th St for sanitary tie-in (10/31/19). Stripping/grading in DEV A (10/31/19). Disking occurring in Dev 4 (11/7/19). Sanitary installation in Dev 2/3 (11/7/19). Grading in Dev 5 and Dev A for basin excavation (11/14/19). Fine grading in Dev 4 and Dev 3 in preparation for paving (11/14/19). Grading in Dev A (12/12/19). Grading has temporarily ceased due to winter conditions (1/23/20). Grading has resumed (4/27/20); Backfilling of curbs for paving underway (10/21/20). Excavation on Lot 110 (12/22/20). Grading on eastern side of Dev 2 (1/12/21). Grading in Dev A, and northern portion of Dev 2 (2/23/21). Excavation by 124th st and Gold Coast Rd (3/4/21). Excavation by 125th and Edward St, and sidewalk pavement near east end of Gold Coast Rd (3/10/21). Utilities were put in the southwest corner of the site (4/21/21). Grading in SW corner of site by Calabretto Building Group (9/8/21). Ground disturbance for sewer installation around Outlot L (7/27/22.) Ground disturbance west of SB 4 for sewer installation (10/19/2022).

What temporary or permanent stabilization measures listed in this section are being implemented?

Existing vegetation (11/8/18). EM 1 partially installed (09/30/19). DEJ seeded the central drainage around the future S. 124th St., the slope in the northeastern quadrant of the site (6/16/20); school site was sodded (12/9/20). ROW seeding began (6/2/21). Matting of the slope west of S 120th entrance (8/25/21). Seeding / matting Outlots F, G, H, and ROW overseeding (4/1/22).

Checklist Questions:

Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?

No

Create Corrective Action?

No, See BMP Section

Have disturbed areas been seeded or otherwise stabilized as required? List inactive portions of the project and if stabilization measure are adequate or needed to prevent erosion.

Yes

Create Corrective Action?



| N/A | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|---|--|--|------------------------|---------|-------------|-------------|------|----------|------------------------|--------|-------------|-----|-----------------------|------|--|---------|--|---------------------------|---|--|--|--|--|-----|----------------|-----------------------------------|--|---------|--|---------------------------|---|--|--|--|--|-----|----------------|-------------------------------------|--|---------|--|---------------------------|---|--|--|--|--|------|----------------------------------|-------------------|--|---------|--|---------------------------|---|--|--|--|--|------|----------------------------------|--------------------|--|---------|--|---------------------------|---|--|--|--|--|------|----------------------------------|-------------------|--|---------|--|---------------------------|--|--|--|--|--|------|------------------|---------------|--|---------|--|---------------------------|---|--|--|--|--|------|------------------|--|-----------|--------|----|---------------------------|--|--|--|--|--|-----|---------------------------|------------|--|---------|--|---------------------------|---|--|--|--|--|-----|---------------------------|---------|--|---------|--|---------------------------|--|--|--|--|--|-----|---------------------------|-----------|-----------|--------|----|---------------------------|--|--|--|--|--|-----|---------------------------|-------------|--|---------|--|---------------------------|---|--|--|--|--|-----|---------------------------|----------|-----------|---------|----|---------------------------|--|--|--|--|--|-----|---------------------------|------------|--|---------|--|
| Are waste materials (concrete, construction material, hazardous, etc.) being managed properly? | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| No | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Create Corrective Action? | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| No, See BMP Section | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Are construction entrances and adjacent streets being maintained adequately? | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| No | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Create Corrective Action? | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| No, See BMP Section | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Is dust associated with the construction activity adequately controlled on the site? | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Yes | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Create Corrective Action? | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| N/A | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Comments: | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Comments: | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 1) Site was active for home construction and storm sewer installation during the last inspection. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 2) Ashbury Hills Self Storage (CSW-202105789) is active on Lot 166 of the Ashbury Hills development as of 9/13/21. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Findings / Corrective Actions (Date): | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Findings / Corrective Actions (Date): | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 1) Some maintenance is required in the BMP section. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 2) E&A will monitor the removal of the inlet filters around the school project with the site stabilization. E&A inspector received an email from Tyson Smith with Lamp Rynearson 1/11/21 that they did not recommend putting inlet filters around the school. GPCS was informed to remove the inlet filters by 3/11/21. GPCS removed 5 inlet filters prior to the 3/24/21 inspection. As of 4/9/21 there are two inlet filters left by the school, E&A inspector will continue to monitor. GPCS was reminded on 4/30/21, 5/4/21, 5/6/21, 5/11/2021, 5/19/21, 5/30/21, 6/25/21, 7/14/21, 8/13/21, 9/10/21, 9/30/21. Peter Katt, Gene Graves, and Commercial Seeding were reminded on 10/14/21, 11/3/21 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| <table border="1"> <thead> <tr> <th>Unique Name</th> <th>Type</th> <th>Location</th> <th>Projected Install Date</th> <th>Status</th> <th>Maintenance</th> </tr> </thead> <tbody> <tr> <td>A 1</td> <td>Area Inlet Protection</td> <td>R 16</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - Silt fence around the inlet will not be recommended as of 4/16/21 due to inlet leading to a sediment basin.</td> </tr> <tr> <td>B 1</td> <td>Temporary Berm</td> <td>North side of site (west of SB 2)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - DEJ Grading removed the temporary berm during the excavation of SB 5 prior to inspection on 11/14/19.</td> </tr> <tr> <td>B 2</td> <td>Temporary Berm</td> <td>Southwest side of site (NE of SB 5)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - DEJ Grading removed the berms prior to inspection on 12/18/19. The berms are not needed at this time. E&A will monitor.</td> </tr> <tr> <td>CE 1</td> <td>Stabilized Construction Entrance</td> <td>Schram Road (W27)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - The construction entrance is no longer necessary as it is removed and no longer in use due to the Schram Road Improvements project grading reaching the area as of the inspection on 8/18/20.</td> </tr> <tr> <td>CE 2</td> <td>Stabilized Construction Entrance</td> <td>Schram Road (AA27)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - Prairie Construction installed a construction entrance prior to inspection on 7/2/19 for school construction. Since this BMP is associated with the school project, E&A will no longer inspect its effectiveness as of the 10/11/19 inspection.</td> </tr> <tr> <td>CE 3</td> <td>Stabilized Construction Entrance</td> <td>Schram Road (O27)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - Graham Construction removed the entrance to prep the area for paving prior to the inspection on 9/24/20. Reinstallation is not necessary due to grading for the Scram Road Improvements (114th to 132nd Street) project reaching the entrance location prior to the inspection on 9/24/20.</td> </tr> <tr> <td>CW 1</td> <td>Concrete Washout</td> <td>North of SB 4</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed- Tab Construction removed the washout pit prior to 11/18/20</td> </tr> <tr> <td>CW 2</td> <td>Concrete Washout</td> <td>Outlot A-South 124th Street & Horizon Street</td> <td>5/19/2021</td> <td>Active</td> <td>No</td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Good Condition- GPCS installed the washout pit prior to the inspection on 5/19/21. Sudbeck Homes cleaned out the washout and cleaned up concrete waste adjacent to the washout prior to the inspection on 3/7/22. Sudbeck Homes installed a berm along the front of the washout prior to the inspection on 3/7/22.</td> </tr> <tr> <td>D 1</td> <td>Temporary Diversion Ditch</td> <td>(BB8-BB15)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - The majority of the diversion was graded out prior to the inspection on 9/24/20. Reinstallation does not appear necessary at this time due to establishment of vegetation in the upstream area.</td> </tr> <tr> <td>D 2</td> <td>Temporary Diversion Ditch</td> <td>(Q1-V2)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed - The diversion is no longer necessary as of the inspection on 8/27/20 due to paving of S. 123rd Avenue, which will divert water via curb inlets to the basin.</td> </tr> <tr> <td>D 3</td> <td>Temporary Diversion Ditch</td> <td>(C20-C26)</td> <td>8/27/2020</td> <td>Active</td> <td>No</td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Good Condition - DEJ installed the diversion prior to the inspection on 8/27/20. Commercial Seeding redefined the diversion prior to the inspection on 11/11/21.</td> </tr> <tr> <td>D 4</td> <td>Temporary Diversion Ditch</td> <td>(BB21-BB25)</td> <td></td> <td>Removed</td> <td></td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Removed- Due to pavement operations and school work, diversion ditch was removed as of 10/21/2020</td> </tr> <tr> <td>D 5</td> <td>Temporary Diversion Ditch</td> <td>(X2-BB6)</td> <td>8/27/2020</td> <td>Pending</td> <td>No</td> </tr> <tr> <td>Current Condition:</td> <td colspan="5">Pending - Perimeter silt fence and existing vegetation are adequately controlling sediment as of the 7/10/21 inspection. Installing the diversion is not recommended at this time. E&A inspector will continue to monitor.</td> </tr> <tr> <td>D 6</td> <td>Temporary Diversion Ditch</td> <td>(V27-AA27)</td> <td></td> <td>Removed</td> <td></td> </tr> </tbody> </table> | | | | | | Unique Name | Type | Location | Projected Install Date | Status | Maintenance | A 1 | Area Inlet Protection | R 16 | | Removed | | Current Condition: | Removed - Silt fence around the inlet will not be recommended as of 4/16/21 due to inlet leading to a sediment basin. | | | | | B 1 | Temporary Berm | North side of site (west of SB 2) | | Removed | | Current Condition: | Removed - DEJ Grading removed the temporary berm during the excavation of SB 5 prior to inspection on 11/14/19. | | | | | B 2 | Temporary Berm | Southwest side of site (NE of SB 5) | | Removed | | Current Condition: | Removed - DEJ Grading removed the berms prior to inspection on 12/18/19. The berms are not needed at this time. E&A will monitor. | | | | | CE 1 | Stabilized Construction Entrance | Schram Road (W27) | | Removed | | Current Condition: | Removed - The construction entrance is no longer necessary as it is removed and no longer in use due to the Schram Road Improvements project grading reaching the area as of the inspection on 8/18/20. | | | | | CE 2 | Stabilized Construction Entrance | Schram Road (AA27) | | Removed | | Current Condition: | Removed - Prairie Construction installed a construction entrance prior to inspection on 7/2/19 for school construction. Since this BMP is associated with the school project, E&A will no longer inspect its effectiveness as of the 10/11/19 inspection. | | | | | CE 3 | Stabilized Construction Entrance | Schram Road (O27) | | Removed | | Current Condition: | Removed - Graham Construction removed the entrance to prep the area for paving prior to the inspection on 9/24/20. Reinstallation is not necessary due to grading for the Scram Road Improvements (114th to 132nd Street) project reaching the entrance location prior to the inspection on 9/24/20. | | | | | CW 1 | Concrete Washout | North of SB 4 | | Removed | | Current Condition: | Removed- Tab Construction removed the washout pit prior to 11/18/20 | | | | | CW 2 | Concrete Washout | Outlot A-South 124th Street & Horizon Street | 5/19/2021 | Active | No | Current Condition: | Good Condition- GPCS installed the washout pit prior to the inspection on 5/19/21. Sudbeck Homes cleaned out the washout and cleaned up concrete waste adjacent to the washout prior to the inspection on 3/7/22. Sudbeck Homes installed a berm along the front of the washout prior to the inspection on 3/7/22. | | | | | D 1 | Temporary Diversion Ditch | (BB8-BB15) | | Removed | | Current Condition: | Removed - The majority of the diversion was graded out prior to the inspection on 9/24/20. Reinstallation does not appear necessary at this time due to establishment of vegetation in the upstream area. | | | | | D 2 | Temporary Diversion Ditch | (Q1-V2) | | Removed | | Current Condition: | Removed - The diversion is no longer necessary as of the inspection on 8/27/20 due to paving of S. 123rd Avenue, which will divert water via curb inlets to the basin. | | | | | D 3 | Temporary Diversion Ditch | (C20-C26) | 8/27/2020 | Active | No | Current Condition: | Good Condition - DEJ installed the diversion prior to the inspection on 8/27/20. Commercial Seeding redefined the diversion prior to the inspection on 11/11/21. | | | | | D 4 | Temporary Diversion Ditch | (BB21-BB25) | | Removed | | Current Condition: | Removed- Due to pavement operations and school work, diversion ditch was removed as of 10/21/2020 | | | | | D 5 | Temporary Diversion Ditch | (X2-BB6) | 8/27/2020 | Pending | No | Current Condition: | Pending - Perimeter silt fence and existing vegetation are adequately controlling sediment as of the 7/10/21 inspection. Installing the diversion is not recommended at this time. E&A inspector will continue to monitor. | | | | | D 6 | Temporary Diversion Ditch | (V27-AA27) | | Removed | |
| Unique Name | Type | Location | Projected Install Date | Status | Maintenance | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| A 1 | Area Inlet Protection | R 16 | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - Silt fence around the inlet will not be recommended as of 4/16/21 due to inlet leading to a sediment basin. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| B 1 | Temporary Berm | North side of site (west of SB 2) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - DEJ Grading removed the temporary berm during the excavation of SB 5 prior to inspection on 11/14/19. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| B 2 | Temporary Berm | Southwest side of site (NE of SB 5) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - DEJ Grading removed the berms prior to inspection on 12/18/19. The berms are not needed at this time. E&A will monitor. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| CE 1 | Stabilized Construction Entrance | Schram Road (W27) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - The construction entrance is no longer necessary as it is removed and no longer in use due to the Schram Road Improvements project grading reaching the area as of the inspection on 8/18/20. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| CE 2 | Stabilized Construction Entrance | Schram Road (AA27) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - Prairie Construction installed a construction entrance prior to inspection on 7/2/19 for school construction. Since this BMP is associated with the school project, E&A will no longer inspect its effectiveness as of the 10/11/19 inspection. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| CE 3 | Stabilized Construction Entrance | Schram Road (O27) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - Graham Construction removed the entrance to prep the area for paving prior to the inspection on 9/24/20. Reinstallation is not necessary due to grading for the Scram Road Improvements (114th to 132nd Street) project reaching the entrance location prior to the inspection on 9/24/20. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| CW 1 | Concrete Washout | North of SB 4 | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed- Tab Construction removed the washout pit prior to 11/18/20 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| CW 2 | Concrete Washout | Outlot A-South 124th Street & Horizon Street | 5/19/2021 | Active | No | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Good Condition- GPCS installed the washout pit prior to the inspection on 5/19/21. Sudbeck Homes cleaned out the washout and cleaned up concrete waste adjacent to the washout prior to the inspection on 3/7/22. Sudbeck Homes installed a berm along the front of the washout prior to the inspection on 3/7/22. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| D 1 | Temporary Diversion Ditch | (BB8-BB15) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - The majority of the diversion was graded out prior to the inspection on 9/24/20. Reinstallation does not appear necessary at this time due to establishment of vegetation in the upstream area. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| D 2 | Temporary Diversion Ditch | (Q1-V2) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed - The diversion is no longer necessary as of the inspection on 8/27/20 due to paving of S. 123rd Avenue, which will divert water via curb inlets to the basin. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| D 3 | Temporary Diversion Ditch | (C20-C26) | 8/27/2020 | Active | No | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Good Condition - DEJ installed the diversion prior to the inspection on 8/27/20. Commercial Seeding redefined the diversion prior to the inspection on 11/11/21. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| D 4 | Temporary Diversion Ditch | (BB21-BB25) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Removed- Due to pavement operations and school work, diversion ditch was removed as of 10/21/2020 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| D 5 | Temporary Diversion Ditch | (X2-BB6) | 8/27/2020 | Pending | No | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Current Condition: | Pending - Perimeter silt fence and existing vegetation are adequately controlling sediment as of the 7/10/21 inspection. Installing the diversion is not recommended at this time. E&A inspector will continue to monitor. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| D 6 | Temporary Diversion Ditch | (V27-AA27) | | Removed | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |

| | | | | | |
|---------------------------|---|-------------|------------|---------|-----|
| Current Condition: | Removed - The diversion will not be necessary as of the inspection on 7/29/20 due to stabilization by vegetation in part of the intended location as well as the start of grading / activity for the Schram Road Improvements project in the remainder of the intended location. | | | | |
| D 7 | Temporary Diversion Ditch | (E28-P28) | 8/27/2020 | Active | No |
| Current Condition: | Good Condition - DEJ installed the diversion prior to the inspection on 8/27/20. DEJ redefined the diversion prior to the inspection on 6/15/21. | | | | |
| D 8 | Temporary Diversion Ditch | (B8-B13) | 8/27/2020 | Active | No |
| Current Condition: | Good Condition - DEJ installed the diversion prior to the inspection on 8/27/20. GPCS redefined the diversion prior to the inspection on 5/19/21. | | | | |
| D 9 | Temporary Diversion Ditch | (C3-E2) | | Removed | |
| Current Condition: | Removed- Due to pavement operations and school work, diversion ditch was removed as of 10/21/2020 | | | | |
| EM 1 | Erosion Control Matting | (CC20-CC27) | 9/30/2019 | Active | No |
| Current Condition: | Good Condition - Erosion control matting installation was underway during inspection on 9/30/19. E&A will monitor for completion of installation during future inspections. Approximately 95% of the matting was installed as of the 10/22/19 inspection. | | | | |
| EM 2 | Erosion Control Matting | B5 | 11/15/2018 | Pending | No |
| Current Condition: | Pending - Will be installed when grading of area is complete. | | | | |
| EM 3 | Erosion Control Matting | D3 | 11/15/2018 | Pending | No |
| Current Condition: | Pending - Will be installed when grading of area is complete. | | | | |
| ET 1 | Erosion Control Terrace | C 12-21 | | Removed | |
| Current Condition: | Removed - The erosion control terrace has been removed and replaced with D-3 and D-8 as of the inspection on 8/27/20. | | | | |
| FT 1 | Fuel Tanks | O23 | | Removed | |
| Current Condition: | Removed - Roth Enterprises removed the fuel tank prior to the inspection on 5/26/20. | | | | |
| FT X | Fuel Tank | Site | | Removed | |
| Current Condition: | Removed - Tab Construction removed the fuel tank prior to the inspection on 10/27/22. | | | | |
| Lot 1 | Individual Lot | Lot 1 | | Removed | |
| Current Condition: | Removed - Ideal Designs sodded the lot prior to the 5/18/22 inspection. | | | | |
| Lot 4 | Individual Lot | Lot 4 | | Removed | |
| Current Condition: | Removed - Belt Construction sodded the lot prior to the inspection on 11/16/21. | | | | |
| Lot 5 | Individual Lot | Lot 5 | | Removed | |
| Current Condition: | Removed - Peter Young sodded the lot prior to the inspection on 11/16/21. | | | | |
| Lot 6 | Individual Lot | Lot 6 | | Removed | |
| Current Condition: | Removed - Belt Construction sodded the lot prior to the 11/11/21 inspection. | | | | |
| Lot 7 | Individual Lot | Lot 7 | 10/27/2022 | Active | Yes |
| Current Condition: | Active - AI Belt began excavating the lot prior to the inspection on 10/27/22. A dirt pile was observed in the ROW during the 10/27/22 inspection, however, due to active excavation, E&A inspector will monitor for removal. The street in front of the lot should be cleaned. AI Belt was informed to complete by 11/10/22. | | | | |
| Lot 8 | Individual Lot | Lot 8 | 9/27/2022 | Active | No |
| Current Condition: | Active - Baranko Homes began excavating the lot prior to the inspection on 9/27/22. The front and rear of the lot are mostly flat, so no BMPs are recommended at this time. E&A inspector will monitor. A dirt pile was observed in the ROW, however Baranko Homes was actively excavating during the inspection on 10/6/22. Baranko Homes removed the dirt pile prior to the inspection on 10/27/22. | | | | |
| Lot 10 | Individual Lot | Lot 10 | 6/21/2022 | Active | No |
| Current Condition: | Active - JC Custom Build began excavating the lot prior to the inspection on 6/21/22. Due to vegetation surrounding the lot, no BMPs will be recommended at this time. E&A inspector will monitor. | | | | |
| Lot 11 | Individual Lot | Lot 1 | 4/27/2022 | Active | No |
| Current Condition: | Good Condition - The homeowner began excavating the lot prior to the 4/27/22 inspection. Dirt piles were observed in the ROW on 4/27/22. The homeowner removed the dirt piles from the ROW prior to the 5/3/22 inspection. The homeowner installed silt fence along the rear of the lot prior to the inspection on 6/29/22. | | | | |
| Lot 17 | Individual Lot | Lot 17 | 5/18/2022 | Active | No |
| Current Condition: | Good Condition - Timeless Homes began excavating the lot prior to the 5/18/22 inspection. Dirt piles were observed in the ROW on 5/18/22. Due to active foundation work, removal is not recommended at this time. E&A inspector will continue to monitor for BMP installation. Timeless Homes removed the dirt pile prior to the inspection on 8/16/22. Timeless Homes secured a portable toilet on the lot prior to the inspection on 8/24/22. | | | | |
| Lot 19 | Individual Lot | Lot 19 | | Removed | |
| Current Condition: | Removed - Belt Construction sodded the lot prior to the 5/18/22 inspection. | | | | |
| Lot 26 | Individual Lot | Lot 26 | | Removed | |
| Current Condition: | Removed - Timeless Homes sodded the lot prior to the inspection on 6/21/22. | | | | |
| Lot 27 | Individual Lot | Lot 27 | 5/18/2022 | Active | No |
| Current Condition: | Active - Timeless Homes began excavating the lot prior to the 5/18/22 inspection. Dirt piles were observed in the ROW on 8/3/22. Due to active sewer hook-up, removal is not recommended at this time. Timeless Homes removed the dirt piles prior to the inspection on 8/16/22. | | | | |
| Lot 29 | Individual Lot | Lot 29 | | Removed | |
| Current Condition: | Removed - Colony Custom Homes sodded the lot prior to the inspection on 6/29/22. | | | | |
| Lot 32 | Individual Lot | Lot 32 | | Removed | |
| Current Condition: | Removed - Belt Construction sodded the lot prior to the inspection on 9/08/22. | | | | |
| Lot 35 | Individual Lot | Lot 35 | | Removed | |
| Current Condition: | Removed - The homeowner (Ms. Ravichandar) sodded the lot and cleaned the street prior to the inspection on 9/12/22. | | | | |
| Lot 44 | Individual Lot | Lot 44 | 4/1/2022 | Pending | Yes |

| | | | | | |
|---------------------------|--|---------|------------|---------|-----|
| Current Condition: | Pending - KRT Construction began excavating the lot prior to the 4/1/22 inspection. Dirt piles were observed in the ROW on 4/1/22. KRT Construction removed the dirt piles prior to the 4/14/22 inspection. 1.) Silt fence or straw wattles should be installed along the front of the lot. 2.) The street in front of the lot should be cleaned. 1.) KRT Construction was informed to complete by 11/16/22. 2.) KRT Construction was informed to complete by 11/16/22. | | | | |
| Lot 45 | Individual Lot | Lot 45 | 7/14/2022 | Pending | Yes |
| Current Condition: | Pending - Belt Construction began excavating the lot prior to the 7/14/22 inspection. Dirt piles were observed in the ROW on 7/14/22. Belt Construction removed the dirt piles prior to the inspection on 8/24/22. 1.) Silt fence or straw wattles should be installed along the front of the lot. 2.) The street in front of the lot should be cleaned. 1.) Belt Construction was informed to complete by 8/31/22. Not done as of the last inspection. Belt Construction was reminded on 11/09/22. 2.) Belt Construction was informed to complete by 8/25/22. Not done as of the last inspection. Belt Construction was reminded on 11/09/22. | | | | |
| Lot 47 | Individual Lot | Lot 47 | 4/7/2022 | Active | No |
| Current Condition: | Good Condition - Legacy Homes began excavating the lot prior to the 4/7/22 inspection. Dirt piles were observed in the ROW on 4/7/22. Legacy Homes removed the dirt piles prior to the 4/27/22 inspection. The front of the lot is mostly flat the rear of the lot is vegetated, so no BMPs are recommended at this time. Legacy Homes secured a portable toilet across from the lot prior to the 5/26/22 inspection. | | | | |
| Lot 58 | Individual Lot | Lot 58 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the northeast and southeast corners of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 70 | Individual Lot | Lot 70 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the southeast corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 90 | Individual Lot | Lot 90 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the northeast corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 111 | Individual Lot | Lot 111 | | Removed | |
| Current Condition: | Removed - Legacy Homes sodded the lot prior to the inspection on 11/16/21. | | | | |
| Lot 112 | Individual Lot | Lot 112 | 4/29/2021 | Active | No |
| Current Condition: | Good Condition - See lot 111 for more information as of 4/29/21. Legacy Homes repaired the wattles prior to the inspection on 6/15/21. Legacy Homes re-secured and extended the wattles prior to the inspection on 10/13/21. Legacy Homes installed silt fence on the northeast corner of the lot prior to the 7/27/22 inspection. The silt fence was damaged prior to the inspection on 9/08/22. Based on stabilization of the lot, recommendations will not be made until the lot becomes active. | | | | |
| Lot 114 | Individual Lot | Lot 114 | 7/27/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Legacy Homes installed silt fence along the south side and rear of the lot prior to the 7/27/22 inspection. | | | | |
| Lot 115 | Individual Lot | Lot 115 | 7/27/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Legacy Homes installed silt fence along the rear of the lot prior to the 7/27/22 inspection. | | | | |
| Lot 116 | Individual Lot | Lot 116 | 7/27/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Legacy Homes installed silt fence along the rear of the lot prior to the 7/27/22 inspection. | | | | |
| Lot 120 | Individual Lot | Lot 120 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the southeast corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 126 | Individual Lot | Lot 126 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the northeast corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 131 | Individual Lot | Lot 131 | | Removed | |
| Current Condition: | Removed - Legacy Homes sodded the lot prior to the inspection on 7/27/22. | | | | |
| Lot 132 | Individual Lot | Lot 132 | 10/28/2021 | Active | Yes |
| Current Condition: | Fair Condition - This lot is inactive for construction. Legacy Homes disturbed the lot during home-building activities on adjacent lots prior to the 10/28/21 inspection. Silt fence should be extended or wattles should be installed across the front of the lot and repaired where damaged. Legacy Homes was informed to complete by 11/4/21. Not done as of last inspection. Legacy Homes was reminded on 12/2/21, 12/23/21, 1/27/22, 3/3/22, 4/7/22, 5/20/22, 7/15/22, 9/09/22 | | | | |
| Lot 133 | Individual Lot | Lot 133 | | Removed | |
| Current Condition: | Removed - Legacy Homes sodded the lot prior to the inspection on 7/27/22. | | | | |
| Lot 134 | Individual Lot | Lot 134 | | Removed | |
| Current Condition: | Removed - Legacy Homes sodded the lot prior to the inspection on 7/27/22. | | | | |
| Lot 135 | Individual Lot | Lot 135 | 10/28/2021 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Legacy Homes disturbed the lot during home-building activities on adjacent lots prior to the 10/28/21 inspection. Legacy Homes installed silt fence along the front corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 136 | Individual Lot | Lot 136 | 6/22/2021 | Active | No |
| Current Condition: | Good Condition - Legacy Homes began excavating the lot prior to the inspection on 6/22/21. Legacy Homes installed silt fence along the front corner of the lot prior to the 8/3/22 inspection. | | | | |

| | | | | | |
|---------------------------|--|------------------|------------|---------|----|
| Lot 137 | Individual Lot | Lot 137 | 6/30/2021 | Active | No |
| Current Condition: | Good Condition - Legacy Homes began excavating the lot prior to the inspection on 6/30/21. Legacy Homes installed silt fence along the front corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 139 | Individual Lot | Lot 139 | 7/7/2021 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the northeast corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 140 | Individual Lot | Lot 140 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the southeast corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 147 | Individual Lot | Lot 147 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the northwest corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 153 | Individual Lot | Lot 153 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the northwest corner of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 154 | Individual Lot | Lot 154 | 6/22/2021 | Active | No |
| Current Condition: | Good Condition - Legacy Homes began excavating the lot prior to the inspection on 6/22/21. Legacy Homes installed silt fence along the front corners of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 159 | Individual Lot | Lot 159 | 7/21/2021 | Active | No |
| Current Condition: | Good Condition - Legacy Homes began excavating the lot prior to the inspection on 7/21/21. Legacy Homes installed silt fence along the front corners of the lot prior to the 8/3/22 inspection. | | | | |
| Lot 3, Replat 1 | Individual Lot | Lot 3, Replat 1 | 8/3/2022 | Active | No |
| Current Condition: | Active - An unidentified builder began excavating the lot prior to the inspection on 8/3/22. The front and rear of the lot are mostly flat, so no BMPs are recommended at this time. Dirt piles were observed in the ROW on 8/3/22. The unidentified builder removed the dirt piles from the ROW prior to the inspection on 8/16/22. | | | | |
| Lot 5, Replat 1 | Individual Lot | Lot 5, Replat 1 | | Removed | |
| Current Condition: | Removed - THI Builders sodded the lot prior to the 7/8/22 inspection. | | | | |
| Lot 6, Replat 1 | Individual Lot | Lot 6, Replat 1 | 12/22/2021 | Active | No |
| Current Condition: | Good Condition - Epcn Communities began excavating the lot prior to the inspection on 12/22/21. THI Builders placed a portable toilet prior to 3/7/22 inspection, but did not acknowledge ownership until 3/14/22. THI Builders secured the portable toilet prior to the 4/14/22 inspection. THI Builders installed silt fence along the north side of the lot prior to the inspection on 9/19/22. THI Builders sodded the lot prior to the inspection on 10/06/22. The silt fence was still in place during the inspection on 10/06/22. | | | | |
| Lot 7, Replat 1 | Individual Lot | Lot 7, Replat 1 | 12/22/2021 | Active | No |
| Current Condition: | Good Condition - Epcn Communities began excavating the lot prior to the inspection on 12/22/21. THI Builders installed silt fence along the north side of the lot prior to the inspection on 9/19/22. THI Builders sodded the lot prior to the inspection on 10/06/22. The silt fence was still in place during the inspection on 10/06/22. | | | | |
| Lot 8, Replat 1 | Individual Lot | Lot 8, Replat 1 | 12/29/2021 | Active | No |
| Current Condition: | Good Condition - Epcn Communities began excavating the lot prior to the inspection on 12/29/21. THI Builders installed silt fence along the north side of the lot prior to the inspection on 9/19/22. | | | | |
| Lot 9, Replat 1 | Individual Lot | Lot 9, Replat 1 | 12/29/2021 | Active | No |
| Current Condition: | Good Condition - Epcn Communities began excavating the lot and installed inlet protection over an existing inlet on Horizon Street prior to the inspection on 12/29/21. Bridgewater Homes installed inlet protection over an existing inlet on Horizon Street prior to the inspection on 12/29/21. Maintenance responsibility for the inlet protection on Horizon Street is assigned to THI Builders as of 3/7/22, but removal will be the responsibility of Bridgewater Homes. THI Builders cleaned out the inlet protection prior to the inspection on 10/06/22. | | | | |
| Lot 10, Replat 1 | Individual Lot | Lot 10, Replat 1 | 12/29/2021 | Active | No |
| Current Condition: | Good Condition - Epcn Communities began excavating the lot prior to the inspection on 12/29/21. THI Builders installed wattles on the east side of the lot prior to the 7/8/22 inspection. Bridgewater cleaned out the inlet protection on the east side of the lot prior to the inspection on 9/08/22. | | | | |
| Lot 11, Replat 1 | Individual Lot | Lot 11, Replat 1 | | Removed | |
| Current Condition: | Removed - Bridgewater Homes sodded the lot prior to the 5/18/22 inspection. | | | | |
| Lot 12, Replat 1 | Individual Lot | Lot 12, Replat 1 | | Removed | |
| Current Condition: | Removed - Bridgewater Homes sodded the lot prior to the 5/18/22 inspection. | | | | |
| Lot 13, Replat 1 | Individual Lot | Lot 13, Replat 1 | 7/8/2022 | Active | No |
| Current Condition: | Good Condition - Bridgewater Homes has been using the lot for their job trailer. Bridgewater Homes sodded part of the lot and installed wattles in the rear of the lot prior to the 7/8/22 inspection. | | | | |
| Lot 14, Replat 1 | Individual Lot | Lot 14, Replat 1 | 7/18/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Bridgewater Homes installed wattles in the rear of the lot prior to the 7/18/22 inspection. | | | | |
| Lot 15, Replat 1 | Individual Lot | Lot 15, Replat 1 | 7/18/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Bridgewater Homes installed wattles in the rear of the lot prior to the 7/18/22 inspection. | | | | |
| Lot 16, Replat 1 | Individual Lot | Lot 16, Replat 1 | | Removed | |
| Current Condition: | Removed - Bridgewater Homes sodded the lot prior to the 7/8/22 inspection. | | | | |
| Lot 17, Replat 1 | Individual Lot | Lot 17, Replat 1 | | Removed | |
| Current Condition: | Removed - Bridgewater Homes sodded the lot prior to the 7/8/22 inspection. | | | | |
| Lot 44, Replat 1 | Individual Lot | Lot 4, Replat 1 | 8/3/2022 | Active | No |
| Current Condition: | Good Condition - This lot is inactive for construction. Great Plains Contractor Services installed silt fence along the east corner of the lot prior to the 8/3/22 inspection. | | | | |
| PB 1 | Portable Bathroom | Site | | Removed | |
| Current Condition: | Removed - Kersten Construction removed the portable toilet prior to the 4/21/21 inspection. | | | | |
| PB 2 | Portable Bathroom | Site | | Removed | |
| Current Condition: | Removed - Legacy Homes removed the portable toilet prior to the 4/1/22 inspection. | | | | |
| PB X | Portable Bathroom | Site | | Removed | |

| | | | | | |
|---------------------------|--|-----------------------|------------|---------|-----|
| Current Condition: | Removed - Tab Construction removed the portable toilet prior to the inspection on 10/27/22. | | | | |
| SB 1 | Sediment Basin | B5 | 11/14/2019 | Active | Yes |
| Current Condition: | <p>Fair Condition - 9% Filled - DEJ Grading began excavation of the basin prior to inspection on 11/14/19. As of the last inspection, the basin is still missing the outlet structure, inlets, and the baffle. The outlet pipe was installed prior to inspection on 11/22/19. The riser is not in place as of the 11/22/19 inspection. DEJ Grading partially installed the riser prior to inspection on 12/12/19. DEJ closed the gaps between the riser and outlet pipe prior to the inspection on 7/21/20. Great Plains Contractor Services installed rip rap below the outfall prior to the inspection on 8/07/20. Roth Enterprises began cleaning out the basin prior to the inspection on 8/17/21. Roth finished cleaning out the basin and installing the baffle prior to the inspection on 9/8/21.</p> <p>The basin isn't draining correctly and a new riser with the correct dimensions should be installed.</p> <p>DEJ Grading was informed to complete by 6/16/21. Not done as of last inspection. DEJ was reminded on 7/9/21, 8/13/21, 8/26/21, 9/10/21, 10/29/21, 2/23/22, 8/5/22. Graves Development was reminded on 12/6/21. DEJ informed the E&A inspector on 2/23/22 that the new riser has been cast and is scheduled for delivery by 3/4/22. E&A inspector will continue to monitor for installation.</p> | | | | |
| SB 2 | Sediment Basin | V5 | 8/19/2019 | Active | No |
| Current Condition: | <p>Good Condition - 11% Filled - Basin will be installed when grading begins in that area. DEJ Grading was in the process of excavating the basin during inspection on 10/16/19. E&A will monitor through completion of installation. DEJ Grading installed a riser in the basin prior to the inspection on 12/27/19. There are gaps between the riser and outlet pipe that need closed as of the 12/27/19 inspection. DEJ closed the gaps between the riser and outlet pipe prior to the inspection on 7/21/20. DEJ installed rip rap below the outfall prior to the inspection on 8/13/20. Roth cleaned out the eastern half of the basin, installed dewatering holes and the eastern baffle prior to the inspection on 5/19/21. Roth completed cleanout and installed dirt baffles and dewatering holes prior to the inspection on 6/9/21. E&A inspector painted cleanout mark on 6/18/21.</p> | | | | |
| SB 3 | Sediment Basin | AA17 | 11/15/2018 | Active | No |
| Current Condition: | <p>Good Condition - 20% Filled - Basin will be installed when grading begins in that area. Basin excavation had begun as of inspection on 11/28/18, however, excavation/shaping of the basin was not complete. E&A will monitor. Excavation of the basin is complete as of the 9/11/19 inspection. DEJ Grading rebuilt the berm of the basin prior to inspection on 10/16/19. The outlet pipe was installed prior to inspection on 12/12/19. DEJ installed a riser in the basin prior to the inspection on 7/21/20. DEJ installed rip rap below the outfall prior to the inspection on 8/13/20. Roth began cleanout prior to the inspection on 6/9/21. Roth installed a dirt baffle prior to the inspection on 6/16/21.</p> | | | | |
| SB 4 | Sediment Basin | AA26 | 11/15/2018 | Active | No |
| Current Condition: | <p>Good Condition - 7% Filled - Basin was being excavated during inspection on 11/15/18. Basin excavation was complete as of inspection on 11/19/18, however, no riser structure has been installed as of last inspection. The outfall of the basin was partially installed as of the 11/14/19 inspection. The outlet pipe was installed prior to inspection on 11/27/19. DEJ installed a permanent riser in the basin and rip rap below the basin outfall prior to the inspection on 8/13/20. The outfall is connected to the riser pipe as of the inspection on 8/13/20, therefore a silt fence wrap is no longer necessary. Roth Enterprises began cleaning out the basin prior to the 10/19/21 inspection. E&A inspector will continue to monitor. Roth enterprises installed the baffle prior to the 10/25/21 inspection. Sediment at the outfall was washed away by natural processes prior to the 10/28/21 inspection. Roth Enterprises completed the remaining SWPPP items prior to the 11/16/21 inspection. The E&A inspector painted the cleanout mark during the 4/1/22 inspection.</p> | | | | |
| SB 5 | Sediment Basin | C28 | 11/14/2019 | Active | Yes |
| Current Condition: | <p>Fair Condition - 10% Filled - DEJ Grading began excavation of the basin prior to inspection on 11/14/19. The outlet pipe was installed prior to inspection on 11/22/19. DEJ installed a riser in the basin prior to the inspection on 7/21/20, therefore a silt fence wrap around the outlet pipe is no longer necessary. Great Plains Contractor Services installed rip rap below the outfall prior to the inspection on 8/07/20. Roth Enterprises cleaned out the basin and installed the baffle prior to the inspection on 10/25/21. An unidentified contractor began installing the inlet pipe prior to the 4/20/22 inspection.</p> <p>The dewatering holes lower than 2.58 feet from the riser crest should be plugged.</p> <p>DEJ, Peter Katt, Gene Graves, and Great Plains Contractor Services were informed to complete by 8/05/20. Not done as of the last inspection. DEJ was reminded on 8/20/20. DEJ, Peter Katt, Gene Graves, and Great Plains Contractor Services were reminded on 9/25/20, 10/30/20, 01/15/21, 3/5/21. Roth Enterprises was reminded on 3/14/21, 5/14/21, 7/9/21, 8/10/21, 9/10/21. DEJ was reminded on 10/29/21, 2/23/22. Graves Development was reminded on 12/6/21, 9/09/22</p> | | | | |
| SF 1 | Silt Fence | BB 20-BB14 | | Removed | |
| Current Condition: | <p>Removed - SF 1 (SF 1.3) was installed by Double D Excavating prior to inspection on 11/28/18. The silt fence east of the slope in the southeast corner of the site, including the undermined portion by the outfall of the basin and the multiple full spots, was removed prior to the inspection on 4/22/20. As of the inspection on 7/29/20, vegetation has become sufficiently established on the slope located along the southeastern perimeter of the site that reinstallation of the removed silt fence is no longer necessary. The E&A inspector will continue to monitor. E&A inspector removed SF 1 as of 4/29/21 due to established vegetation.</p> | | | | |
| SF 2 | Silt Fence | BB 14 - Gold Coast Rd | 11/28/2018 | Active | No |
| Current Condition: | <p>Good Condition - A portion of SF 2 (SF 1.2) was installed by Double D Excavating prior to inspection on 11/28/18. Great Plains Contractor Services installed the remainder of the silt fence prior to inspection on 7/31/19. Great Plains Contractor Services installed silt fence on either side of Gold Coast Road prior to the inspection on 8/19/20. Great Plains Contractor Services closed the gap in the silt fence east of the SB 2 outfall. The full portion of silt fence south of the future location of Gold Coast Road was removed to allow access for sewer work prior to the inspection on 9/24/20. Silt fence was removed due to grading on eastern perimeter from Lake Vista Drive to Gold Coast Road prior to 1/12/21 inspection. Great Plains Contractor Services repaired and reinstalled new silt fence above SB 3 (C) outfall prior to 5/10/21. Commercial Seeding reinstalled the silt fence south of Gold Coast Road to SB 3 prior to the 11/11/21 inspection. Missing portions of silt fence will be recommended to homebuilders at the lot level as necessary. Graves Development repaired the silt fence prior to the inspection on 9/19/22.</p> | | | | |
| SF 3 | Silt Fence | Gold Coast Rd - BB 1 | 11/28/2018 | Active | No |
| Current Condition: | <p>Good Condition - A portion of SF 3 (SF 1.2) was installed by Double D Excavating prior to inspection on 11/28/18. Great Plains Contractor Services installed the remainder of the silt fence prior to inspection on 7/31/19. Great Plains Contractor Services installed silt fence on either side of Gold Coast Road prior to the inspection on 8/19/20. Great Plains Contractor Services closed the gap in the silt fence east of the SB 2 outfall, cleaned out some of the full portions of silt fence on the northeastern perimeter of the site (additional cleanout still required), and cleaned out the silt fence where full on the north side of the site prior to the inspection on 9/09/20. The full portion of silt fence south of the future location of Gold Coast Road was removed to allow access for sewer work prior to the inspection on 9/24/20. Silt fence was removed due to grading on eastern perimeter from Gold Coast Road to the northeast corner of the site prior to 1/12/21 inspection. Commercial Seeding reinstalled the silt fence along the northeast corner of the site prior to the 11/11/21 inspection. Missing portions of silt fence will be recommended to homebuilders at the lot level as necessary.</p> | | | | |
| SF 4 | Silt Fence | BB 1 - 120th St | 11/28/2018 | Active | No |

| | | | | | |
|--------------------------------|--|---|------------|---|-----|
| Current Condition: | Good Condition - A portion of SF 4 (SF 1.2) was installed by Double D Excavating prior to inspection on 11/28/18. Great Plains Contractor Services installed the remainder of the silt fence prior to inspection on 7/31/19. Great Plains Contractor Services cleaned out some of the full portions of silt fence on the northeastern perimeter of the site (additional cleanout still required), and cleaned out the silt fence where full on the north side of the site prior to the inspection on 9/09/20. Great Plains Contractor Services repaired and reinstalled new silt fence in the NE corner prior to 5/10/21. GPCS installed silt fence on the east side of 120th Street, and backfilled the silt fence north of SB 2, prior to 6/15/21. Commercial Seeding cleaned out and repaired the silt fence prior to the 11/11/21 inspection. Great Plains Contractor Services repaired the silt fence prior to the 8/3/22 inspection. | | | | |
| SF 5 | Silt Fence | 120th St - S 123rd Ave | 11/7/2019 | Active | No |
| Current Condition: | Good Condition - (SF 1.1) Great Plains Contractor Services repaired the silt fence and reinstalled the silt fence on east and west sides of South 123rd Avenue; and east side of South 120th Street prior to 11/10/20. Silt fence going north/south north of S 124th Street damaged by snow removal prior to inspection on 12/30/20. Silt fence was removed between 123rd ave and S 120th Street due to grading prior to 1/12/21 Inspection. GPCS installed silt fence on the west side of 120th Street prior to 5/19/21. GPCS cleaned out the silt fence on the west side of 120th Street prior to 6/15/21. GPCS repaired and extended the silt fence on the west side of 120th street prior to 8/25/21. Commercial seeding cleaned out and repaired the silt fence around S 120th Street and reinstalled silt fence around S 123rd and S 125th Street prior to the 11/11/21 inspection. Great Plains Contractor Services repaired the silt fence prior to the 8/3/22 inspection. Graves Development repaired the silt fence where torn near the northern entrance prior to the inspection on 10/06/22. | | | | |
| SF 6 | Silt Fence | S 123rd Ave - S 125th St | | Removed | |
| Current Condition: | Removed- (SF 1.1) Great Plains Contractor Services repaired the silt fence and reinstalled the silt fence on east and west sides of South 123rd Avenue; and east side of South 120th Street prior to 11/10/2020. Silt fence going north/south north of S 124th Street damaged by snow removal prior to inspection on 12/30/20. Great Plains Contractor Services removed the silt fence prior to the 4/21/21 inspection. E&A inspector removed SF 1 as of 4/29/2021 due to established vegetation. | | | | |
| SF 7 | Silt Fence | S 125th St - A 5 | 11/7/2019 | Active | No |
| Current Condition: | Good Condition - (SF 1.1) Great Plains Contractor Services repaired the silt fence and reinstalled the silt fence on east and west sides of South 123rd Avenue; and east side of South 120th Street prior to 11/10/2020. Silt fence going north/south north of S 124th Street damaged by snow removal prior to inspection on 12/30/20. GPCS removed a portion of the silt fence north of SB 1 prior to the inspection on 6/15/21. Commercial seeding repaired and reinstalled the silt fence around S 125th street and north of SB 1 prior to the 11/11/21 inspection. Great Plains Contractor Services repaired the silt fence prior to the 8/3/22 inspection. | | | | |
| SF 8 | Silt Fence | B 24 - K 28 | 7/18/2019 | Active | Yes |
| Current Condition: | Fair Condition - (SF 1.5) - Due to Schram Road Improvements, damaged silt fence south of SB E and D7 will be maintained by Sarpy County Department of Roads until road project is completed. E&A removed that section of silt fence from the maintenance plan as of 4/30/2021. Commercial Seeding repaired the silt fence prior to the 11/11/21 inspection. Silt fence should be removed or repaired. Graves Development was informed to complete by 11/9/22. Not done as of last inspection. | | | | |
| SF 9 | Silt Fence | A 9 - A 12 | 11/7/2019 | Active | Yes |
| Current Condition: | Fair Condition - (SF 2) Great Plains Contractor Services repaired the silt fence where full (still needs cleaned out), backfilled the undermined portions north of the full portion, and backfilled/trenched-in the portion south of the full portion prior to the inspection on 7/15/20. Great Plains Contractor Services cleaned out and repaired the silt fence where full and trenched-in the silt fence where the bottom of the run was exposed in several areas (some still need trenched-in) prior to the inspection on 9/09/20. Great Plains Contractor Services repaired/cleaned out the silt fence prior to the 4/21/21 inspection. Great Plains Contractor Services repaired/cleaned out the silt fence prior to the 5/10/21 inspection. Commercial Seeding cleaned out and repaired the silt fence prior to the 11/11/21 inspection. The silt fence should be repaired where fallen. Graves Development was informed to complete by 5/25/22. Not done as of last inspection. Graves Development was reminded on 6/24/22, 7/29/22, 9/09/22, 11/02/22 | | | | |
| STR | Streets | Site | 11/8/2018 | Active | Yes |
| Current Condition: | Fair Condition - Peter Katt / Graves Development cleaned the southern entrances prior to the 2/9/22 inspection. THI Builders cleaned the streets prior to the 7/14/22 inspection. Streets around active Legacy Homes lots should be cleaned daily or as needed. Legacy Homes was informed to complete by 1/25/22. Not done as of last inspection. Legacy Homes was reminded on 3/3/22, 4/7/22, 5/20/22, 7/15/22, 9/09/22 | | | | |
| SWPPP Sign | Misc./Other | Schram Road (W27) and S 120th Street (P1) | 11/19/2018 | Active | No |
| Current Condition: | Good Condition - E&A inspector installed the SWPPP sign at S 124th Street and Schram Road during inspection on 11/19/18. E&A inspector installed the SWPPP sign at S 120th Street at the north end of the site during the inspection on 6/9/21. The SWPPP sign on S 120th was blown over prior to the 3/23/22 inspection. The E&A inspector reinstalled the SWPPP sign on S 120th Street during the 4/1/22 inspection. | | | | |
| Certification Statement | I certify, under penalty of law, that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gathered and evaluated the information submitted. Based on my inquiry of the person or persons who manage the system or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information including the possibility of fines and imprisonment for knowing violations. | | | | |
| Inspector Signature: |  | | | Reviewed By:  | |