

E&A Consulting Group, Inc.
 10909 Mill Valley Road, Suite 100
 Omaha, NE 68154
 tel 402.895.4700
 fax 402.895.3599
 www.eacg.com



E & A CONSULTING GROUP, INC.

Engineering Answers

Zachary A. Jilek, CPESC, CISEC
 Environmental Services Dept. Manager

E&A- P2019.328.000

Inspector: Jason Brackett		Stage
Project Name:	Bridgeport Development SAR-20161228-3910-GP1 CSW-201701381	1
For Week Ending:	2/22/2020	68136
Project Location:	SW of Cornhusker Road and S 180th Street	

Grading:	100%			
Sanitary Sewer:	100%			
Storm Sewer:	100%			
Paving:	95%			
Seeding:	75%			
Utilities:	100%			
Overall Development:	60%			

RAIN FALL AMOUNTS	Amount in tenths	Date inspected	Weather Conditions	
				Week 1
Friday	0.00"			
Monday	0.02"			
Tuesday	0.00"	2/18/2020	Mostly Sunny 42/20	
Wednesday	0.08"			
Thursday	0.00"			
Friday	0.00"			
Saturday	0.00"			

Complaints:	None
--------------------	------

Construction Sequencing:

Which portion(s) (i.e. drainage basins) of the site have had a temporary or permanent cessation of grading, earthwork, or ground disturbance in the last 14 days?

Grading in Phase I was completed prior to E&A being hired to conduct SWPPP inspections (1/3/2020).

Which portion(s) (i.e. drainage basins) of the site do not have grading, earthwork, or ground disturbance scheduled in the next 14 days?

Grading in Phase I was completed prior to E&A being hired to conduct SWPPP inspections (1/3/2020).

What temporary or permanent stabilization measures listed in this section are being implemented?

Site was seeded prior to E&A being hired to conduct SWPPP inspections (1/3/2020).

SUMMARY QUESTIONS:

Are approved entrances and adjacent streets being maintained adequately?

No, See BMPs section.

Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?

No, See BMPs section.

CHECKLIST QUESTIONS:

Are waste materials (concrete, construction material, hazardous, etc.) being managed properly?

No, See BMPs and Findings section.

Is dust associated with the construction activity adequately controlled on the site?

Yes

Comments:

Comments: Site was active for homebuilding during the most recent inspection.

Civil development and some homebuilding was completed prior to E&A being hired to conduct SWPPP inspections on 1/3/2020. Projected install dates for the BMPs listed below will reflect the date when the inspector first observed the BMPs on 1/3/2020.

Findings / Corrective Actions (Date):

Findings / Corrective Actions (Date):

1) Some maintenance is required in the BMP section of this report.

2) All inactive areas of the site that have no planned ground disturbance within 14 days need to be stabilized.

A. S 180th Street ROW, area adjacent to CE 1, backfilled trails and walkways, Lot 10/11 Replat 1, area around Pinehurst Circle/Median, Camelback Ave ROW, and Lot 8 Replat 1. Gene Graves was informed to complete by 1/17/2020 or when weather allows. Not done as of the last inspection.

B. Overgraded lots during homebuilding need to be stabilized. All builders were informed to complete by 1/17/2020 when weather allows and as needed. Not done as of the last inspection.

3) Trash dumpsters on site need to be emptied if they are above the fill line to prevent trash and debris from blowing around the site. All builders were informed to complete by 2/12/20. Not done as of the last inspection.

Unique Name	Type	Location	Projected Install Date	Status	Maintenance
AI 1	Area Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - A silt fence wrap was installed around the area inlet prior to the 1/3/2020 inspection. Silt fence wrap needs to be cleaned out and repaired. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
AI 2	Area Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - A silt fence wrap was installed around the area inlet prior to the 1/3/2020 inspection. Silt fence wrap needs to be cleaned out and repaired. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
AI 3	Area Inlet Protection	See SWPPP	1/10/2020	Pending	Yes
Current Condition:	Pending - Area inlet was installed prior to the 1/3/2020 inspection. Silt fence wrap needs to be installed around the area inlet. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
CE 1	Stabilized Construction Entrance	Cornhusker and S 181st Street	1/10/2020	Pending	Yes
Current Condition:	Pending - A construction entrance needs to be installed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
CE 2	Stabilized Construction Entrance	Cornhusker and S 184th Street	1/10/2020	Pending	Yes
Current Condition:	Pending - A construction entrance needs to be installed or the entrance needs to be closed off. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
CW 1	Concrete Washout	Lot 56	1/3/2020	Active	Yes
Current Condition:	Fair Condition - A lot level concrete washout was installed on Lot 56 prior to the 1/3/2020 inspection. 1.) Concrete washout needs to be cleaned out and a berm needs to be built along the front of the washout to prevent concrete waste from running off into the street. 2.) Rock needs to be added to the approach for the concrete washout to prevent trackout when in use. 1.) Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection. 2.) Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 1	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 2	Inlet Protection	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection.				
IP 3	Inlet Protection	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection.				
IP 4	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				

IP 5	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 6	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 7	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 8	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 9	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 10	Inlet Protection	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection.				
IP 11	Inlet Protection	See SWPPP	1/10/2020	Pending	Yes
Current Condition:	Pending - Inlet protection needs to be installed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 12	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out and re-secured. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 13	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 14	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 15	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out and re-secured. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 16	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				

Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 31	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 32	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be re-secured. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 33	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out and re-secured. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 34	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 35	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 36	Inlet Protection	See SWPPP	1/10/2020	Pending	Yes
Current Condition:	Pending - Inlet protection needs to be installed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 37	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 38	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 39	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 40	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 41	Inlet Protection	See SWPPP	1/3/2020	Active	Yes

Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 42	Inlet Protection	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Curb inlet protection was installed prior to the 1/3/2020 inspection. IP needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 43	Inlet Protection	See SWPPP	1/3/2020	Pending	Yes
Current Condition:	Pending - IP needs to be installed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
IP 44	Inlet Protection	See SWPPP	1/3/2020	Pending	Yes
Current Condition:	Pending - IP needs to be installed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 1 Replat 1	Individual Lot	Lot 1 Replat 1	1/3/2020	Active	Yes
Current Condition:	Fair Condition- PHI began construction on the lot prior to the 1/3/2020 inspection. PHI installed silt fence along the north side of the lot and in the southeast corner prior to the 1/8/20 inspection. The silt fence in the southeast corner of the lot needs to be retied. PHI was informed to complete by 2/12/2020. Not done as of the last inspection.				
Lot 8	Individual Lot	Lot 8	1/3/2020	Active	No
Current Condition:	Active - Mercury Contractors began construction on the lot prior to the 1/3/2020 inspection. The lot is relatively flat, no BMPs are recommended at this time.				
Lot 8 Replat 1	Individual Lot	Lot 8 Replat 1	2/5/2020	Pending	Yes
Current Condition:	Pending - Unidentified builder began construction on the lot prior to the 2/5/2020 inspection. Silt fence needs to be installed on both sides of the rear of the lot. Unidentified builder will be informed to complete by 2/12/2020 when identified. Not done as of the last inspection.				
Lot 18	Individual Lot	Lot 18	1/3/2020	Pending	Yes
Current Condition:	Pending - Hildy Construction began construction on the lot prior to the 1/3/2020 inspection. Silt fence needs to be installed along the north and west sides of the lot. Hildy Construction was informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 27	Individual Lot	Lot 27	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Mercury Contractors began construction on the lot prior to the 1/3/2020 inspection. Mercury Contractors installed silt fence in the rear of the lot and in the northeast corner prior to the 1/3/2020 inspection. The silt fence in the northeast corner of the lot needs to be extended along the north side of the lot and hooked part-way along the front of the lot. Mercury Contractors were informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 34	Individual Lot	Lot 1 Replat 4	1/3/2020	Pending	Yes
Current Condition:	Pending - McCaul Contracting began construction on the lot prior to the 1/3/2020 inspection. Silt fence needs to be installed along the north and west sides of the lot and in the southwest corner. McCaul Contracting was informed to complete by 1/15/20. Not done as of the last inspection.				
Lot 59	Individual Lot	Lot 59	2/18/2020	Active	No
Current Condition:	Active - Hildy Construction began excavation of the lot prior to the 2/18/20 inspection. A dirt pile was observed in the ROW; however, hildy construction was actively moving dirt and pouring foundations at the time, the inspector will monitor for removal and the installation of BMPs.				
Lot 60	Individual Lot	Lot 60	1/3/2020	Pending	Yes

Current Condition:	Pending - Unidentified builder began construction on the lot prior to the 1/3/2020 inspection. Unidentified builder removed the dirt pile from the ROW prior to the 1/16/2020 inspection. Silt fence needs to be installed in the rear of the lot and part-way up each side. Unidentified builder will be informed to complete by 1/10/2020 when identified. Not done as of the last inspection.				
Lot 64	Individual Lot	Lot 64	1/3/2020	Pending	Yes
Current Condition:	Pending - Kavan Homes began construction on the lot prior to the 1/3/2020 inspection. 1.) Silt fence needs to be installed in the rear of the lot and part-way up each side. 2.) Dirt piles need to be removed from the ROW. 1.) Kavan Homes was informed to complete by 1/10/2020. Not done as of the last inspection. 2.) Kavan Homes was informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 70	Individual Lot	Lot 70	1/3/2020	Pending	Yes
Current Condition:	Pending - Kavan Homes began construction on the lot prior to the 1/3/2020 inspection. Kavan Homes removed the dirt piles from the ROW prior to the 1/29/20 inspection. Silt fence needs to be installed in the rear of the lot and part-way up each side. Kavan Homes was informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 73	Individual Lot	Lot 73	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Colony Custom Homes began construction on the lot prior to the 1/3/2020 inspection. Colony Custom Homes installed silt fence not trenched in prior to the 1/16/2020 inspection, recommendation has been modified, the same reminder dates apply. Silt fence needs to be trenched in. Colony Custom Homes was informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 87	Individual Lot	Lot 87	1/3/2020	Active	No
Current Condition:	Active - Hildy Construction began construction on the lot prior to the 1/3/2020 inspection. SF 4 is in place in the rear of the lot, no further BMPs are recommended at this time.				
Lot 94	Individual Lot	Lot 94	1/3/2020	Active	No
Current Condition:	Active - Homeowner Michael Morrison began construction on the lot prior to the 1/3/2020 inspection. The lot is relatively flat, no BMPs will be recommended at this time. Homeowner Michael Morrison removed the dirt pile from the ROW prior to the 1/16/2020 inspection.				
Lot 95	Individual Lot	Lot 95	1/3/2020	Pending	Yes
Current Condition:	Pending - Vencil Construction began construction on the lot prior to the 1/3/2020 inspection. Silt fence needs to be installed on the north side of the lot and in the northeast corner. Vencil Construction was informed to complete by 1/10/2020. Not done as of the last inspection.				
Lot 119	Individual Lot	Lot 119	2/18/2020	Pending	Yes
Current Condition:	Pending - Ideal Designs began construction on the lot prior to the 2/18/2020 inspection. A dirt pile was observed in the ROW; however, Ideal was actively moving dirt and pouring foundations at the time, the inspector will monitor for removal. To prevent flooding an inlet protection will not be recommended in front of the lot, street cleaning will be recommended as needed. 1.) Silt fence needs to be installed in the rear and on the sides of the lot. 2.) The sidewalk adjacent to the lot needs to be cleaned 1.) Ideal Designs was informed to complete by 2/25/20. 2.) Ideal Designs was informed to complete by 2/19/20.				
Lot 126	Individual Lot	Lot 126	1/3/2020	Active	No
Current Condition:	Active - Belt Construction began construction on the lot prior to the 1/3/2020 inspection. Belt Construction staked down a portable toilet on the front of the lot prior to the 1/10/2020 inspection. The lot is relatively flat, no BMPs will be recommended at this time.				
Lot 128	Individual Lot	Lot 128	2/5/2020	Active	No
Current Condition:	Active - Belt Construction began construction on the lot prior to the 2/5/2020 inspection. Belt Construction removed the dirt pile from the ROW prior to the 2/18/20 inspection.				
Lot 134	Individual Lot	Lot 134	1/3/2020	Active	Yes

Current Condition:	Fair Condition - Silverthorn Custom Homes began construction on the lot prior to the 1/3/2020 inspection. SF 4 is in place in the rear of the lot. 1.) Silt fence needs to be cleaned out/repared in the rear of the lot. 2.) The portable toilet on the lot needs to be secured. 1.) Silverthorn Custom Homes was informed to complete by 1/10/2020. Not done as of the last inspection. Silverthorn was reminded on 2/6/2020. 2.) Silverthorn Custom Homes was informed to complete by 2/12/2020. Not done as of the last inspection.				
Lot 135	Individual Lot	Lot 135	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Landmark Performance Group began construction on the lot prior to the 1/3/2020 inspection. SF 4 is in place in the rear of the lot. Silt fence needs to be cleaned out/repared in the rear of the lot. Landmark Performance Group was informed to complete by 1/10/2020. Not done as of the last inspection.				
SB 1	Sediment Basin	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - 10% filled - The basin was installed prior to the 1/3/2020 inspection with a permanent riser.				
SB 2	Sediment Basin	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - 10% filled - The basin was installed prior to the 1/3/2020 inspection with a permanent riser.				
SB 3	Sediment Basin	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - 10% filled - The basin was installed prior to the 1/3/2020 inspection with a permanent riser.				
SB 4	Sediment Basin	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - 10% filled - The basin was installed prior to the 1/3/2020 inspection with a permanent riser.				
SB 5	Sediment Basin	See SWPPP	1/3/2020	Active	No
Current Condition:	Good Condition - 10% filled - The basin was installed prior to the 1/3/2020 inspection with a permanent riser.				
SF 1	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed in the northeast corner of SB 1 prior to the 1/3/2020 inspection. Due to vegetation growth around the basin the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 2	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed on the east side of S 181st Street prior to the 1/3/2020 inspection. Due to established vegetation in the area, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 3	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed on the west side of S 181st Street prior to the 1/3/2020 inspection. Due to vegetation in the area and builder activity, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 4	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed around the wetlands and drainageways prior to the 1/3/2020 inspection. Silt fence needs to be repaired/cleaned out/reinstalled where the ground is disturbed. Silt fence can be removed where the area that drains to the silt fence is vegetated. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 5	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed on the west side of Cheyenne Road prior to the 1/3/2020 inspection. Due to established vegetation in the area, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 6	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed southeast of the intersection of Camelback Avenue and S 184th Street prior to the 1/3/2020 inspection. Due to small area of ground disturbance and the slope in the area, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 7	Silt fence	See SWPPP	1/3/2020	Active	Yes

Current Condition:	Fair Condition - Silt fence was installed southeast of the intersection of Camelback Avenue and S 183rd Circle prior to the 1/3/2020 inspection. Silt fence needs to be repaired where damaged and backfilled where undermined. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 8	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed behind Lot 99 prior to the 1/3/2020 inspection. Due to sodding of lot 99 silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 9	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed along Cornhusker Road north and northwest of SB 5 prior to the 1/3/2020 inspection. Due to established vegetation in the area, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 10	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed along the west side of S 184th Street prior to the 1/3/2020 inspection. Due to vegetation in the area and builder activity, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 11	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed along the east side of S 184th Street prior to the 1/3/2020 inspection. Due to vegetation in the area and builder activity, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 12	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed west of Pinehurst Circle prior to the 1/3/2020 inspection. Due to established vegetation in the area, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 13	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed east of Pinehurst Circle prior to the 1/3/2020 inspection. Due to established vegetation in the area, the silt fence can be removed. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SF 14	Silt fence	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Silt fence was installed southeast of Camelback Avenue and S 182nd Street prior to the 1/3/2020 inspection. Silt fence needs to be retied to one post and extended the entire length of the disturbed ground. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
SW 1	Straw Wattles	See SWPPP	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Straw wattles were installed on the SW corner of Lot 39 prior to the 1/3/2020 inspection. Straw wattles needs to be cleaned out. Gene Graves was informed to complete by 1/10/2020. Not done as of the last inspection.				
STR	Streets	Internal/S 132nd and Main Street	1/3/2020	Active	Yes
Current Condition:	Fair Condition - Street cleaning and sidewalk cleaning is necessary in multiple locations throughout the development. All builders and Gene Graves were informed to complete by 1/4/2020. Not done as of the last inspection. All builders were reminded on 2/6/2020.				
SWPPP Sign	Misc/Other	Camelback Ave and S 180th Street	1/29/2020	Active	No

Current Condition:	Good Condition - E&A inspector installed 3 SWPPP signs at the intersection of S 180th Street and Laquinta Street, at the intersection of S 180th Street and Camelback Road, and at the intersection of Cornhusker Road and S 181st Street during the 1/29/2020 inspection. The E&A inspector re-secured the SWPPP sign during the 2/10/2020 inspection.
--------------------	---

Inspector Signature: 

Reviewed By: 