E & A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599 www.eacg.com



Zachary A. Jilek, CPESC, CISEC Environmental Services Dept. Manager

E&A - P2020.100.002

Inspector: Alex Brown					Stage	
Project Name:		Golden Hills Phase II IA - 38142 - 37869 5/21/2022				
For Week Ending:						
Project Location:	Golden	Golden Hills Drive & Old Mormon Bridge Road (Crescent, Iowa)				
Grading:	100%					
Sanitary Sewer:	100%					
Storm Sewer:	100%					
Paving:	100%					
Seeding:	70%					
Utilities:	100%					
Overall Development:	50%					

RAIN FALL AMOUNTS	Amount in tenths	Date inspected	Weather Conditions	Time	
					Week 1
Sunday	0.00"				
Monday	0.00"				
Tuesday	0.25"	5/17/2022	Cloudy 78/63	5:50 PM	
Wednesday	1.03"				
Thursday	0.00"				
Friday	0.00"				
Saturday	0.00"				

Complaints:

Construction Sequencing:

Which portion(s) (i.e. drainage basins) of the site have had a temporary or permanent cessation of grading, earthwork, or ground disturbance in the last 14 days?

Grading began in spring 2021; Entire site graded by fall 2021 (3/17/22). Grading in the northeast quart of the site (5/17/22).

Which portion(s) (i.e. drainage basins) of the site do not have grading, earthwork, or ground disturbance scheduled in the next 14 days?

Grading began in spring 2021; Entire site graded by fall 2021 (3/17/22). Grading in the northeast quart of the site (5/17/22).

What temporary or permanent stabilization measures listed in this section are being implemented?

Existing vegetation (3/17/22). Slope along SW corner of the site seeded / matted in fall 2021 (3/17/22). Area west of Lot 33 and Lot 61 seeded / matted (3/29/22). North side of Silver Lane and east side of Copper Mountain Drive seeded / matted (3/29/22). South side of Silver Lane and west side of Copper Mountain Drive seeded / matted (4/5/22). Rear of Lots 58 - 60 partially seeded / matted (4/5/22). Disturbed area behind Lots 38 - 40 seeded / matted (4/5/22). Lots 34-40 and 59-61 sodded (4/12/22).

Checklist Questions:

Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity? Yes Create Corrective Action? N/A

Have disturbed areas been seeded or otherwise stabilized as required? List inactive portions of the project and if stabilization measure are adequate or needed to prevent erosion

Create Corrective Action? No, see Findings Section

Are waste materials (concrete, construction material, hazardous, etc.) being managed properly?

Create Corrective Action?

Are construction entrances and adjacent streets being maintained adequately?

Create Corrective Action?

o, see BMP Sectior

Is dust associated with the construction activity adequately controlled on the site? Yes

Create Corrective Action?

Comments:

Comments:

1.) Site was inactive during the last inspection.

Findings / Corrective Actions (Date)

Findings / Corrective Actions (Date):

1.) Some maintenance is required in the BMP section.

2.) E&A began inspecting the site on 3/17/22 after being contracted for SWPPP services by Neal Drickey. 3.) All disturbed areas, located north of active lots, that are not scheduled for imminent work should be temporarily stabilized. Neal Drickey was informed to complete by 3/24/22. Not done as of last inspection. Neal Drickey seeded/matted the ROW on the east side of Copper Mountain Drive prior to the 3/29/22 inspection. Neal Drickey seeded/matted the ROW on the west side of Copper Mountain Drive prior to the 4/5/22 inspection. E&A inspector will continue to monitor. Neal Drickey was reminded on 4/21/22

4.) The slope in the rear of lots 55 - 58 should be stabilized. Neal Drickey was informed to complete by 4/26/22. Not done as of last inspection.

Unique Name	Туре	Location	Projected Install Date	Status	Maintenance	
CE 01	Construction Entrance	Х3		Removed		
Current Condition:	Removed - Neal Drickey paved the entrance prior to the 3/17/22 inspection.					
CE 02	Construction Entrance	D6	·	Removed		
Current Condition:	Removed - Neal Drickey pav	ed the entrance prior to	the 3/17/22 inspection.			
CE A	Construction Entrance	BB7	4/1/2021	Active	Yes	
Current Condition:			the entrance prior to the 3/17/			
	A 6" layer of 2" diameter rock should be added to the entrance, or the entrance should be stabilized and closed off to prevent anyone from accessing the site from this location. Neal Drickey was informed to complete by 3/24/22. Not done as of last inspection. Neal Drickey was reminded on 4/21/22					
DS 1 - 6	Diversion	See SWPPP	4/1/2021	Pending	Yes	
Current Condition:	perimeter silt fence is adequa 3/24/22. E&A inspector will c Diversion 4 should be installe	ately containing sedimen ontinue to monitor. ed.	stallation DS 1, DS 2, and DS t around CE 1, so installation o lot done as of last inspection.			
DS A - O	Diversion	See SWPPP	4/1/2021	Active	Yes	
Current Condition:			4/ 1/2021 SI - M prior to the 3/17/22 inspe			
	 so installation will not be recommended. Installation of DS C, DC E - H and DS O is not recommended as of 3/17/22 due to progress lot-level construction and existing grade of the site. E&A inspector will continue to monitor. 1.) Diversions B, I, J, K, L, and M should be re-defined to funnel runoff into the sediment traps. 2.) Diversions D and N should be installed. 1.) Neal Drickey was informed to complete by 3/31/22. Not done as of last inspection. 2.) Neal Drickey was informed to complete by 3/31/22. Not done as of last inspection. 					
ECM 1	Erosion Control Matting	SW Corner	4/1/2021	Active	No	
Current Condition:	Good Condition - Neal Drick	ey installed the erosion c	ontrol matting along the slope 40 and 35-40 prior to the 4/5/2	prior to the 3/17/22 inspec		
		East Side of Copper Mountain Drive	3/29/2022	Active		
ECM 2	Erosion Control Matting				No	
ECM 2 Current Condition:	Good Condition - Neal Drick	ey installed the erosion c	ontrol matting along the ROW oved for utility work prior to the		and Silver Lane prior	
Current Condition: ECM 3	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive	oved for utility work prior to the 4/5/2022	4/26/22 inspection. E&A	and Silver Lane prior t inspector will continue t	
ECM 3 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection.	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW	4/26/22 inspection. E&A	and Silver Lane prior t inspector will continue t	
ECM 3 ECM 3 Current Condition: ECM 3	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active	and Silver Lane prior inspector will continue No and Silver Lane prior	
ECM 3 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active	and Silver Lane prior inspector will continue No and Silver Lane prior	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se 3/17/2022	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active	and Silver Lane prior inspector will continue No and Silver Lane prior No 4/5/22 inspection.	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site ey installed a fuel tank no	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active	and Silver Lane prior inspector will continue No and Silver Lane prior No 4/5/22 inspection.	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01 Current Condition: IP 1 - 10	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank Good Condition - Neal Dricke fuel tank prior to the 4/5/22 ir Inlet Protection	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site ey installed a fuel tank no	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se 3/17/2022	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active	and Silver Lane prior t inspector will continue No and Silver Lane prior t No 4/5/22 inspection.	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank Good Condition - Neal Dricke fuel tank prior to the 4/5/22 in Inlet Protection Pending - Inlet protection should be inst	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site ey installed a fuel tank no rspection. On Site	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se 3/17/2022 orth of SB A prior to the 3/17/22 3/24/2022	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active 2 inspection. Neal Drickey Pending	and Silver Lane prior t inspector will continue i No and Silver Lane prior t No 4/5/22 inspection. No built a berm around th Yes	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01 Current Condition: IP 1 - 10 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank Good Condition - Neal Dricke fuel tank prior to the 4/5/22 in Inlet Protection Pending - Inlet protection should be insp Neal Drickey was informed to	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site ey installed a fuel tank no spection. On Site	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se 3/17/2022 orth of SB A prior to the 3/17/22 3/24/2022	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active 2 inspection. Neal Drickey Pending	and Silver Lane prior f inspector will continue No and Silver Lane prior f No 4/5/22 inspection. No built a berm around th Yes	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01 Current Condition: IP 1 - 10 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank Good Condition - Neal Dricke fuel tank prior to the 4/5/22 in Inlet Protection Pending - Inlet protection should be ins Neal Drickey was informed to Individual Lot	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site ey installed a fuel tank no spection. On Site talled on the ten grate in p complete by 3/24/22. N Lot 33	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se 3/17/2022 orth of SB A prior to the 3/17/22 3/24/2022 lets on Silver Lane.	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active 2 inspection. Neal Drickey Pending	and Silver Lane prior f inspector will continue No and Silver Lane prior f No 4/5/22 inspection. No built a berm around th Yes	
Current Condition: ECM 3 Current Condition: ECM 3 Current Condition: FT 01 Current Condition: IP 1 - 10 Current Condition:	Good Condition - Neal Dricke the 3/29/22 inspection. Some monitor. Erosion Control Matting Good Condition - Neal Dricke the 4/5/22 inspection. Erosion Control Matting Good Condition - Neal Dricke Fuel Tank Good Condition - Neal Dricke fuel tank prior to the 4/5/22 in Inlet Protection Pending - Inlet protection should be insp Neal Drickey was informed to	ey installed the erosion c e of the matting was rem West Side of Copper Mountain Drive ey installed the erosion c Western Perimeter ey installed the erosion c On Site ey installed a fuel tank no spection. On Site talled on the ten grate in p complete by 3/24/22. N Lot 33	oved for utility work prior to the 4/5/2022 ontrol matting along the ROW 4/5/2022 ontrol matting along several se 3/17/2022 orth of SB A prior to the 3/17/22 3/24/2022 lets on Silver Lane.	4/26/22 inspection. E&A i Active of Copper Mountain Drive Active ections of SF 3 prior to the Active 2 inspection. Neal Drickey Pending	and Silver Lane prior f inspector will continue No and Silver Lane prior f No 4/5/22 inspection. No built a berm around th Yes	

	_				
Lot 35	Individual Lot	Lot 35		Removed	
Current Condition:	Removed - Neal Drickey soc		1/12/22 inspection.		
Lot 36	Individual Lot	Lot 36		Removed	
Current Condition:	Removed - Neal Drickey soc	· · · · · · · · · · · · · · · · · · ·	1/12/22 inspection.		
Lot 37	Individual Lot	Lot 37		Removed	
Current Condition:	Removed - Neal Drickey soc		1/12/22 inspection.	-	
Lot 38	Individual Lot	Lot 38		Removed	
Current Condition:	Removed - Neal Drickey soc	Ided the lot prior to the	1/12/22 inspection.		
Lot 39	Individual Lot	Lot 39		Removed	
Current Condition:	Removed - Neal Drickey soc	Ided the lot prior to the	1/12/22 inspection.		
Lot 40	Individual Lot	Lot 40		Removed	
Current Condition:	Removed - Neal Drickey soc	Ided the lot prior to the	1/12/22 inspection.		
Lot 54	Individual Lot	Lot 54	3/17/2022	Active	No
Current Condition:			e lot prior to the 3/17/22 inspect		
			to the 4/5/22 inspection. Neal D	Prickey installed wattles alo	ong the south side of the
	driveway prior to the 4/26/22				
Lot 55	Individual Lot	Lot 55	3/17/2022	Active	Yes
Current Condition:			ot prior to the 3/17/22 inspection Drickey installed wattles along t		
	inspection. Wattles should be installed a	along the front of the lot.			
Lot 56	Individual Lot	Lot 56	3/17/2022	Active	Yes
Current Condition:			ot prior to the 3/17/22 inspectio		
	side of the driveway prior to t Wattles should be installed a Neal Drickey was informed to	along the front of the lot.	Not done as of last inspection. I	Neal Drickey was reminded	d on 4/21/22
Lot 57	Individual Lot	Lot 57	3/17/2022	Active	Yes
Current Condition:			ot prior to the 3/17/22 inspectio		
	Wattles should be installed a	U			
Lot 58	-		Not done as of last inspection. I	-	d on 4/21/22
Lot 58	Individual Lot	Lot 58		Neal Drickey was reminded Removed	d on 4/21/22
Current Condition:	Individual Lot Removed - Neal Drickey sc	Lot 58 odded the lot prior to t		Removed	d on 4/21/22
Current Condition: Lot 59	Individual Lot Removed - Neal Drickey so Individual Lot	Lot 58 odded the lot prior to t Lot 59	he 5/17/22 inspection.	-	d on 4/21/22
Current Condition: Lot 59 Current Condition:	Individual Lot Removed - Neal Drickey so Individual Lot Removed - Neal Drickey soc	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the	he 5/17/22 inspection.	Removed Removed	d on 4/21/22
Current Condition: Lot 59 Current Condition: Lot 60	Individual Lot Removed - Neal Drickey so Individual Lot Removed - Neal Drickey soc Individual Lot	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the Lot 60	he 5/17/22 inspection. 4/12/22 inspection.	Removed	d on 4/21/22
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition:	Individual Lot Removed - Neal Drickey so Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the a Lot 60 Ided the lot prior to the a	he 5/17/22 inspection. 4/12/22 inspection.	Removed Removed Removed	d on 4/21/22
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61	he 5/17/22 inspection. 1/12/22 inspection. 1/12/22 inspection. 1/12/22 inspection.	Removed Removed	d on 4/21/22
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition:	Individual Lot Removed - Neal Drickey so Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61	he 5/17/22 inspection. 1/12/22 inspection. 1/12/22 inspection. 1/12/22 inspection.	Removed Removed Removed	d on 4/21/22
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site	4/1/2021	Removed Removed Removed Removed Active	d on 4/21/22
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site	be 5/17/22 inspection. 1/12/22 inspection. 1/12/22 inspection. 1/12/22 inspection. 1/12/22 inspection.	Removed Removed Removed Removed Active	
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61 Current Condition: MS 01 Current Condition: SB 1	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Dricke Sediment Basin	Lot 58 bdded the lot prior to t Lot 59 Ided the lot prior to the Lot 60 Ided the lot prior to the Lot 61 Ided the lot prior to the On Site ey added a designated N of CE 1	he 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 4/1/2021 4/1/2021	Removed Removed Removed Removed Active a 3/17/22 inspection. Active	I No Yes
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61 Current Condition: MS 01 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser dr The basin should be installed properly elevated dewatering	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspect d per the SWPPP plan, pholes.	he 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 4/1/2021 material storage area prior to the 4/1/2021 he sediment basin prior to the 3	Removed Removed Removed Removed Active e 3/17/22 inspection. Active y17/22 inspection. Active s, anti-vortex device, emerged	No Yes A inspector painted the ergency spillway, and
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61 Current Condition: MS 01 Current Condition: SB 1	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser dr The basin should be installed properly elevated dewatering	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspect d per the SWPPP plan, pholes.	4 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 material storage area prior to the 4/1/2021 he sediment basin prior to the 3 tion. including a berm around all side	Removed Removed Removed Removed Active e 3/17/22 inspection. Active y17/22 inspection. Active s, anti-vortex device, emerged	No Yes A inspector painted the ergency spillway, and
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: Lot 61 Current Condition: MS 01 Current Condition: SB 1 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey	Lot 58 bidded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspect d per the SWPPP plan, holes. o complete by 3/24/22. See SWPPP y installed SF 3 prior to	be 5/17/22 inspection. 1 1/12/22 inspection. 1 1/12/22 inspection. 1 1/12/22 inspection. 1 1/12/22 inspection. 4/1/2021 he sediment basin prior to the 3 tion. including a berm around all sid Not done as of last inspection. I 4/1/2021 he 4/20/21 inspection. Due to s	Removed Removed Removed Removed Active e 3/17/22 inspection. Active 3/17/22 inspection. The E& es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta	No No Yes A inspector painted the ergency spillway, and d on 4/21/22 Yes Illation of SF 2 is no longer
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: MS 01 Current Condition: SB 1 Current Condition: SB 1 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey recommended as of 4/5/22. Lot 61, installation of SF 1 is	Lot 58 odded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspect d per the SWPPP plan, g holes. o complete by 3/24/22. See SWPPP y installed SF 3 prior to Neal Drickey cleaned of no longer recommende	he 5/17/22 inspection. 1/12/22 inspection. 1/1/2021 material storage area prior to the 3 4/1/2021 he sediment basin prior to the 3 including a berm around all sid Not done as of last inspection. I 4/1/2021 he 4/20/21 inspection. Due to s it, repaired, and extended SF 3 id as of 4/12/22.	Removed Removed Removed Removed Active e 3/17/22 inspection. Active 3/17/22 inspection. The E& es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta	No No Yes A inspector painted the ergency spillway, and d on 4/21/22 Yes Illation of SF 2 is no longer
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: MS 01 Current Condition: SB 1 Current Condition: SB 1 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey recommended as of 4/5/22. Lot 61, installation of SF 1 is SF 3 should be cleaned out the Removed - Neal Drickey was informed to SF 3 should be cleaned out the Removed - Neal Drickey was informed to SF 3 should be cleaned out the Content of the stallation of SF 1 is SF 3 should be cleaned out the Set Stallation of SF 1 is SF 3 should be cleaned out the Set Stallation of SF 1 is SF 3 should be cleaned out the SF 3 should be should be should be should be SF 3 should be should be should be should be SF 3 should be should be should be should be SF 3 should be should be should be should be SF 3 should be should be SF 3 should be should be should be	Lot 58 bidded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspec d per the SWPPP plan, g holes. o complete by 3/24/22. See SWPPP y installed SF 3 prior to Neal Drickey cleaned of no longer recommended where full in the rear of	he 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 material storage area prior to the 4/1/2021 he sediment basin prior to the 3 tion. including a berm around all sid 4/1/2021 he 4/20/21 inspection. In 4/1/2021 he 4/20/21 inspection. Due to s it, repaired, and extended SF 3 it as of 4/12/22. Lot 58.	Removed Removed Removed Removed Active e 3/17/22 inspection. Active 3/17/22 inspection. The E& es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta	No No Yes A inspector painted the ergency spillway, and d on 4/21/22 Yes Illation of SF 2 is no longer
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: MS 01 Current Condition: SB 1 Current Condition: SB 1 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey recommended as of 4/5/22. Lot 61, installation of SF 1 is SF 3 should be cleaned out the Removed - Neal Drickey was informed to SF 3 should be cleaned out the Removed - Neal Drickey was informed to SF 3 should be cleaned out the Content of the stallation of SF 1 is SF 3 should be cleaned out the Set Stallation of SF 1 is SF 3 should be cleaned out the Set Stallation of SF 1 is SF 3 should be cleaned out the SF 3 should be should be should be should be SF 3 should be should be should be should be SF 3 should be should be should be should be SF 3 should be should be should be should be SF 3 should be should be SF 3 should be should be should be	Lot 58 bidded the lot prior to t Lot 59 Ided the lot prior to the 4 Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 On Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspec d per the SWPPP plan, g holes. o complete by 3/24/22. See SWPPP y installed SF 3 prior to Neal Drickey cleaned of no longer recommended where full in the rear of	he 5/17/22 inspection. 1/12/22 inspection. 1/1/2021 material storage area prior to the 3 4/1/2021 he sediment basin prior to the 3 including a berm around all sid Not done as of last inspection. I 4/1/2021 he 4/20/21 inspection. Due to s it, repaired, and extended SF 3 id as of 4/12/22.	Removed Removed Removed Removed Active e 3/17/22 inspection. Active 3/17/22 inspection. The E& es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta	No No Yes A inspector painted the ergency spillway, and d on 4/21/22 Yes Illation of SF 2 is no longer
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: MS 01 Current Condition: SB 1 Current Condition: SF 1 - 3 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey recommended as of 4/5/22. Lot 61, installation of SF 1 is SF 3 should be cleaned out Neal Drickey was informed to Silt Fence Good Condition - Neal Dricked during lot-level fine grading p 61, reinstallation of SF N is r removed SF B and installed longer recommended as of 4	Lot 58 Dedded the lot prior to t Lot 59 Ided the lot prior to te Lot 60 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 Lot 61 Ided the lot prior to the 4 Con Site ey added a designated N of CE 1 Neal Drickey installed t uring the 4/19/22 inspect o complete by 3/24/22. See SWPPP installed SF 3 prior to 1 Neal Drickey cleaned of no longer recommended or complete by 4/26/22. See SWPPP ey installed SF A-D and orior to the 3/29/22 inspect SF I prior to the 4/26/22. SF I prior to the 4/26/22.	he 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 material storage area prior to the 4/1/2021 he sediment basin prior to the 3 tion. including a berm around all sid Not done as of last inspection. I 4/1/2021 he 4/20/21 inspection. Due to s it, repaired, and extended SF 3 id as of 4/12/22. Lot 58. Not done as of last inspection.	Removed Removed Removed Removed Removed Active e 3/17/22 inspection. Active s/17/22 inspection. The E& //1/22 inspection. The E& Active es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta prior to the 4/5/22 inspect Active 22 inspection. Neal Dricke & Active *A inspector will continue ontaining sediment, so insta odding of upgradient lots, i	No N
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: MS 01 Current Condition: SB 1 Current Condition: SF 1 - 3 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey recommended as of 4/5/22. Lot 61, installation of SF 1 is SF 3 should be cleaned out Neal Drickey was informed to Silt Fence Good Condition - Neal Dricked during lot-level fine grading p 61, reinstallation of SF N is r removed SF B and installed longer recommended as of 4	Lot 58 odded the lot prior to t Lot 59 ided the lot prior to the 4 Lot 60 ided the lot prior to the 4 Lot 61 ided the lot prior to the 4 Con Site ey added a designated N of CE 1 Neal Drickey installed t val Drickey installed t val Drickey installed t o complete by 3/24/22. See SWPPP installed SF 3 prior to 1 Neal Drickey cleaned of no longer recommended where full in the rear of o complete by 4/26/22. See SWPPP ey installed SF A-D and prior to the 3/29/22 inspe- to longer recommended SF I prior to the 4/5/22 U/5/22. E&A inspector w V/19/22. E&A inspector w	he 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 material storage area prior to the 4/1/2021 he sediment basin prior to the 3 tion. including a berm around all sid Not done as of last inspection. I 4/1/2021 he 4/20/21 inspection. Due to s it, repaired, and extended SF 3 id as of 4/12/22. Lot 58. Not done as of last inspection. 4/1/2021 SF L, M, O, P prior to the 3/17/ ection. Reinstallation will not be las of the 3/29/22 inspection. E nspection. SF I is adequately cu ill continue to monitor. Due to si	Removed Removed Removed Removed Removed Active e 3/17/22 inspection. Active s/17/22 inspection. The E& //1/22 inspection. The E& Active es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta prior to the 4/5/22 inspect Active 22 inspection. Neal Dricke & Active *A inspector will continue ontaining sediment, so insta odding of upgradient lots, i	No N
Current Condition: Lot 59 Current Condition: Lot 60 Current Condition: MS 01 Current Condition: SB 1 Current Condition: SF 1 - 3 Current Condition:	Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Individual Lot Removed - Neal Drickey soc Material Storage Good Condition - Neal Drickey soc Material Storage Good Condition - Neal Drickey Sediment Basin Poor Condition - Neal Dricke Sediment Basin Poor Condition - 10% filled - cleanout mark on the riser du The basin should be installed properly elevated dewatering Neal Drickey was informed to Silt Fence Fair Condition - Neal Drickey recommended as of 4/5/22. Lot 61, installation of SF 1 is SF 3 should be cleaned out Neal Drickey was informed to Silt Fence Good Condition - Neal Dricked during lot-level fine grading p 61, reinstallation of SF N is r removed SF B and installed longer recommended as of 4 longer recommended as of 4	Lot 58 odded the lot prior to t Lot 59 ided the lot prior to the 4 Lot 60 ided the lot prior to the 4 Lot 61 ided the lot prior to the 4 Con Site ey added a designated N of CE 1 Neal Drickey installed t val Drickey installed t val Drickey installed t o complete by 3/24/22. See SWPPP installed SF 3 prior to 1 Neal Drickey cleaned of no longer recommended where full in the rear of o complete by 4/26/22. See SWPPP ey installed SF A-D and prior to the 3/29/22 inspe- to longer recommended SF I prior to the 4/5/22 U/5/22. E&A inspector w V/19/22. E&A inspector w	he 5/17/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/12/22 inspection. 4/1/2021 material storage area prior to the 4/1/2021 he sediment basin prior to the 3 tion. including a berm around all sid Not done as of last inspection. I 4/1/2021 he 4/20/21 inspection. Due to s it, repaired, and extended SF 3 id as of 4/12/22. Lot 58. Not done as of last inspection. 4/1/2021 SF L, M, O, P prior to the 3/17/ ection. Reinstallation will not be las of the 3/29/22 inspection. E nspection. SF I is adequately cu ill continue to monitor. Due to si	Removed Removed Removed Removed Removed Active e 3/17/22 inspection. Active s/17/22 inspection. The E& //1/22 inspection. The E& Active es, anti-vortex device, eme Neal Drickey was reminded Active tabilization of Lot 33, insta prior to the 4/5/22 inspect Active 22 inspection. Neal Dricke & Active *A inspector will continue ontaining sediment, so insta odding of upgradient lots, i	No N

Current Condition:	Good Condition - Neal Drick	ey installed ST B and SD	D - J prior to the 3/17/22 ins	spection. Due to progress of	lot-level construction an		
	storage capacity of ST D, ins						
	installed ST A and ST C prior to the 3/29/22 inspection. Neal Drickey reinstalled ST G, H, I, and J prior to the 5/17/22 inspection.						
STR	Streets	On Site	4/1/2021	Active	No		
Current Condition:	Good Condition - Trackout v	vas observed on Copper	Mountain Drive during the 3	17/22 inspection. Neal Drick	ey cleaned the streets		
	prior to the 4/5/22 inspection. Neal Drickey cleaned the streets prior to the 5/17/22 inspection. No major signs of trackout were						
	observed during the most recent inspection.						
SWPPP Sign	SWPPP Sign	On Site	3/31/2022	Active	No		
Current Condition:	Good Condition - The E&A in	nspector installed the sig	n north of the Silver Lane en	trance during the 4/26/22 ins	pection.		
W 1	Straw Wattles	East Side of Copper Mountain Drive	3/29/2022	Active	No		
Current Condition:	Good Condition - Neal Drickey installed the wattles along the ROW of Copper Mountain Drive and Silver Lane prior to the 3/29/22 inspection.						
W A - H	Straw Wattles	See SWPPP	4/5/2022	Active	No		
Current Condition:	Good Condition - Neal Drickey installed erosion control matting in place of W A, installed W B, and installed silt fence in place of W C prior to the 4/5/22 inspection. Due to progress of lot-level construction, installation of W D - H is not recommended. E&A inspector will continue to monitor.						
WO 1	Concrete Washout	On site	3/24/2022	Active	No		
Current Condition:	Good Condition - Neal Drickey cleaned up the concrete waste and installed a designated concrete washout east of SB 1 prior to the 4/5/22 inspection.						
WS 01	Waste Storage Area	On site	4/1/2021	Pending	No		
Current Condition:	Pending - Dumpsters were in place on individual lots during the 3/17/22 inspection. General site waste storage will be recommended a necessary. E&A inspector will continue to monitor.						
WT A - H	Wattles	See SWPPP		Removed			
Current Condition:	Removed - Maintenance for wattles will be assigned to individual lots as 3/17/22.						
Certification Statement	"I certify, under penalty of law with a system designed to as inquiry of the person or pers information submitted is, to t penalties for submitting false	ssure that qualified perso ons who manage the sys he best of my knowledge	nnel properly gathered and e tem or those persons directly and belief, true, accurate, a	y responsible for gathering th nd complete. I am aware tha	omitted. Based on my le information, the t there are significant		
spector Signature:	May			Reviewed By:	to Se		