E & A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599 www.eacg.com



Zachary A. Jilek, CPESC, CISEC

Environmental Services Dept. Manager

Engineering Answers

Environmental oct vices	2 op aaago.	=				
		E&A - P	2020.100.002			
Inspector: Nathan Hack	or: Nathan Hack					
		Golden Hills Phase II				
Project Name:						
For Week Ending:		51526				
Project Location:	Golder	Golden Hills Drive & Old Mormon Bridge Road (Crescent, Iowa)				
• "	1 1000/				T T	
Grading:	100%					
Sanitary Sewer:	100%					
Storm Sewer:	100%					
Paving:	100%					
Seeding:	70%					
Utilities:	100%					
Overall Development:	70%					
RAIN FALL AMOUNTS	Amount in tenths	Date inspected	Weather Conditions	Time	Storm Event Times	
					Week 1	

RAIN FALL AMOUNTS	Amount in tentris	Date inspected	Weather Conditions	Time	Storm Event Times
					Week 1
Sunday	0.00"				
Monday	0.00"				
Tuesday	0.00"	3/21/2023	Cloudy 51/34	2:45 PM	
Wednesday	0.00"				
Thursday	0.00"				
Friday	0.00"				
Saturday	0.00"				

Complaints:

Grading began in spring 2021; Entire site graded by fall 2021 (3/17/22). Grading in the northeast quarter of the site (5/17/22). Excavation of hillside on northeast portion of site (11/8/22). Minor ground disturbance for mailbox installation (11/28/22). Sidewalk installation active along lots 41, 42, and 43 (1/10/23). Tree removal and grubbing on northeast corner of site (1/24/23)

Which portion(s) (i.e. drainage basins) of the site do not have grading, earthwork, or ground disturbance scheduled in the next 14 days?

Grading began in spring 2021; Entire site graded by fall 2021 (3/17/22). Grading in the northeast quarter of the site (5/17/22). Excavation of hillside on northeast portion of site (11/8/22). Minor ground disturbance for mailbox installation (11/28/22). Sidewalk installation active along lots 41, 42, and 43 (1/10/23). Tree removal and grubbing on northeast corner of site (1/24/23)

What temporary or permanent stabilization measures listed in this section are being implemented?

Existing vegetation (3/17/22). Slope along SW corner of the site seeded / matted in fall 2021 (3/17/22). Area west of Lot 33 and Lot 61 seeded / matted (3/29/22). North side of Silver Lane and east side of Copper Mountain Drive seeded / matted (3/29/22). South side of Silver Lane and west side of Copper Mountain Drive seeded / matted (4/5/22). Rear of Lots 58 - 60 partially seeded / matted (4/5/22). Disturbed area behind Lots 38 - 40 seeded / matted (4/5/22). Lots 34-40 and 59-61 sodded (4/12/22). Rear of Lots 55 - 57 seeded / matted (7/26/22). Rear of lot 42 seeded / matted (11/8/22).

Checklist Questions:

are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?

reate Corrective Action?

See BMP Section

Have disturbed areas been seeded or otherwise stabilized as required? List inactive portions of the project and if stabilization measure are adequate or needed to prevent erosion.

Create Corrective Action?

Are waste materials (concrete, construction material, hazardous, etc.) being managed properly?

Create Corrective Action?
No, see BMP Section

Are construction entrances and adjacent streets being maintained adequately?

Create Corrective Action? No, see BMP Section Is dust associated with the construction activity adequately controlled on the site? Yes Create Corrective Action? N/A Comments: 1.) Site was active during the last inspection.

- Findings / Corrective Actions (Date):
 Findings / Corrective Actions (Date):
- 1.) Some maintenance is required in the BMP section.
 2.) E&A began inspecting the site on 3/17/22 after being contracted for SWPPP services by Neal Drickey.

Haiman Nama	T	Laadiaa	Dunis stad In stall Date	Otatura	Maintanana		
Unique Name CE 01	Type Construction Entrance	Location X3	Projected Install Date	Status Removed	Maintenance		
Current Condition:	Removed - Neal Drickey paved the entrance prior to the 3/17/22 inspection.						
CE 02	Construction Entrance	D6	ine 3/17/22 inspection.	Removed	<u> </u>		
Current Condition:	Removed - Neal Drickey pay		the 3/17/22 inspection	Removed			
	- ''	BB7	4/1/2021	Antivo	Vaa		
CE A Current Condition:	Construction Entrance			Active	Yes		
Current Condition:	Poor Condition -5% effective - Neal Drickey installed the entrance prior to the 3/17/22 inspection. CE A is no longer effective; a						
	negligible amount of rock remains present (2/14/23). CE A continues to experience use despite its ineffectiveness (2/28/23). CE A was compacted without the addition of rock to the entrance prior to the 3/21/23 inspection.						
	compacted without the day		ranco prior to the 0/2 //20 me	podioni			
	A 6" layer of 2" diameter roc	k should be added to the	entrance, or the entrance shou	uld be stabilized and close	d off to prevent anyone		
	from accessing the site from	this location.					
			lot done as of last inspection. N	leal Drickey was reminded	d on 4/21/22, 5/24/22,		
D0.4 C	6/24/22, 7/20/22, 8/3/22, 8/1		2/03/23.	-	ı		
DS 1 - 6 Current Condition:	Diversion Pomoved Due to progress	See SWPPP	l diversions 1-6 will no longer be	Removed	11/01/2022 inspection		
Current Condition:	Removed - Due to progress	of lot-level construction	diversions 1-6 will no longer be	recommended as or the	1 1/0 1/2022 IIISpection.		
DS A - O	Diversion	See SWPPP	4/1/2021	Active	Yes		
Current Condition:			I - M prior to the 3/17/22 inspec				
			OS C, DC E - H and DS O is no				
			inspector will continue to moni				
			level construction in the area, r				
	installed Diversion N prior to	the inspection on 11/8/2	2.		·		
	Diversion D should be install	led.					
		o complete by 3/31/22. N	lot done as of last inspection. N	leal Drickey was reminded	d on 5/24/22, 6/24/22,		
	7/20/22, 11/30/22, 2/03/23						
ECM 1	Erosion Control Matting	SW Corner	4/1/2021	Active	No No		
Current Condition:			control matting along the slope		tion. Neal Drickey		
	extended the matting north a		40 and 35-40 prior to the 4/5/2	z inspection.			
504.0	Erosion Control Matting	East Side of Copper	3/29/2022	Active	No		
ECM 2		Mountain Drive					
Current Condition:			ontrol matting along the ROW oved for utility work prior to the				
	monitor.	e or the matting was rem	oved for utility work prior to the	4/20/22 Inspection. Earl	rispector will continue to		
	monitor.	West Cide of Conner	<u> </u>		I		
ECM 3	Erosion Control Matting	West Side of Copper Mountain Drive	4/5/2022	Active	No		
Current Condition:	Good Condition - Neal Drick		ontrol matting along the ROW	of Conner Mountain Drive	and Silver Lane prior to		
Gurrent Gondition.	the 4/5/22 inspection.	oy motanou are erector t	one of matering along the receiv	or coppor mountain Brivo	and onvoi Earlo prior to		
ECM 3	Erosion Control Matting	Western Perimeter	4/5/2022	Active	No		
Current Condition:		ev installed the erosion of	control matting along several se				
FT 01	Fuel Tank	On Site	3/17/2022	Active	No		
Current Condition:			orth of SB A prior to the 3/17/22				
Janon Johanni.	fuel tank prior to the 4/5/22 in	•	02 / pilot to tilo 0/11/2/	pood.c / todi Bilokoy	a 20 around aro		
IP 1 - 10	Inlet Protection	·	3/34/3033	Dondina	Vaa		
Current Condition:	Pending -	On Site	3/24/2022	Pending	Yes		
Gurrent Contaition:	- Chaing -						
	Inlet protection should be ins	stalled on the ten grate in	lets on Silver Lane				
	Inlet protection should be installed on the ten grate inlets on Silver Lane.						
	Neal Drickey was informed to complete by 3/24/22. Not done as of last inspection. Neal Drickey was reminded on 4/21/22, 5/24/22,						
	6/24/22, 7/20/22, 8/3/22, 8/16/22, 11/9/22, 11/30/22, 2/03/23						
Lot 33	Individual Lot	Lot 33		Removed			
Current Condition:	Removed - Neal Drickey soc	ded the lot prior to the 4	/5/22 inspection.				
Lot 34	Individual Lot	Lot 34		Removed			
Current Condition:	Removed - Neal Drickey sodded the lot prior to the 4/12/22 inspection.						
Lot 35	Individual Lot Lot 35 Removed						
Current Condition:	Removed - Neal Drickey soc		l /12/22 inspection	Removed	I.		
Janon Johanon.		accurate for prior to the 4	.2,22 1100001011.				

1 100			T			
Lot 36	Individual Lot	Lot 36	/12/22 increation	Removed		
Current Condition:	Removed - Neal Drickey sod	·	r 12/22 inspection.		ı	
Lot 37	Individual Lot Removed - Neal Drickey sod	Lot 37	/12/22 increation	Removed		
Current Condition:			r 12/22 inspection.		ī	
Lot 38	Individual Lot	Lot 38	140/00: "	Removed		
Current Condition:	Removed - Neal Drickey sod	•	/12/22 Inspection.			
Lot 39	Individual Lot	Lot 39		Removed		
Current Condition:	Removed - Neal Drickey sod	·	/12/22 inspection.			
Lot 40	Individual Lot	Lot 40		Removed		
Current Condition:	Removed - Neal Drickey sod	Ided the lot prior to the 4	/12/22 inspection.			
Lot 41	Individual Lot	Lot 41	8/2/2022	Active	No	
Current Condition:	Good Condition - Neal Drickey began excavating the lot prior to the 8/2/22 inspection. Neal Drickey repaired the erosion rills prior to the inspection on 11/29/22. Sidewalk paving was completed in front of the lot prior to the 3/14/23 inspection. Neal Drickey installed wattles on the front and downhill side of the lot prior to the 3/21/23 inspection. E&A inspector will monitor for lot stabilization.					
Lot 42	Individual Lot	Lot 42	8/2/2022	Active	No	
Current Condition:			e lot prior to the 8/2/22 inspecti			
	lot prior to the 3/14/23 inspec	ction. Neal Drickey insta	alled wattles on the front and	downhill side of the lot	orior to the 3/21/23	
	inspection. E&A inspector	will monitor for lot stal				
Lot 43	Individual Lot	Lot 43	8/2/2022	Active	No	
Current Condition:		ction.Neal Drickey insta	e lot prior to the 8/2/22 inspecti Illed wattles on the front and bilization.			
Lot 54	Individual Lot	Lot 54		Removed		
Current Condition:	Removed - Neal Drickey sod		inspection on 10/11/22.	D 1	Г	
Lot 55	Individual Lot	Lot 55	i	Removed		
Current Condition: Lot 56	Removed - Neal Drickey sod		Inspection on 10/11/22.	Domovod	I	
Current Condition:	Individual Lot Removed - Neal Drickey sod	Lot 56	inspection on 10/11/22	Removed		
Lot 57	Individual Lot	Lot 57		Removed		
Current Condition:	Removed - Neal Drickey sod		inspection on 10/11/22.	rtomovou		
Lot 58	Individual Lot	Lot 58		Removed		
Current Condition:	Removed - Neal Drickey sod	Ided the lot prior to the 5	/17/22 inspection.	•	•	
Lot 59	Individual Lot	Lot 59	I	Removed		
Current Condition:	Removed - Neal Drickey sod		/12/22 inspection.	1101110104	l .	
Lot 60	Individual Lot	Lot 60	· · · · · · · · · · · · · · · · · · ·	Removed		
Current Condition:	Removed - Neal Drickey sod		/12/22 inspection	rtemoved	l	
Lot 61	<u> </u>		I	D	I	
Current Condition:	Individual Lot Removed - Neal Drickey sod	Lot 61	/12/22 inspection	Removed		
	•	•				
MS 01	Material Storage	On Site	4/1/2021 naterial storage area prior to the	Active	No 11 and 15 are being	
Current Condition:			naterial storage area prior to the Ps are being recommended for			
PB X	Portable Bathroom	On Site	7/12/2022	Active	Yes	
Current Condition:	The portable toilet should be Neal Drickey was informed to 11/9/22, 11/30/22, 2/03/23	secured. complete by 7/19/22. N	on Lot 49 prior to the 7/12/22 in lot done as of last inspection.		i on 8/3/22, 8/16/22,	
SB 1	Sediment Basin	N of CE 1	4/1/2021	Active	Yes	
Current Condition:	Poor Condition - 10% filled - Neal Drickey installed the sediment basin prior to the 3/17/22 inspection. The E&A inspector painted the					
	cleanout mark on the riser during the 4/19/22 inspection. The basin should be installed per the SWPPP plan, including a berm around all sides, anti-vortex device, emergency spillway, and properly elevated dewatering holes. Neal Drickey was informed to complete by 3/24/22. Not done as of last inspection. Neal Drickey was reminded on 4/21/22, 5/24/22, 6/24/22, 7/20/22, 8/3/22, 8/16/22, 11/9/22, 11/30/22, 2/03/23					
SF 1 - 3	Silt Fence	See SWPPP	4/1/2021	Active	Yes	
Current Condition:	Fair Condition - Neal Drickey installed SF 3 prior to the 4/20/21 inspection. Due to stabilization of Lot 33, installation of SF 2 is no longer recommended as of 4/5/22. Neal Drickey cleaned out, repaired, and extended SF 3 prior to the 4/5/22 inspection. Due to stabilization of Lot 61, installation of SF 1 is no longer recommended as of 4/12/22. Silt fence should be cleaned out and removed. The area should then be stabilized. Neal Drickey was informed to complete by 10/18/22. Not done as of last inspection. Neal Drickey was reminded on 11/9/22, 11/30/22,					
	2/03/23	5 complete by 10/16/22.	Not done as or last inspection.	TNEAL DITCKEY WAS TEITINGS	50 OH 11/9/22, 11/30/22,	
SF A - Q	Silt Fence	See SWPPP	4/1/2021	Active	Yes	

Inspector Signature:	not m			Reviewed By:	to Sur	
Certification Statement	with a system designed to as inquiry of the person or perso information submitted is, to t	ssure that qualified perso ons who manage the sys he best of my knowledge	d all attachments were prepared onnel properly gathered and eva- stem or those persons directly re- e and belief, true, accurate, and e possibility of fines and impriso	aluated the information subsesponsible for gathering the complete. I am aware that	omitted. Based on my ne information, the nt there are significant	
Current Condition:	Removed - Maintenance for	wattles will be assigned				
Current Condition: WT A - H	1	'	ual lots during the 3/17/22 insprinue to monitor. Dumpsters wer		•	
WS 01	2/03/23 Waste Storage Area	On site	4/1/2021	Active	No	
	Due to hole in the concrete v		ould be replaced or repaired. Not done as of last inspection.	Neal Drickey was reminde	ed on 11/9/22, 11/30/22,	
Current Condition:		cleaned up the concrete	e waste and installed a designa	ted concrete washout eas	t of SB 1 prior to the	
WO 1	continue to monitor. Concrete Washout	On site	3/24/2022	Active	Yes	
Current Condition:	Good Condition - Neal Drickey installed erosion control matting in place of W A, installed W B, and installed silt fence in place of W C prior to the 4/5/22 inspection. Due to progress of lot-level construction, installation of W D - H is not recommended. E&A inspector will					
W A - H	Straw Wattles	See SWPPP	4/5/2022	Active	No	
Current Condition:	Good Condition - Neal Drick inspection.		long the ROW of Copper Moun	tain Drive and Silver Lane	prior to the 3/29/22	
W 1	Straw Wattles	East Side of Copper Mountain Drive	3/29/2022	Active	No	
Current Condition:			n north of the Silver Lane entra rmation during the 1/3/2023 ins		pection. E&A inspector	
SWPPP Sign	SWPPP Sign	On Site	3/31/2022	Active	No	
Current Condition:	prior to the 4/5/22 inspection during the most recent inspe	. Neal Drickey cleaned the ction. Neal Drickey clear	Mountain Drive during the 3/17, the streets prior to the 5/17/22 in the streets prior to the 8/23, ckey cleaned the streets prior to	nspection. No major signs /22 inspection. No major s	of trackout were observed	
STR	Streets	On Site	4/1/2021	Active	No	
Current Condition:	storage capacity of ST D, insinstalled ST A and ST C prio Drickey cleaned out ST C pr	stallation of ST K is not re or to the 3/29/22 inspection ior to the 8/2/22 inspection of grading and lot-level co	D D - J prior to the 3/17/22 inspector of the state of 3/24/22. E& on. Neal Drickey reinstalled ST on. Neal Drickey cleaned out S' instruction in the area, reinstallate inspection on 11/8/22.	A inspector will continue t G, H, I, and J prior to the T A and removed ST B, S	o monitor. Neal Drickey 5/17/22 inspection. Neal Γ G, H, I, and J prior to	
ST A - K	Sediment Trap	See SWPPP	4/1/2021	Active	No	
		· ·	roance in the northeast quadra		d on 8/3/22, 8/16/22,	
	covered 70% of exposed dirt near SF L, M, O prior to the inspection on 8/23/22. E&A inspector will continue to monitor. Silt fence should be installed around the ground disturbance in the northeast guadrant of the site.					
	during lot-level fine grading prior to the 3/29/22 inspection. Reinstallation will not be recommended. Due to seeding / matting behind lot 61, reinstallation of SF N is no longer recommended as of the 3/29/22 inspection. E&A inspector will continue to monitor. Neal Drickey removed SF B and installed SF I prior to the 4/5/22 inspection. SF I is adequately containing sediment, so installation of SF H is no longer recommended as of 4/5/22. E&A inspector will continue to monitor. Due to sodding of upgradient lots, installation of SF E is no longer recommended as of 4/19/22. E&A inspector will continue to monitor. Minor damage was observed to SF L during the 5/3/22 inspection. E&A inspector will continue to monitor. Minor damage was observed to SF L during the 5/3/22 inspection. E&A inspector will continue to monitor. Neal Drickey removed SF L, M, and O prior to the 8/2/22 inspection. Vegetation has					
Current Condition:	Fair Condition - Neal Drickey installed SF A-D and SF L, M, O, P prior to the 3/17/22 inspection. Neal Drickey removed SF C and D					