E&A Consulting Group, Inc. 330 North 117th Street Omaha, NE 68154-2509 tel 402.895.4700 fax 402.895.3599 www.eacg.com



Zachary A. Jilek, CPESC, CISEC Erosion Control Specialist- Manager

Erosion Control Specialist- Man	-	E&A- P2006.0	56.01		
Inspector: Mike Jacobson					Stage
		Irc	on Horse		3
Project Name:		NE	R110574		
For Week Ending:			13/2010		
Project Location:	Hwy 6 & Iron Horse Drive- Ashland, NE (Sanders County)				68003
•		• • • • • • • • • • • • • • • • • • • •	• / · · · · · · · · · · · · · · · · · ·		
Grading:	100				
Sanitary Sewer:	90				
Storm Sewer: Paving:	90				
Seeding:	100				
Utilities:	90	0%			
Overall Development:	50	0%			
RAIN FALL AMOUNTS	Amount in tenths	Date inspected			Week
Sunday:	0.04"				TOCK
Monday	0.00"				
Tuesday	0.00"				
Wednesday	0.00"				
Thursday Friday	0.00" 0.09"				
Saturday	0.02"				
					Week 2
Sunday:	0.05"				
Monday	0.00"				
Tuesday	0.00"	02/23/10			
Wednesday	0.00"				
Thursday Friday	0.00"				
Saturday	0.00"				
					Week 3
Sunday:	0.00"				
Monday	0.00"				
Tuesday	0.00"				
Wednesday Thursday	0.00"				
Friday	0.00"				
Saturday	0.10"				
					Week 4/5
Sunday:	0.00"				
Monday	0.20"				
Tuesday Wednesday	0.07" Trace				
Thursday	0.60"				
Friday	0.05"	03/12/10			
Saturday	Trace				
0 - mm lainta	None				
Complaints:					
Construction Sequencing:	<u>I</u>		<u></u>	ļ.	4
Which portion(s) (i.e. drainage basins) o	f the site have had a tempor	ary or permanent cessa	ion of grading, earthwork	, or ground disturbance in	n the last 14 days?
Entire site: grading completed and	etabilized prior to Sprin	a 2005			
Entire site; grading completed and	stabilized prior to Sprin	ig 2005.			
Which portion(s) (i.e. drainage basins) o	f the site do not have gradin	ng, earthwork, or ground	disturbance scheduled in	the next 14 days? :	
Entire site; grading completed and	stabilized prior to Sprin	a 2005.			
		.9 _000.			

Dense Vegetation, seeding/sodding, matting, Re-seeding 5/2006, paving, and landscaping.								
Comments:				•				

Comments:

Site is in overall good condition. Home construction is active on site.

During last inspection some of the BMP's are still covered with snow, but appeared to be in good working condition unless otherwise noted. Findings / Corrective Actions (Date):

Findings / Corrective Actions (Date):

 Silt fence check East of lot 128 is undermined and needs to be backfilled and compacted. Boyer Young was informed to complete by 10/30/08. On 3/13/09 Boyer Young was reminded that maintenance needs to be completed ASAP. Maintenance not completed as of last inspection.
 Silt fence checks West of lot 128 are undermined and needs to be backfilled and compacted. Boyer Young was informed to complete by 10/30/08. On 3/13/09 Boyer Young was reminded that maintenance needs to be completed ASAP. Maintenance not completed as of last inspection.

3) Varies empty lots have concrete/debris on them and it needs to be cleaned up. Boyer Young was informed to complete by 3/18/09. Maintenance not completed as of last inspection.

4) Silt fence needs to be installed on the back of lot 118. Boyer Young was informed to complete maintenance by 3/18/09. Maintenance not completed as of last inspection.

5) It is recommended to Boyer Young that silt fence should be installed on the front of lot 60. Boyer Young was informed to complete installation of silt fence by 3/18/09. Silt fence has not been installed as of last inspection.

6) Lot 123 lot level silt fence is down/damaged and needs to be repaired, replaced if needed. Builder Steve Faller w/ Landmark Homes was informe 7) Lot 192 lot level silt fence is down/damaged needs to be repaired, replaced if needed. Also the back silt fence run is undermined in a few areas a 8) Lot 43 lot level silt fence is down/damaged and needs to be repaired, replaced if needed. Some additional silt fence needs to be installed on the 9) Silt fence check East of lot 128 is down/damaged in a few areas and it needs to be repaired, replaced if needed. Boyer Young was informed to c 10) Some maintenance is required in the BMP section.

	Projected Install					
Unique Name	Туре	Location	Date	Status	Maintenance	
	Permanent	N00d00m00s				
PDP A	Detention Pond	W00d00m00s	In Place	Active	No	
Current Condition:	Good Condition					
		N00d00m00s				
SF 1	Silt Fence	W00d00m00s	In Place	Active	Yes	
Current Condition:	Fair Condition- Protecting run-on from adjacent corn field.					
	A few areas down/damaged and needs to be repaired or removed. Boyer & Young to remove silt fence or maintenance by 3/21/08. On 3/13/09 Boyer Young was reminded that maintenance needs to be completed ASAP. Maintenance not completed as of last inspection.					
SF 2	Silt Fence	N00d00m00s W00d00m00s		Removed		
Current Condition:			need to be reinstalled		uction starts up in this	
	Removed due to good vegetation, but will need to be reinstalled once home construction starts up in this area.					
		N00d00m00s				
SF 3	Silt Fence	W00d00m00s	In Place	Active	Yes	
Current Condition:	 Fair Condition- Partially removed due to good vegetation, but will need to be reinstalled once home construction start up in this area. A few areas area down/damaged and needs to be repaired. Boyer Young was informed to complete maintenance by 7/24/08. On 3/13/09 Boyer Young was reminded that maintenance needs to be completed ASAP. Maintenance not completed as of last inspection. 					
		N00d00m00s				
SF 4	Silt Fence	W00d00m00s		Removed		
Current Condition:	Removed due to good vegetation.					
		N00d00m00s				
SF 5	Silt Fence	W00d00m00s	In Place	Active	Yes	
Current Condition:	Fair Condition One area is down/damaged and full and needs to be repaired and cleaned out. Boyer Young was informed to complete by 6/6/08. On 3/13/09 Boyer Young was reminded that maintenance needs to be completed ASAP. Maintenance not completed as of last inspection.					
		N00d00m00s				
SF 6	Silt Fence	W00d00m00s		Removed		
Current Condition:	Removed due to de	evelonment				

SF 7	Silt Fence	N00d00m00s W00d00m00s		Removed		
Current Condition:	Removed due to development.					
STR	Streets	N00d00m00s W00d00m00s	In Place	Active	Yes	
Current Condition:	Fair Condition-					
	There is some minor run off in the Iron Horse Drive Circle and it needs to be cleaned up.					
	Boyer Young was informed to clean up 3/14/10.					
SWPPP Sign	SWPPP Sign	Three signs of site	8/8/2008	Active	No	
Current Condition:	Good Condition - A sign has been installed at Club House Drive and Hwy 6 and at Iron Horse Drive and Hwy 6. South Lakeview Way & South Bend Road entrance. During inspection on 4/29/09 inspector found a SWPPP sign in a pile of concrete debris at the entrance at South Lakeview Way & South Bend Road and re-installed during inspection. Therefore there are know three signs on site.					
Inspector Signature:			Reviewed By:	Ednany K. Jilde		