E&A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599

www.eacg.com

Yes



Zachary A. Jilek, CPESC, CISEC

**Engineering Answers** 

		E&A- P2014.577	<b>'</b> .001		
Inspector: Colton Reeder					Stage
Project Name:		Shelby High School NER115160			
For Week Ending:					
Project Location:	Walr	68662			
Froject Location.	vvaii	iut St. and washingt	on St, Shelby, NE (Polk	County)	00002
Grading:	100%				
Sanitary Sewer:	100%				
Storm Sewer:	100%				
Paving:	100%				
Seeding:	70%				
Utilities:	100%				
Overall Development:	94%				
RAIN FALL AMOUNTS	Amount in tenths	Date inspected	Weather Conditions		
Sunday:	0.16"				Weel
Monday	1.23"			+	+
Tuesday	0.05"	09/26/17	64/55 Rain	+	
Nednesday	0.00"	00/20/17	OT/OU INAIII	+	
Thursday	0.00"			+	
-riday	0.00"			+	
Saturday	0.00"			1	
	0.00				Weel
Sunday:	0.46"				
Monday	017"				
Tuesday	0.40"				
Vednesday	0.00"				
Thursday	0.40"				
Friday	1.10"				
Saturday	0.93"	10/07/17	73/51 Rain		
					Weel
Sunday:	0.00"				
Monday	0.21"				
Гuesday	0.43"				
Wednesday	0.00"				
Thursday	0.00"				
Friday	0.00"				
Saturday	0.01"				
	INI				
Complaints:	None				
complaints.					
Construction Sequencing:				_	
Vhich portion(s) (i.e. drainage basins) o	f the site have had a tempora	ary or permanent cessation	on of grading, earthwork, or	ground disturbance in	the last 14 days?:
Grading is active (6/11/15) Phase 1 Grading of Phase 2 has been comp (8/1/16)					
Which portion(s) (i.e. drainage basins) o					
Grading is active (6/11/15). Phase for Grading of Phase 2 has been comp (8/1/16).					
What temporary or permanent stabilizati Existing Vegetation. The area Wes started (4/28/17). Parking lot island pasketball court on the east side of	st and East of the football s and drainage easemen	field and track were s t along south side of fo	eeded or sodded(11/3/15		
SUMMARY QUESTIONS:					
Are approved entrances and adjacent st	reets being maintained adeq	uately?			
1					

Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?						
No- sediment was deposited in the drainage	ge along the sou	th side of the site.				
CHECKLIST QUESTIONS:						
Are waste materials (concrete, construction mat	erial, hazardous, e	tc.) being managed proper	ly?			
No, See Findings/Corrective Actions Secti	on.					
Is dust associated with the construction activity	adequately contro	olled on the site?				
Yes						

## Comments:

## Comments:

1) An Email was received from Doug Walter asking what percentage of the project area needs to be stailized in order to stop performing erosion control inspections. Zach Jilek informed Doug Walter that the site needs 70% density of permanent ground cover to meet closure requirements. There are also still BMP's that need removed to close the project after stabalization has taken place. The current estimated ground cover is around 50% as of the inspection on 10/07/17.

## Findings / Corrective Actions (Date):

Findings / Corrective Actions (Date):

- 1.) See BMP section for required maintenance.
- 2.) The area disturbed along the west end of the athletic field needs to be seeded and stabilized. BD Construction was informed to complete by 1/30/17. Not done as of last inspection. BD Construction was reminded on 3/21/17, 3/30/17, 4/16/17, 5/24/17, 6/28/17, 8/20/17, 9/18/17.
  3.) The sediment that has deposited in the drainage way along the south side of the site needs to be cleaned up. BD Construction was informed to complete by 1/30/17. Not done as of the last inspection. BD Construction was reminded on 3/21/17, 3/30/17, 4/16/17, 5/1/17, 5/24/17, 6/28/17, 8/20/17, 9/18/17.
- 4.) The area disturbed by utility work in the drainage way to the south of the site needs to be stabilized. BD Construction was informed to complete by 1/30/17. Not done as of the last inspection. BD Construction was reminded on 3/21/17, 3/30/17, 4/16/17, 5/1/17, 5/24/17, 6/28/17, 8/20/17, 9/18/17.
  6.) Detention pond was completed and the area needs to be stabilized. Also a silt fence needs to be installed at the outlet pipe to prevent more runoff to ditch. BD Construction was informed to complete by 5/29/17. A piece of silt fence fabric was installed across the outlet pipe, but was not entrenched or secured. The pond was not stabilized as of the last inspection. BD Construction removed the silt fence from the outfall prior to the inspection on 6/14/17. BD Construction was informed to reinstall silt fence or a bale check at the outfall on 6/28/17 by 7/5/17. Not done as of the last inspection. BD Construction was reminded on 8/20/17, 9/18/17.

Unique Name	Туре	Location	Projected Install Date	Status	Maintenance	
·		Southwest of Football	-			
A1	Silt Fence	Field		Removed		
Current Condition:	Removed - BD Construction removed the silt fence for final stabilization as of the 9/24/15 inspection.					
A2	Silt Fence	South of Football Field		Removed		
Current Condition:			due to paving in the area as		pection.	
A3	Silt Fence	East of Football Field		Removed		
Current Condition:	Removed - BD		he silt fence for final stabiliza	ation as of the 9/24	15 inspection.	
		Northwest of Football				
A4	Silt Fence	Field	<u> </u>	Removed		
Current Condition:	Removed - The	silt fence is no longer n	eeded due to paving in the	area as of the 9/15/	15 inspection.	
A5	Silt Fence	West of Football Field		Removed		
Current Condition:			ne silt fence for final stabiliza		/15 inspection	
Current Condition.	rtemoved - BB	Construction removed to		1011 43 01 1110 3/2-4	10 mapeonom.	
A9	Silt Fence	Southeast side of site		Removed		
Current Condition:	Removed - The	silt fence was not need	ed during construction.			
A10	Silt Fence	Southeast side of site		Removed		
Current Condition:	Silt Fence was	removed due to flatness	of area and inactivity it will	not be re-installed a	at this time.	
A11	Silt Fence	South side of site		Removed		
Current Condition:	Silt Fence was removed due to completion of parking lot. Silt fence will not be re-installed at this time. BD has been requested to install straw wattles in the draining way in place of removed silt fence.					
		Southwest corner of				
A12	Silt Fence	site	1/30/2017	Pending	Yes	
Current Condition:	Pending -					
	The silt fence needs to be reinstalled or stabilize the area.  BD Construction was informed to complete by 1/30/17. Not done as of the last inspection. BD Construction was reminded on 3/21/17, 3/30/17, 4/16/17, 5/1/17, 5/24/17, 6/28/17, 8/20/17, 9/18/17.					
	Trae Forming a	Southwest corner of	<u> </u>	I		
A13	Silt Fence	site	1/30/2017	Pending	Yes	
Current Condition:	Pending -					
	The silt fence needs to be reinstalled or stabilize the area.					
	BD Construction was informed to complete by 1/30/17. Not done as of the last inspection. BD Construction was reminded on 3/21/17, 3/30/17, 4/16/17, 5/1/17, 5/24/17, 6/28/17, 8/20/17, 9/18/17.					
		South of existing				
A17	Inlet filter	building		Removed		

Current Condition:	Removed- Area	was paved prior to insp	ection on 5/22/17 by BD Co	onstruction.			
		South of existing	•				
A18	Inlet filter	building	" F/00/47 L DD 0	Removed			
Current Condition:	Removed- Area	Between building on	ection on 5/22/17 by BD Co	nstruction.			
A19	Inlet filter	north side of the site		Removed			
Current Condition:	Pending - Then	inlet was removed prior	to inspection on 11/14/16.				
		Between building on					
A20	Inlet filter	north side of the site	3/7/2016	Active	No No		
Current Condition:			ired and paved around the i	niet prior to the insp	Dection on 6/14/17.		
	E&A will monitor the need for BMP installation.  Between building on						
A21	Inlet filter	north side of the site	7/5/2017	Pending	Yes		
Current Condition:	Pending -	morar order or and order	170/2011	1 5.14.1.9			
	, and the second						
	Inlet protection needs to be installed or the area around the inlet needs to be stabilized.						
	DD Cometmostic		1-4- b 7/5/47 NI-4 d	-64114:4:-	- DD 0		
		n was informed to comp on 8/20/17, 9/18/17.	lete by 7/5/17. Not done as	of the last inspectio	n. BD Construction		
	was reminded to			I			
A22	Inlet filter	Between building on north side of the site	7/5/2017	Pending	Yes		
Current Condition:	Pending -	HOLLIT SIDE OF THE SITE	1/3/2017	Pending	162		
Current Condition.	r ending -						
	Inlet protection	needs to be installed or	the area around the inlet ne	eds to be stabilized	l.		
			lete by 7/5/17. Not done as	of the last inspectio	n. BD Construction		
		on 8/20/17, 9/18/17.					
Б	Construction			D d			
B Current Condition:	Entrance	Field	nanent entrance for school r	Removed	as of the 1/27/16		
Current Condition:	inspection.	s entrance is now a peri	ianent entrance for School i	namenance crews	as 01 the 1/2//10		
	Construction	South side of existing		I			
B 2	Entrance	parking lot		Removed			
Current Condition:			ne entrance for paving purp		pection on 6/14/17.		
			, ,,,	·			
	Construction						
B 3	Entrance	Southeast side of site		Active			
Current Condition:	Removed - BD		construction entrance prior	to inspection on 5/1	/17.		
24	lalat Dasta etian	Southeast of Football		D d			
C1 Current Condition:	Inlet Protection		from the report due to the i	Removed	completed area of		
Current Condition.		f the 3/21/16 inspection.		illet be located iii a	completed area of		
	' '	Northeast of Football					
C2	Inlet Protection			Removed			
Current Condition:			from the report due to the i	nlet be located in a	completed area of		
	the project as o	f the 3/21/16 inspection.					
		Northwest of Football					
C3	Bale Check	Field	1/30/2017	Pending	Yes		
Current Condition:	Pending -						
	The bale check needs to be reinstalled due to continued runoff from the athletic field eroding the adjacent						
	drainage way.	Thoods to be remetalled	ado to continuou ranon non		roung the dajacent		
			lete by 1/30/17. Not done as				
	was reminded of	on 3/21/17, 3/30/17, 4/16	6/17, 5/1/17, 5/24/17, 6/28/1	7, 8/20/17, 9/18/17.			
C4	Bale Check	North of B2	7/11/2017	Active	No		
Current Condition:	1	- BD Construction insta	lled a straw wattle at the fla	red end prior to the	inspection on		
	7/11/17.						
05	<b>.</b>	Northwest of Football					
C5 Current Condition:	Bale Check	Field Construction removed the	ne straw wattle due to comp	Removed	abalization in the		
Current Condition:		nspection on 8/30/17.	ie straw wattie due to comp	iletion of sodding/st	abalization in the		
	2.50 40 51 116 11	Northwest of Football					
C6	Bale Check	Field		Removed			
Current Condition:			L ne straw wattle due to comp		abalization in the		
		nspection on 8/30/17.					
C7	Bale Check	East property line	7/11/2017	Active	No		
Current Condition:	1		stalled a straw wattle in the	drainage near the co	emetary prior to the		
	inspection on 7	/11/17.					
		Northwest of Football					
C8	Bale Check	Field		Removed	-1-1:4: ' ''		
Current Condition:		Construction removed the repection on 8/30/17.	ne straw wattle due to comp	etion of sodding/st	apalization in the		
CW	Concrete	On Site		Removed			
CVV	Concrete	OII SILE		I removed			

Current Condition:	Removed - Due to all major paving being completed a washout is no longer being recommended.						
STR	Streets	On site	In Place	Active	No		
Current Condition:	Good Condition - No major signs of track off.						
		Southwest of Football					
SWPPP Sign	SWPPP Sign	Field	7/1/2015	Active	No		
Current Condition:	Good Condition	Good Condition - The inspector installed the SWPPP sign on 7/1/15.					
		Southeast Corners of					
Wattle Check 1	Straw Wattle	site		Removed			
Current Condition:	Removed - BD Construction removed the wattle prior to the inspection on 7/27/17.						
		North west corner of					
Wattle Check 2	Straw Wattle	site	7/11/2017	Active	No		
Current Condition:	Good Condition - BD Construction installed 2 wattles in the drainage way near the construction trailer prior						
	to the inspection on 7/11/17.						
Wattle Check 3	Straw Wattle	West of entrance B3		Removed			
Current Condition:	Removed - BD Construction removed the straw wattle prior to inspection on 5/22/17.						
Inspector Signature: Calton R. Reeder				Reviewed By:	Est Sul		