E & A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599 www.eacg.com

Comments:



Zachary A. Jilek, CPESC, CISEC **Engineering Answers** Environmental Services Dept. Manager E&A - P2019.327.000 Inspector: Shaun McGuire Stage **Springfield Pines** 1 CSW-201600337 Project Name: 5/13/2023 68059 For Week Ending: Project Location: SW of 132nd Street and Platteview Road, Springfield, NE Phase I Grading: 100% Sanitary Sewer: 100% Storm Sewer: 100% Paving: 100% Seeding: 75% **Utilities:** 100% Overall Development: 70% Amount in tenths RAIN FALL AMOUNTS Date inspected Weather Conditions Time Week 1 Sunday: 0.02" Monday: 0.03" 0.00" Tuesday: Wednesday: 0.00" 5/10/2023 Sunny 82/63 10:10 AM Thursday: 0.06" Friday: 0.00" Saturday: 0.00" Complaints: None Construction Sequencing: Which portion(s) (i.e. drainage basins) of the site have had a temporary or permanent cessation of grading, earthwork, or ground disturbance in the last 14 days? Grading in Phase I was completed prior to E&A being hired to conduct SWPPP inspections (1/3/20). ed in the next 14 days? Grading in Phase I was completed prior to E&A being hired to conduct SWPPP inspections (1/3/20). Site was seeded prior to E&A being hired to conduct SWPPP inspections (1/3/20). Portion of ground to the southeast of SB 4 seeded and matted (5/11/20). Checklist Questions: re receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity? Yes reate Corrective Action? N/A lave disturbed areas been seeded or otherwise stabilized as required? List inactive portions of the project and if stabilization measure are adequate or needed to prevent erosion. Create Corrective Action?
No, see Findings section No, see BMPs section and Findings section Yes N/A ed with the construction activity adequately controlled on the site? Yes N/A

Comments: Site was active for homebuilding during the most recent inspection.

The School Site was graded prior to the 9/23/20 inspection. The School Site is not covered by the Springfield Pines permit (SPR-20200728-5543-GP1).

Findings / Corrective Actions (Date)

Findings / Corrective Actions (Date):

- 1) Some maintenance is required in the BMP section of this report.
- 2) Vacant-disturbed lots need to be stabilized.

A. Overgraded lots during homebuilding construction need to be stabilized. All builders were informed to complete by 1/17/20 when weather allows and asneeded. Not done as of the last inspection. All builders were reminded on 9/24/20, 6/24/21. As of the 3/1/2023 inspection there are no longer any overgraded inactive lots. Inactive lots still need stabilization.

3) Concrete waste was located throughout the development. D.R. Horton was informed to clean up concrete waste in SB 4 on 3/3/22. Not done as of last inspection. D.R. Horton was reminded on 3/24/22, 5/24/22, 6/2/22, 6/17/22, 6/23/22, 8/19/22, 8/31/22, 11/11/22, 3/1/23. D.R. Horton was informed to clean up concrete waste on lot 72 on 8/31/22. Not done as of last inspection. D.R. Horton was reminded on 11/11/22, 3/1/23, 4/21/23

Unique Name	Туре	Location	Projected Install Date	Status	Maintenance	
Al 1	Area Inlet Protection	See SWPPP	1/3/2020	Active	No	
Current Condition:			inspection. The surrounding a	rea is vegetated and	the inlet drains to SB 1; i	
	inlet protection will be reco					
Al 2	Area Inlet Protection	See SWPPP	1/3/2020	Active	Yes	
Current Condition:		O .	estalled prior to the 1/3/20 inspection will be a second at the		0	
			ction will be recommended at t	the state of the s		
			talled 3 additional inlets and ad		rior to the 11/922	
	inspection. Orban Spark c	learied out the inlet pro	tection prior to the 11/9/22 insp	ection.		
	Inlet protection should be	cleaned out				
	mict protection should be	bicarica out.				
	D.R. Horton was informed	to complete by 4/26/23	3. Not done as of last inspection	n. SID was informed	to complete by 5/10/23	
Al 3	Area Inlet Protection	See SWPPP	3/9/2020	Active	No	
Current Condition:	Active - Area inlet with dor	ne grate was installed	prior to the 3/9/20 inspections.	Commercial Seeding	removed the remaining	
	fence/T-posts around the i					
Al 4	Area Inlet Protection	See SWPPP	3/9/2020	Active	No	
Current Condition:			prior to the 3/9/20 inspection. T	he surrounding area	was seeded and matted	
	the inlet drains to SB 2; no	inlet protection will be	recommended at this time.			
CW 1	Concrete Washout	Lot 81 Replat 1		Removed		
Current Condition:			alled on Lot 81 Replat 1 prior to	•		
		•	/11/20, the berm recommendat	_		
			e 6/1/20 inspection. Gene Grav			
			oncrete washout from Lot 81 Re			
			orior to the 7/7/21 inspection. G			
		•	monitor for reinstallation. D.R.			
			was removed by D.R. Horton pr		·	
			the 5/10/22 inspection. D.R. H			
	for reinstallation.	. Horton removed the c	concrete washout prior to the 10	#11/22 inspection, the	e ΕαΑ inspector will mor	
IP 1	Inlet Protection	See SWPPP	T	Removed	1	
Current Condition:			et filter prior to the 4/27/20 insp		l na hacin reinetallation is	
Current Condition.	not recommended.	sealing removed the init	et litter prior to the 4/21/20 msp	ection. Thet drains to	a basiii, reilistallatioii k	
IP 2	Inlet Protection	See SWPPP		Removed		
Current Condition:	Removed - Commercial S	eeding removed the inl	et filter prior to the 4/27/20 insp	ection. Inlet drains to	a basin, reinstallation is	
	not recommended. D.R. H	orton reinstalled the inl	let filter prior to the 6/21/22 insp	ection. D.R. Horton r	emoved the inlet filter pr	
	to the 12/21/22 inspection.	. Inlet drains to a basin,	, reinstallation is not recommen	ded.		
IP 3	Inlet Protection	See SWPPP		Removed		
Current Condition:	Removed - Commercial S	eeding removed the inl	et filter prior to the 4/27/20 insp	ection. Inlet drains to	a basin, reinstallation is	
	not recommended.	_				
IP 4	Inlet Protection	See SWPPP		Removed		
Current Condition:	Removed - Commercial S	Seeding removed the in	let filter prior to the 4/27/20 insp	pection. Inlet drains to	o a basin, reinstallation	
	not recommended. D.R. Horton reinstalled inlet filter protection prior to the 5/31/22 inspection. D.R. Horton removed the inlet filt					
	prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.					
IP 5	Inlet Protection	See SWPPP		Removed		
Current Condition:	Removed - Commercial S	eeding removed the inl	et filter prior to the 4/27/20 insp	ection. Inlet drains to	a basin, reinstallation is	
	not recommended. D.R. H	orton reinstalled inlet fi	Iter protection prior to the 5/3/2	2 inspection. D.R. Ho	rton removed the inlet fi	
	prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.					
IP 6	Inlet Protection	See SWPPP		Removed		
Current Condition:			et filter prior to the 4/27/20 insp			
	not recommended. D.R. Horton reinstalled inlet filter protection prior to the 8/30/22 inspection. D.R. Horton removed the inlet filter					
	prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.					
IP 7	Inlet Protection	See SWPPP		Removed		
Current Condition:	Removed - Commercial S	eeding removed the inl	et filter prior to the 4/27/20 insp	ection. Inlet drains to	a basin, reinstallation is	
	not recommended.					
IP 8	Inlet Protection	See SWPPP		Removed		
		ooding romoved the inl	et filter prior to the 4/27/20 insp	ection Inlet drains to	a hasin reinstallation is	
Current Condition:	Removed - Commercial S	eeding removed the ini	of filter prior to the 4/27/20 map	collon. Thick drains to	a basin, remotaliation is	
Current Condition:	not recommended. D.R. H	lorton reinstalled inlet fi	Iter protection prior to the 8/30/	22 inspection. D.R. H	,	
Current Condition:	not recommended. D.R. H	lorton reinstalled inlet fi		22 inspection. D.R. H	,	

Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.	3			
IP 10	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is recommended. D.R. Horton reinstalled inlet filter protection prior to the 3/1/22 inspection. D.R. Horton cleaned out the inlet filt prior to the 6/7/22 inspection. D.R. Horton reinstalled the inlet filter prior to the 6/21/22 inspection. D.R. Horton removed the infilter prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.	er			
IP 11	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter protection prior to the 3/1/22 inspection. D.R. Horton repaired the inlet filter prior to the 4/5/22 inspection. D.R. Horton removed the inlet filter prior to the 4/5/22 inspection. D.R. Horton removed the inlet filter prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.				
IP 12 Current Condition:	Inlet Protection See SWPPP Removed Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.	3			
IP 13	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.	3			
IP 14	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. Inlet Protection See SWPPP Removed	3			
IP 15 Current Condition:	Inlet Protection See SWPPP Removed Removed Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is				
Guirent Condition.	not recommended.	,			
IP 16	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.	3			
IP 17	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter protection prior to the 3/29/22 inspection. D.R. Horton maintained the inlet filter prior to the 8/2/22 inspection. D.R. Horton removed the inlet filter prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.				
IP 18	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 5/11/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter protection prior to the 5/3/22 inspection. D.R. Horton cleaned out the inlet filter prior to the 7/12/22 inspection. D.R. Horton cleaned out the inlet filter prior to the 8/23/22 inspection. D.R. Horton removed the inlet filter prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.				
IP 19	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.	3			
Current Condition:	Inlet Protection See SWPPP Removed Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.				
IP 21	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter prior to the 3/29/22 inspection. D.R. Horton maintained the inlet filter prior to the 8/2/22 inspection. D.R. Horton removed the inlet filter prior to the 12/21/22 inspection. Inlet drains to a basin, reinstallation is not recommended.				
IP 22	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended.	3			
IP 23 Current Condition:	Inlet Protection See SWPPP Removed Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter protection prior to the 3/1/22 inspection. D.R. Horton removed the inlet fil prior to the 7/26/22 inspection.				
IP 24 Current Condition:	Inlet Protection See SWPPP Removed				
	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter protection prior to the 3/1/22 inspection. D.R. Horton removed the inlet fill prior to the 7/26/22 inspection.				
IP 25	Inlet Protection See SWPPP Removed				
Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton removed the inlet filter prior to the 5/31/22 inspection.	3			
IP 26	Inlet Protection See SWPPP 3/29/2022 Active Yes				
Current Condition:	Fair Condition - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is not recommended. D.R. Horton reinstalled inlet filter protection prior to the 3/29/22 inspection. D.R. Horton cleaned out the inlet filter prior to the 8/16/22 inspection. Inlet filter should be removed.				
	D.R. Horton was informed to complete by 11/16/22. Not done as of last inspection. D.R. Horton was reminded on 3/1/23, 4/21 SID was informed to complete by 5/10/23. Not done as of last inspection.	/23.			
IP 27	Inlet Protection See SWPPP Removed				

Current Condition:	Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inl	let drains to a basin, reinstallation is				
IP 28	not recommended. Inlet Protection See SWPPP Rem	poved				
Current Condition:	Inlet Protection See SWPPP Removed Removed - Commercial Seeding removed the inlet filter prior to the 4/27/20 inspection. Inlet drains to a basin, reinstallation is					
Lot 1 Replat 1	not recommended. Individual Lot Lot 1 Replat 1 Rem	noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 4/12/22 inspection.	loved				
Lot 4 Replat 3	Individual Lot Lot 4 Replat 3 Rem	noved				
Current Condition: Lot 6 Replat 1	Removed - D.R. Horton sodded the lot prior to the 11/9/22 inspection. Individual Lot Lot 6 Replat 1 Rem	noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 11/9/22 inspection.	loved				
Lot 7 Replat 1	Individual Lot Lot 7 Replat 1 Rem	noved				
Current Condition: Lot 10 Replat 1	Removed - Carlson Tile Inc. sodded the lot prior to the 6/21/22 inspection. Individual Lot Lot 10 Replat 1 Rem	noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 4/19/22 inspection.	10000				
Lot 11 Replat 1		noved				
Current Condition: Lot 13 Replat 1	Removed - D.R. Horton sodded the lot prior to the 4/19/22 inspection. Individual Lot Lot 13 Replat 1 Rem	noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 4/19/22 inspection.					
Lot 19 Replat 1	Individual Lot Lot 19 Replat 1 Rem	noved				
Current Condition: Lot 20 Replat 1	Removed - Brooks Builders sodded the lot prior to the 5/10/22 inspection. Individual Lot Lot 20 Replat 1 Rem	noved				
Current Condition:	Active - Sundown Homes LLC sodded the lot prior to the 8/23/22 inspection.					
Lot 22 Replat 1 Current Condition:	Individual Lot Lot 22 Replat 1 Rem Removed - Urban Spark sodded the lot prior to the 5/17/22 inspection.	noved				
Lot 23 Replat 1		noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 4/12/22 inspection.					
Lot 28 Replat 1 Current Condition:	Individual Lot Lot 28 Replat 1 Rem Removed - D.R. Horton sodded the lot prior to the 4/12/22 inspection.	noved				
Lot 30 Replat 1		noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 11/2/22 inspection.					
Lot 33 Replat 1 Current Condition:	Individual Lot Lot 33 Replat 1 Rem Removed - D.R. Horton sodded the lot prior to the 5/17/22 inspection.	noved				
Lot 43 Replat 1		noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 7/26/22 inspection.					
Lot 45 Replat 1 Current Condition:	Individual Lot Lot 45 Replat 1 Rem Removed - Brooks Builders Inc. sodded the lot prior to the 4/26/23 inspection.	noved				
Lot 46 Replat 1		noved				
Current Condition:	Removed - Epic Custom Homes sodded the lot prior to the 5/17/22 inspection.					
Lot 48 Replat 1 Current Condition:	Individual Lot Lot 48 Replat 1 Removed - D.R. Horton sodded the lot prior to the 10/25/22 inspection.	noved				
Lot 49 Replat 1	Individual Lot Lot 49 Replat 1 Rem	noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 10/11/22 inspection.					
Lot 51 Replat 1 Current Condition:	Individual Lot Lot 51 Replat 1 Removed - D.R. Horton sodded the lot prior to the 10/11/22 inspection.	noved				
Lot 55 Replat 1	Individual Lot Lot 55 Replat 1 5/11/2020 Ac	tive Yes				
Current Condition:	Fair Condition - Gene Graves installed silt fence on the side of the lot prior to the inspection maintenance will be sent to the builder of the lot when construction begins. Minor damage					
	the 6/22/21 inspection, the inspector will monitor. D&E Custom Building began excavation	3				
	inspection. Dirt piles were observed in the ROW during the 8/23/22 inspection. D&E Custo					
	waste and the dirt piles from the ROW prior to the 9/13/22 inspection.					
	1.) Silt fence perimeter should be installed.					
	2.) Wattles should be installed along the front of the lot. 3.) Streets should be cleaned.					
	1.) Landmark Performance Corporation was informed to complete by 8/30/22. Not done as of last inspection. Landmark Performance Corporation was reminded on 11/3/22. D&E Custom Building was informed to complete by 3/8/23. Not done as of last inspection. D&E Custom Building was reminded on 4/20/23.					
	2.) Landmark Performance Corporation was informed to complete by 8/30/22. Not done as of last inspection. Landmark Performance Corporation was reminded on 11/3/22. D&E Custom Building was informed to complete by 3/8/23. Not done as of last inspection. D&E Custom Building was reminded on 4/20/23.					
1.457.0	3.) Landmark Performance Corporation was informed to complete by 4/20/23. Not done as					
Lot 57 Replat 1 Current Condition:	Individual Lot Lot 57 Replat 1 Removed - Pacesetter Homes sodded the lot prior to the 7/12/22 inspection.	noved				
Lot 59 Replat 1	Individual Lot Lot 59 Replat 1 Rem	noved				
Current Condition:	Removed - Nelson Builders sodded the lot prior to the 6/21/22 inspection.	acyced .				
Lot 63 Replat 1 Current Condition:	Individual Lot Lot 63 Replat 1 Removed - Urban Spark soddedf the lot prior to the 5/10/23 inspection.	noved				
Lot 71 Replat 1	Individual Lot Lot 71 Replat 1 Rem	noved				
Current Condition:	Removed - D.R. Horton sodded the lot prior to the 8/16/22 inspection.	- Doved				
Lot 78 Replat 1 Current Condition:	Individual Lot Lot 78 Replat 1 Rem Removed - Sundown Homes sodded the lot prior to the 7/19/22 inspection.	noved				
Lot 82 Replat 1		tive Yes				

	Fair Condition - Urban Spark began excavation of the lot prior to the 4/19/22 inspection. Dirt pile was noticed in the ROW during the 4/26/22 inspection. Urban Spark installed silt fence on the south side of the lot prior to the 4/26/22 inspection. Urban Spark removed the dirt pile from the ROW prior to the 5/17/22 inspection. Urban Spark cleaned the streets and sidewalk prior to the 5/10/23 inspection. 1.) Outflow pipe behind the lot should be cleaned out and uncovered. 2.) Silt fence should be repaired and trenched in on the side of the lot. 3.) Sediment that washed on to lot 83 should be cleaned up.				
11/3/22, 11/9/22, 3/1/23, 4/20/23	1.) Urban Spark was informed to complete by 6/28/22. Not done as of last inspection. Urban Spark was reminded on 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/23 2.) Urban Spark was informed to complete by 4/26/23. Not done as of last inspection.				
2.) Urban Spark was informed to complete by 4/26/23. 3.) Urban Spark was informed to complete by 4/26/23.					
Lot 90 Replat 1 Individual Lot Lot 90 Replat 1	. Hot done do or lact mopos	Removed			
Current Condition: Removed - D.R. Horton sodded the lot prior to the 11/9	/9/22 inspection.				
Lot 96 Replat 1 Individual Lot Lot 96 Replat 1	10/00 in an anti-	Removed			
Current Condition: Removed - D.R. Horton sodded the lot prior to the 8/10 Lot 97 Replat 1 Individual Lot Lot 97 Replat 1	16/22 inspection.	Removed			
Current Condition: Removed - D.R. Horton sodded the lot prior to the 12/	/7/22 inspection.	Removed			
Lot 100 Replat 1 Individual Lot Lot 100 Replat 1	·	Removed			
Current Condition: Removed - Woodland Homes sodded the lot prior to the					
Lot 101 Replat 1 Individual Lot Lot 101 Replat 1 Current Condition: Fair Condition - Home owner began construction on the	10/25/2021	Active	Yes		
during the 10/25/21 inspection, the inspector will monifence at the rear of the lot prior to the 1/4/22 inspection the dirt piles from the ROW prior to the 2/15/22 inspection the dirt piles from the ROW prior to the 2/15/22 inspection to the dirt piles from the ROW prior to the 2/15/22 inspection to the dirt piles from the ROW prior to the 2/15/22 inspection. 1.) Wattles should be repaired/reinstalled at the rear 2.) Wattles should be installed on the front of the lot of 3.) Silt fence should be cleaned out and sediment that 4.) Silt fence should be installed on the sides of the lot 5.) Sediment that has washed on to adjoining lots should be installed on the sides of the lot 5.) Sediment that has washed on to adjoining lots should be installed on the sides of the lot 5.) Urban Spark was informed to complete by 12/14/2* 3/8/22, 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/5.) Urban Spark was informed to complete by 3/12/22.	during the 10/25/21 inspection, the inspector will monitor for removal and the installation of BMPs. Home owner installed silt fence at the rear of the lot prior to the 1/4/22 inspection. Maintenance recommendations have changed. Home owner removed the dirt piles from the ROW prior to the 2/15/22 inspection. 1.) Silt fence should be repaired/reinstalled at the rear of the lot or the lot should be sodded. 2.) Wattles should be installed on the front of the lot or the lot should be sodded. 3.) Silt fence should be cleaned out and sediment that has fallen past the property line to the east should be cleaned up. 4.) Silt fence should be installed on the sides of the lot or the lot should be sodded. 5.) Sediment that has washed on to adjoining lots should be cleaned up. 1.) Urban Spark was informed to complete by 12/14/21. Not done as of the last inspection. Urban Spark was reminded on 1/5/22, 3/8/22, 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/23. Home owner was informed to complete by 5/3/23. 2.) Urban Spark was informed to complete by 12/14/21. Not done as of the last inspection. Urban Spark was reminded on 1/5/22, 3/8/22, 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/23. Home owner was informed to complete by 5/3/23. 3.) Urban Spark was informed to complete by 2/22/22. Not done as of last inspection. Urban Spark was reminded on 3/8/22, 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/23. Home owner was informed to complete by 5/3/23. 4.) Urban Spark was informed to complete by 3/12/22. Not done as of last inspection. Urban Spark was reminded on 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/23. Home owner was informed to complete by 5/3/23. 5.) Urban Spark was informed to complete by 3/12/22. Not done as of last inspection. Urban Spark was reminded on 4/27/22, 5/6/22, 6/23/22, 8/2/22, 11/3/22, 11/9/22, 3/1/23, 4/20/23. Home owner was informed to complete by 5/3/23. 5.) Urban Spark was informed to complete by 3/12/22. Not done as of last i				
Current Condition: Removed - D.R. Horton sodded the lot prior to the 11/2	/2/22 inspection.	Removed			
Lot 112 Replat 1 Individual Lot Lot 112 Replat 1	·	Removed			
Current Condition: Removed - D&E Custom Building sodded the lot prior	r to the 4/12/22 inspection.				
Lot 116 Replat 1 Individual Lot Lot 116 Replat 1	/0/00 in an anti-	Removed			
Current Condition: Removed - D.R. Horton sodded the lot prior to the 11/2 Lot 119 Replat 1 Individual Lot Lot 119 Replat 1	7/19/2022	Active	No		
	Good Condition - D.R. Horton installed wattles along the front of the lot prior to the 7/19/22 inspection. Lot is currently inactive.				
Lot 120 Replat 1 Individual Lot Lot 120 Replat 1	3/1/2022	Active	Yes		
Current Condition: Fair Condition - D.R. Horton installed perimeter wattle					
the lot prior to the 11/9/22 inspection. Silt fence still red Silt fence should be removed. D.R. Horton was informed to complete by 9/6/22. Not 04/21/23	to the 4/26/22 inspection. D.R. Horton installed silt fence at the rear of the lot prior to the 7/12/22 inspection. D.R. Horton sodded the lot prior to the 11/9/22 inspection. Silt fence still remains at the rear of the lot. Silt fence should be removed. D.R. Horton was informed to complete by 9/6/22. Not done as of last inspection. D.R. Horton was reminded on 11/11/22, 3/1/23,				
Lot 126 Replat 1 Individual Lot Lot 127 Replat 1	11/23/2021	Active	No is currently inactive D.P.		
Current Condition: Active - D.R. Horton staked down a portable toilet on L Horton resecured the portable toilet prior to the 3/29/2: the 11/16/22 inspection.	•	removed the portable	•		
Lot 127 Replat 1 Individual Lot Lot 127 Replat 1	/05/00 ::'	Removed			
Current Condition: Removed - D.R. Horton sodded the lot prior to the 10/2 Lot 128 Replat 1 Individual Lot Lot 128 Replat 1	/25/22 Inspection.	Removed			
Current Condition: Removed - D.R. Horton sodded the lot prior to the 10/3	/25/22 inspection.	Nemoveu	<u>I</u>		
SB 1 Sediment Basin See SWPPP	1/3/2020	Active	No		
Current Condition: Good Condition - 1% filled - The basin was installed p plugged the bottom 4 holes in the orifice plate prior to increastion.	•	•	· ·		
inspection. SB 2 Sediment Basin See SWPPP	1/3/2020	Active	No		

Current Condition:	Good Condition - 1% filled - The basin was installed prior to the 1/3/20 inspection with a permanent riser. Commercial Seeding plugged the bottom 2 rows of holes in the orifice plate prior to the 4/27/20 inspection. Hausman began cleaning out the basin prior to the 8/9/22 inspection. Hasuman cleaned out the basin prior to the 8/16/22 inspection.					
SB 3	Sediment Basin	See SWPPP	1/3/2020	Active	No	
Current Condition:			ed prior to the 1/3/20 inspection			
	plugged the bottom 4 holes in the orifice plate prior to the 4/27/20 inspection. Hausman cleaned out the basin prior to the 8/9/22 inspection.					
SB 4	Sediment Basin	See SWPPP	1/3/2020	Active	No	
Current Condition:	Good Condition - 30% filled - The basin was installed prior to the 1/3/20 inspection with a temporary riser. Commercial Seeding plugged the lowest dewatering hole and backfilled the erosion prior to the 4/27/20 inspection. Commercial seeding seeded and matted the erosion at the inlet pipe and installed a straw wattle at the stub road prior to the inspection on 5/11/20. All future recommendation of maintenance for the wattle will be included with SB 4. Riser in the basin was removed prior to the 10/11/22 inspection. E&A inspector will monitor for installation of permanent riser.					
SF 1	Silt fence	See SWPPP		Removed		
Current Condition:			fence prior to the 4/27/20 insp	ection.		
SF 2	Silt fence	See SWPPP		Removed		
Current Condition:	Removed - Wattles were r recommendations.		ruction prior to the 10/26/21 in	spection. See Lot BN	MPs for further	
SF 3	Silt fence	See SWPPP		Removed		
Current Condition:	Removed - Silt fence was		for active construction prior to	the 5/18/20 inspection	n.	
SF 4	Silt fence	Springfield Trail		Removed		
Current Condition:			thed or removed as of the 4/9/			
W1	Straw Wattle	SB 4 Stub Road		Removed		
Current Condition:	Removed - Tim Geis cleaned the street and removed the wattle prior to the 7/15/20 inspection, reinstallation is not necessary.					
STR	Streets	Internal/S 132nd and Main Street	1/3/2020	Active	No	
Current Condition:	Good Condition - Streets were clean and free of track out during the 11/9/22 inspection.				_	
CWDDD Ciana	Mice/Other	S 132nd Street and	4/27/2020	Activo	No	
SWPPP Signs Current Condition:	Misc/Other Man Street 1/27/2020 Active No					
Current Condition:	Good Condition - E&A inspector installed SWPPP signs at the intersection of Main Street and N 10th Ave and S 132nd St					
0. 177. 17. 01.1	and Hazel Lane during the 1/27/20 inspection.					
Certification Statement: "I certify, under penalty of law, that this document and all attachments were prepared under m						
	direction or supervision in accordance with a system designed to assure that qualified personnel					
	properly gathered and evaluated the information submitted. Based on my inquiry of the person or					
	persons who manage the system or those persons directly responsible for gathering the information,					
	the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information including the possibility					
	of fines and imprisonment	for knowing violations."				
Inspector Signature:	Sm Nogni			Reviewed By:	Gets Soly	