E & A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599

www.eacg.com



Zachary A. Jilek, CPESC, CISEC Environmental Services Dept. Manager

Engineering Answers

Inspector: Matthew Vanicek				Stage	
		Talaassala N	Andinal Olivia		
			Medical Clinic	2	
Project Name:		CSW-201702196 4/13/2019			
For Week Ending:					
Project Location:	ı	Hwy 32 and K St Te	kamah, NE (Burt County)	68061	
				•	
Grading:	100				
Sanitary Sewer:	100				
Storm Sewer:	100				
Paving: Seeding:	70	%			
Seeding. Utilities:	100				
Overall Development:	85				
overan Beverepment.		70	l l		
RAIN FALL AMOUNTS	Amount in tenths	Date inspected	Weather Conditions		
				W	
Sunday:	0.23"				
Monday	0.00"				
Tuesday	0.00"	03/26/19	63/42 Partly Sunny		
Wednesday	0.00"				
Thursday	0.00"				
Friday	0.00"				
Saturday	0.00"				
				W	
Sunday:	0.00"				
Monday	0.00"				
Tuesday	0.17"				
Wednesday	0.36"				
Thursday	0.20"	4/4/2019	52/46 Rain		
Friday	0.00"				
Saturday	0.00"				
				W	
Sunday:	0.00"				
Monday	0.00"				
Tuesday	0.00"				
Wednesday	0.00"				
Thursday	0.00"				
Friday	0.00"				
Saturday	0.00"				
Complaints:	None				
	_				
Construction Sequencing:					
Which portion(s) (i.e. drainage basins) o	of the site have had a temporar	y or permanent cessation	of grading, earthwork, or ground dist	urbance in the last 14 days?	
Grading began on the entire site (
Which portion(s) (i.e. drainage basins) o		• •		/s?:	
Grading began on the entire site (What temporary or permanent stabilizati					

SUMMARY QUESTIONS:

Existing Vegetation (12/20/2012).

cent streets being maintained adequately?

No, See BMP section

Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?

CHECKLIST QUESTIONS: Are waste materials (concrete, construction material, hazardous, etc.) being managed properly? No, See findings section Is dust associated with the construction activity adequately controlled on the site? Yes Comments: Comments: The site was inactive during the last inspection. Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 2) The portable toilet needs secured. McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building								
Are waste materials (construction material, hazardous, stc.) being managed properly? No. See findings section It dark associated with the construction activity adequately controlled on the site? Yes Comments: Comments: Comments: Findings? Corrective Actions (Date): Findings? Corrective Actions (Date): Findings? Corrective Actions (Date): Findings of Corrective Actions (Date): Findings of Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 2) Since the section of the last inspection in McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was informed to complete by 3/20/19. Not done as of the last inspection. 4. Construction Entance All Construction Entance Rock needs added to the entrance. McCarthy Building was informed to complete by 9/20/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/20/18. Not done as of the last inspection. McCarthy Building was informed to main the second of the	Yes							
Are waste materials (construction material, hazardous, stc.) being managed properly? No. See findings section It dark associated with the construction activity adequately controlled on the site? Yes Comments: Comments: Comments: Findings? Corrective Actions (Date): Findings? Corrective Actions (Date): Findings? Corrective Actions (Date): Findings of Corrective Actions (Date): Findings of Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 1) Some maintenance is required in the BMP section. 2) Since the section of the last inspection in McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was informed to complete by 3/20/19. Not done as of the last inspection. 4. Construction Entance All Construction Entance Rock needs added to the entrance. McCarthy Building was informed to complete by 9/20/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/20/18. Not done as of the last inspection. McCarthy Building was informed to main the second of the	CHECKLIST OLIESTIONS:							
No. See findings section that searched with the construction activity adequately controlled on the site? Yes Comments: Comments: The site was inactive during the last inspection. Findings of Corrective Actions (Date): Thorizon and the second of the site of the si	· · · · · · · · · · · · · · · · · · ·	material, hazardous, etc.) be	eing managed properly?					
Comments: Comments: The site was inactive during the last inspection. Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): Some maintenance is required in the BMP section. 2) The portable toilet needs secured. McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was reminded on 1/23/19, 3/16/19 3), Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name Type Location Northeastern side of 1/2/20/2017 Active Yes Current Condition: Fair Condition - 35% effective- Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 1/17/18, 1/22/18/18, 1/22/18/18, 1/22/19/19, 3/18/19 CW 1 Concrete Washout Eastern side of site 1/2/20/20/17 Active No Current Condition: Good Condition: McCarthy Building installed the weshout prior to the inspection on 1/22/19. Gurrent Condition: Good Condition: McCarthy Building installed the weshout prior to the inspection on 1/22/19. Gurrent Condition: Good Condition: McCarthy Building installed the weshout prior to the inspection on 1/22/19. Gurrent Condition: Good Condition: McCarthy Building installed the weshout prior to the inspection on 1/22/19. Gurrent Condition: Good Condition: McCarthy Building installed the weshout prior to the inspection on 1/22/19. Gurrent Condition: Good Condition - McCarthy Building companies installed the salt fence prior to the inspection on 1/22/19/19. Gurrent Condition: Good Condition - McCarthy Building companies installed the salt fence prior to the inspection on 1/2/20/17. Active No Gurrent Condition: Good Condition - Aportion of the salt fence secure was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the salt should be sta	No, See findings section	,	ggppy.					
Comments: Comments: The site was inactive during the last inspection. Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 2) The portable totic needs secured. McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was reminded on 1/23/19, 3/16/19 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name Type Location Northeastern side of the 12/20/2017 Active Yes Current Condition: Construction Entrance ACCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was seemed on 11/17/18. 11/23/18, 12/91/8, 17/29/19, 3/16/19 CW1 Concrete Washout I Eastern side of site 1/22/20/31 Active No Current Condition: Good Condition- McCarthy Building installed the weshout prior to the inspection on 1/23/19. B1 Current Condition: Good Condition- McCarthy Building Companies installed the self tence prior to the inspection on 1/23/19. B2 Current Condition: Good Condition- McCarthy Building Companies installed the self tence prior to the inspection on 1/22/17. B2 Current Condition: Good Condition- McCarthy Building Companies installed the self tence prior to the inspection on 1/22/01/7. B3 Silf Fence South of A1 1/22/02/2017 Active No Current Condition: Good Condition- Accarthy Building Companies installed the silf tence prior to the inspection on 1/22/01/7. B4 Silf Fence Southern Perimeter 1/22/02/2017 Active No Current Condition: Fair Condition- Accarthy Building Companies installed the silf sence prior to the inspection on 1/22/01/7. Active Yes Current Condition: Fair Condition- Accarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. McCarthy Building was reminded on 1/21/9/18, 1/23/99, 3/16/19 2) McCarthy Buildin	Is dust associated with the construction act	tivity adequately controlled o	n the site?					
Comments: The site was inactive during the last inspection. Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 2) The portable toles required in the BMP section. 2) The portable toles required in the BMP section. 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. McCarthy Building was reminded on 1/23/19, 3/16/19 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. **Unique Name** Type** Location** Northeastern side of 12/20/2017 Active Yes Current Condition: Fair Condition-35% effective- Rock needs added to the entrance. **McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 1/21/9/18, 1/22/19, 3/16/19 CWT 1 Concrete Washout Eastern side of site 1/2/20/19, 3/16/19 CWT 1 Concrete Washout Eastern side of site 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building installed the washout prior to the inspection on 12/20/19. B1 Silt Fence Northern Perimeter 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B2 Silt Fence South of A1 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B3 Silt Fence South of A1 1/2/20/2017 Active Yes Current Condition: Fair Condition: Fair Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B3 Silt Fence South Park and Shineeds to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 3/20/19. Not done	Yes							
Comments: The site was inactive during the last inspection. Findings / Corrective Actions (Date): Findings / Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 2) The portable toles required in the BMP section. 2) The portable toles required in the BMP section. 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. McCarthy Building was reminded on 1/23/19, 3/16/19 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. **Unique Name** Type** Location** Northeastern side of 12/20/2017 Active Yes Current Condition: Fair Condition-35% effective- Rock needs added to the entrance. **McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 1/21/9/18, 1/22/19, 3/16/19 CWT 1 Concrete Washout Eastern side of site 1/2/20/19, 3/16/19 CWT 1 Concrete Washout Eastern side of site 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building installed the washout prior to the inspection on 12/20/19. B1 Silt Fence Northern Perimeter 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B2 Silt Fence South of A1 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B3 Silt Fence South of A1 1/2/20/2017 Active Yes Current Condition: Fair Condition: Fair Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B3 Silt Fence South Park and Shineeds to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 3/20/19. Not done	Comments:							
Findings / Corrective Actions (Date): 1) Some maintenance is required in the BMP section. 2) The portable toile intered secured, McCarthy Building was informed to complete by 12/24/18, Not done as of the last inspection. McCarthy Building was reminded on 1/23/19, 3/16/19 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name								
Findings / Corrective Actions (Date): 1) Some maintaneance is required in the BMP section. 2) The portable toilet needs secured. McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was remined on 1/22/19, 31/61/9 3), Intel protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name Type Location Northeastern side of 12/20/2017 Active Fair Condition: Cover and the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building installed the washout prior to the inspection on 1/20/17. Gurrent Condition: Current Condition: Southwestern side of 12/20/20/17 Pending No Sulf-Fance Southern Perimeter 12/20/20/17 Active Yes Current Condition: Southwestern side of 12/20/20/17 Active Yes Current Condition: Fair Condition - McCarthy Building Companies was informed to complete by 3	The site was inactive during the last i	inspection.						
1) Some maintenance is required in the BMP section. 2) The portable folial needs accurated. McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was reminded on 1/23/19, 3/16/19 3) Inlet protection needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name Type Location Projected Install Date 12/20/2017 Active Yes Current Condition: Fair Condition assistance. Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/718, 11/23/18, 12/19/18, 11/29/19, 3/16/19 Current Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 11/23/19. Gurrent Condition: Good Condition-McCarthy Building Companies installed the sill fence prior to the inspection on 12/20/17. B1 Gurrent Condition: Pending - The silt fence is currently not necessary. The inspector will continue to monitor. Solt Fence Southwestern side of 12/20/20/17 Active No Current Condition: Good Condition-McCarthy Building Companies installed the sill fence prior to the inspection on 12/20/17. B2 Silt Fence Southwestern side of 12/20/20/17 Active No Current Condition: Good Condition-McCarthy Building Companies installed the sill fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/20/17 Active Ves Current Condition: Good Condition-McCarthy Building Companies installed the sill fence prior to the inspection on 12/20/17. Active Ves Silt Fence Southern Perimeter 12/20/20/17 Active Ves Current Condition: Good Condition-McCarthy Building Companies installed the sill fence prior to the inspection. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/20/17 Active Ves Current Condition: Good Con	3	- /						
2) The portable toilet needs secured. McCarthy Building was informed to complete by 12/24/18. Not done as of the last inspection. McCarthy Building was reminded on 17/21/9. 3) Interpretation needs to be installed over the grate inlet on the west side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name	,	,						
was reminded on 1/23/19, 3/16/19 Unique Name Type Location Northeastern side of side of the building. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Unique Name Type Location Northeastern side of side of 12/20/2017 Active Yes Current Condition: Fair Condition - 35% effective- Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18. 11/23/18, 12/19/18, 1/22/19, 3/16/19 CW1 Corrent Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 1/27/19. Bit fence South Fance Southers are side of side of 1/22/2017 Active No Current Condition: Good Condition-McCarthy Building Companies installed the silf fence prior to the inspection on 1/27/91/7. Bit Fence Southers are side of side of 1/22/2017 Bit Fence Southers are side of side of 1/22/2017 Bit Fence Southers Bit Fence southers are side of side of 1/22/2017 Bit Fence Southers Bit Fence southers are side of side of 1/22/2017 Bit Fence Southers Bit Fence Southers Perimeter (1/22/2017) Bit Fence Southers Bit Fence Southers Perimeter (1/22/2017) Bit Fence Southers			informed to complete by	, 12/24/18 Not done as o	of the last inspection	on McCarthy Building		
Unique Name Type Location Location Projected Install Date Projected Install Date Status Maintenance A1 Construction Entrance Fair Condition: Fair Condition: Fair Condition: Fair Condition: Fair Condition: Fair Condition: Current Condition: Cood Condition - Micren	was reminded on 1/23/19, 3/16/19	Modulity Ballanig Was I	mormou to complete by	7 12/2 1/ 10: 1101 40110 40 1		The Modulary Bullaning		
Unique Name Type Location Northeastern side of site 12/20/2017 Active Yes Current Condition: Fair Condition - 35% effective- Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18. 11/23/18. 12/19/18. 12/29/19. 3/16/19 CW1 Current Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 11/23/19. Silf Fence South of A1 Silf Fence Southwestern side of site 1/22/2017 Active No Current Condition: Good Condition-McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B2 Silf Fence Southwestern side of site 1/22/2017 B3 Silf Fence Southwestern side of site 1/22/2017 Active No Current Condition: Good Condition-McCarthy Building Companies installed the silf ence prior to the inspection on 12/20/17. Silf Fence Southwestern side of site 1/22/20/20/17 Active No Current Condition: Good Condition-McCarthy Building Companies installed the silf ence prior to the inspection on 12/20/17. Silf Fence Southwestern side of 1/22/20/20/17 Active No Current Condition: Good Condition-McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B4 Silf Fence Southern Perimeter 1/2/20/20/17 Active Yes Current Condition: 1) A small section of silf fence needs repaired. 2) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1) McCarthy Building was informed to complete by 1/26/18. Not done as of the last inspection. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silf Fence Eastern Perimeter 1/2/20/20/17 Active Yes Current Condition: Good Condition-Aportion of the silf fence was removed due to utility installment. The silf fence needs to be repaired where knocked down OR the site should be stabilized and the silf fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspecti	, ,	•	n the west side of the bu	uilding. McCarthy Buildin	g Companies was i	nformed to complete		
A1 Construction Entrance site 12/20/2017 Active Yes Current Condition: Fair Condition - 35% effective- Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 12/19/18, 1/22/19, 3/16/19 CW 1 Concrete Washout Eastern side of site 1/22/2019 Active No Current Condition: Good Condition - McCarthy Building companies installed the washout prior to the inspection on 1/23/19. Silt Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Silt Fence South of A1 12/20/2017 Pending No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Silt Fence South of A1 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active No Current Condition: Fair Condition- 1) A small section of silt fence needs repaired. 2) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Sit Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - Aportion of the sit fence was removed due to utility installment. The sit fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. No current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap i	by 3/20/19. Not done as of the last i	inspection.						
A1 Construction Entrance site 12/20/2017 Active Yes Current Condition: Fair Condition - 35% effective- Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 12/19/18, 1/22/19, 3/16/19 CW 1 Concrete Washout Eastern side of site 1/22/2019 Active No Current Condition: Good Condition - McCarthy Building companies installed the washout prior to the inspection on 1/23/19. Silt Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Silt Fence South of A1 12/20/2017 Pending No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Silt Fence South of A1 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active No Current Condition: Fair Condition- 1) A small section of silt fence needs repaired. 2) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Sit Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - Aportion of the sit fence was removed due to utility installment. The sit fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. No current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap i						1		
Current Condition: Cood Condition - McCarthy Building Companies installed the silt fe	Unique Name	Type		Projected Install Date	Status	Maintenance		
Current Condition: Fair Condition - 35% effective- Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 12/19/18, 12/29/19, 31/6/19 Current Condition: Good Condition- McCarthy Building installed the washout prior to the inspection on 1/23/19. Silf Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition- McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. Silf Fence South of A1 12/20/2017 Pending No Current Condition: Pending - The silf fence is currently not necessary. The inspector will continue to monitor. Silf Fence Southern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B3 Silf Fence Southern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B4 Silf Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition- 1) A small section of silf fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off sile untreated. 1.) McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Good Condition - McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. Gap in silf fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of sile		O		40/00/0047	A -45	Var		
Rock needs added to the entrance. McCarthy Building was informed to complete by 9/26/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 12/19/18, 1/22/19, 3/16/19 CW 1				12/20/2017	Active	res		
McCarthy Building was informed to complete by 9/28/18. Not done as of the last inspection. McCarthy Building was reminded on 11/7/18, 11/23/18, 12/19/18, 1/22/19, 3/16/19 CURTENT Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 1/23/19. B1 Silf Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition-McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B2 Silf Fence South of A1 12/20/2017 Pending No Current Condition: B3 Silf Fence South of A1 12/20/2017 Pending No Current Condition: Good Condition-McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B3 Silf Fence Southern Perimeter 12/20/2017 Pending No Current Condition: Good Condition-McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. B4 Silf Fence Southern Perimeter 12/20/2017 Active No Current Condition: Fair Condition: 1.) A small section of silf fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silf Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Good Condition - A portion of the silf fence was removed due to utility installment. The silf fence needs to be repaired where knocked down OR the site should be stabilized and the silf fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. Good Condition - McCarthy Building Companies installed the silf fence prior to the inspection on 12/20/17. Gap in silf fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. Silf Fence South East side of	Current Condition.	Tall Condition 0070 C	neouve					
was reminded on 11/7/18, 11/23/18, 12/19/18, 1/22/19, 3/16/19 CWT 1 Concrete Washout Eastern side of site 1/22/2019 Active No Current Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 1/23/19. B1 Silt Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B2 Silt Fence South of A1 12/20/2017 Pending No Current Condition: Pending - The silt fence is currently not necessary. The inspector will continue to monitor. B3 Silt Fence Southern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Accarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Accarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Accarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. South eas								
was reminded on 11/7/18, 11/23/18, 12/19/18, 1/22/19, 3/16/19 CWT 1 Concrete Washout Eastern side of site 1/22/2019 Active No Current Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 1/23/19. B1 Silt Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B2 Silt Fence South of A1 12/20/2017 Pending No Current Condition: Pending - The silt fence is currently not necessary. The inspector will continue to monitor. B3 Silt Fence Southern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Accarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Accarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Accarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. South eas								
CWT 1 Concrete Washout Eastern side of site 1/22/2019 Active No Current Condition: Good Condition-McCarthy Building installed the washout prior to the inspection on 1/23/19. B1 Silt Fence Northern Perimeter 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B2 Silt Fence South of A1 12/20/2017 Pending No Current Condition: Pending - The silt fence is currently not necessary. The inspector will continue to monitor. B3 Silt Fence Surrently not necessary. The inspector will continue to monitor. B3 Silt Fence Surrently not necessary. The inspector will continue to monitor. Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: 1) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 1/2/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observe					of the last inspection	n. McCartny Building		
Current Condition: B1 Good Condition- McCarthy Building installed the washout prior to the inspection on 1/23/19. B1 Good Condition- McCarthy Building Companies installed the slit fence prior to the inspection on 1/22/01/7. B2 Silt Fence South of A1 12/20/2017 Pending No Current Condition: Pending - The silt fence is currently not necessary. The inspector will continue to monitor. B3 Silt Fence Southwestern side of Silt Southwestern side of Southwestern side of Southwestern side of Silt Southwestern side of Silt Southwestern side of Southwestern side Southwest	CW 1			•	Active	No		
Silt Fence								
B2 Silt Fence South of A1 12/20/2017 Pending No Current Condition: Pending - The silt fence is currently not necessary. The inspector will continue to monitor. B3 Silt Fence Southwestern side of Silt Fence Insurently of Pending No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition- 1) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		Silt Fence	Northern Perimeter	12/20/2017	Active	No		
Current Condition: B3 Silt Fence Southwestern side of 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition- McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: To A state Active Yes Current Condition: To A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern comer South eastern comer Site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
B3 Silt Fence Southwestern side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition- 1.) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
Current Condition: B4 Silt Fence Southern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition- 1.) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to	Current Condition.	r chaing - the silt lene		Sary. The inspector will c				
Current Condition: Fair Condition- 1.) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner Sitt Fence Prior to the inspection on 12/20/17. Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Active No								
Current Condition: Fair Condition- 1.) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
1.) A small section of silt fence needs repaired. 2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to			Southern Perimeter	12/20/2017	Active	Yes		
2.) The gap between B4 and B3 needs to be closed as it is allowing water to flow off site untreated. 1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Active No	Current Condition.	Tall Collulion-						
1.) McCarthy Building was informed to complete by 11/26/18. Not done as of the last inspection. McCarthy Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		2.) The gap between B	4 and B3 needs to be o	closed as it is allowing wa	ter to flow off site u	intreated.		
Building was reminded on 12/19/18, 1/23/19, 3/16/19 2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		1) McCarthy Building y	was informed to comple	te by 11/26/18. Not done	as of the last inso	ection McCarthy		
2.) McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B5 Silt Fence Eastern Perimeter 12/20/2017 Active Yes Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence Of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		,	· · · · · · · · · · · · · · · · · · ·		as of the last map	conon: Mocariny		
Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
Current Condition: Fair Condition - A portion of the silt fence was removed due to utility installment. The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to					·			
The silt fence needs to be repaired where knocked down OR the site should be stabilized and the silt fence removed. McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to				II.		Yes		
McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to	Current Condition.	Fair Condition - A porti	off of the silt ferice was	removed due to dunty in	Stallinent.			
McCarthy Building Companies was informed to complete by 3/20/19. Not done as of the last inspection. B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		removed.						
B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
B6 Silt Fence South East side of site 12/20/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		MicCartify Building Col	npanies was informed to	T	lot done as of the	last inspection.		
Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/17. Gap in silt fence was observed during the 8/31/18 inspection. Area is heavily vegetated and reinstallation will not be recommended at this time. B7 Silt Fence Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to	B6	Silt Fence	South East side of site	12/20/2017	Active	No		
not be recommended at this time. South eastern corner		Good Condition - McCa	arthy Building Compani	es installed the silt fence	prior to the inspec	tion on 12/20/17.		
B7 Silt Fence South eastern corner of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to								
B7 Silt Fence of site 12/27/2017 Active No Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		not be recommended a						
Current Condition: Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 12/20/18 to		0:14 5		40/07/0047	A a.t	N =		
, , ,								
	ourient condition.			os matanou the silt leffice	phor to the maper	1011 011 12/20/10 tO		

South eastern corner

Good Condition- No track out was observed during the inspection on 9/21/18.

Misc./Other South of A1 1/3/2018

12/27/2017

Good Condition - McCarthy Building Companies installed the silt fence prior to the inspection on 5/28/18.

Streets Northern side of site 12/20/2017 Active No

Active

Active

No

No

of site

Silt Fence

В7

Current Condition: STR

Current Condition: SWPPP Sign

Current Condition:	Good Condition - The inspector installed the sign during the 1/3/18 inspection.				
Newton Signature:	Vann		Reviewed By:	Sit Sil	