E & A Consulting Group, Inc. 10909 Mill Valley Road, Suite 100 Omaha, NE 68154 tel 402.895.4700 fax 402.895.3599 www.eacg.com



Zachary A. Jilek, CPESC, CISEC

age 1							
1							
1							
022							
)22							
Weeled							
Week 1							
?							
M =l== :							
W slope							
No. See BMP Section Are receiving waters adjacent to the project free of any significant signs of erosion or sediment that would be associated with the construction activity?							

Comments:

East side of the site remains idle. Home construction is continuing on the west side of the project.

Findings / Corrective Actions (Date):

Findings / Corrective Actions (Date):

- 1.) Some maintenance is required in the BMP section.
- 2.) City Inspection Report #6110 was reviewed and forwarded to Developer Steve Champoux to fix remaining silt fence 10, basin items and cleaning up of walking trail on 10/20/2017. (See prior Comments). Note: Per conversation with Terri (Developer) and E&A Inspector on 11/22/2017, sediment basin #3 maintenance, riser and SRR #9 will be installed once grading resumes in the eastern phase next year. E&A will continue to monitor silt runoff and issues on the eastern section of the site. Ed Jochim will be hired to repair SB #2 riser as of 11/22/2017. City Inspection Report #6901 was received and forwarded to the Developer Steve Champoux and Terri Krasne on 2/27/2018 for compliance and street cleaning. (Note: SF 10 has been repaired).
- 3.) Trash needs to be picked up next to the home construction. Terri Krasne was informed to complete by 3/9/2018. Not done as of the last inspection.

Unique Name	Type	Location	Projected Install Date	Status	Maintena		
CD1-14	Wattles	Site	9/7/2016	Active	No		
Current Condition:	Good Condition-CD 14 is in place currently. E&A will verify other wattles and necessity as work progresse CD 1-10 are presently not needed based on lot level construction.						
CE-1	Entrance	Blondo Parkway		Removed			
Current Condition:	Removed- Entrance was removed and paved prior to 10/2/2017 inspection.						
CE-2	Entrance	Blondo Parkway-East	9/7/2016	Active	No		
Current Condition:			is installed prior to 10/2/201				
	Entrance remains in	active as of 3/16/2018.					
CW-1	Concrete washout	West side of project		Removed			
Current Condition:	Removed- Washout pi	t was removed prior to 1	10/2/2017.				
CW-2	Concrete washout	East side of project	5/1/2018	Pending	No		
Current Condition:			ern phase prior to road pavi		INO		
Diversion Ditches 1-24	Diversion Ditches	Site	9/7/2016	Active	No		
Current Condition:			installed prior to the inspec				
	during the first inspecti level construction.	ı	ntinue to monitor. Other div	ersion ditches wer	e removed fo		
Inlet Filters	Inlet Filters	202nd Street, 202nd Avenue	10/25/2017	Active	Yes		
Current Condition:			out prior to 10/25/2017 by				
Current Condition.	i dii Gondicion illiotti	intere nave been dicance			Cnampoux.		
current condition.	Inlet filters can be re		blishment of vegetation a	nd flooding conc			
	Inlet filters can be red Terri Krasne was info	moved due to the estal	3/22/2018.		erns.		
Lot 30	Inlet filters can be red Terri Krasne was info	promed to complete by 3	10/25/2017	Active	erns.		
	Inlet filters can be reconstructed Terri Krasne was info	promed to complete by 3	10/25/2017 x prior to 10/25/2017. Lot is	Active	erns.		
Lot 30	Inlet filters can be reconstructed Terri Krasne was info	primed to complete by 3 202nd Street ated by Steve Champou.	10/25/2017 x prior to 10/25/2017. Lot is	Active	erns.		
Lot 30 Current Condition:	Inlet filters can be red Terri Krasne was info Silt Fence Active- Lot was excave monitor need for silt fe Silt Fence Active- Lot was excave	proved due to the estal promed to complete by 3 202nd Street ated by Steve Champournce installation on the frequency and Street vated by Steve Champ	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot	Active s presently flat. Ea	No &A will contin		
Lot 30 Current Condition:	Inlet filters can be red Terri Krasne was info Silt Fence Active- Lot was excave monitor need for silt fe Silt Fence Active- Lot was excave	primed to complete by 3 202nd Street ated by Steve Champour, nce installation on the fr	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot	Active s presently flat. Ea	No &A will contin		
Lot 30 Current Condition:	Inlet filters can be red Terri Krasne was info Silt Fence Active- Lot was excave monitor need for silt fe Silt Fence Active- Lot was excave	proved due to the estal proved to complete by 3 202nd Street ated by Steve Champour, nce installation on the free 202nd Street vated by Steve Champieed for silt fence installation.	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot	Active s presently flat. Ea	No &A will contin		
Lot 30 Current Condition:	Inlet filters can be red Terri Krasne was info Silt Fence Active- Lot was excava monitor need for silt fe Silt Fence Active- Lot was excava continue to monitor in the second continue to be removed.	proved due to the estal proved to complete by 3 202nd Street ated by Steve Champour, nce installation on the free 202nd Street vated by Steve Champieed for silt fence installation.	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot allation on the front.	Active s presently flat. Ea	No &A will contin		
Lot 30 Current Condition: Lot 31 Current Condition:	Inlet filters can be red Terri Krasne was info Silt Fence Active- Lot was excave monitor need for silt fe Silt Fence Active- Lot was excave continue to monitor in the continue to mo	202nd Street ated by Steve Champourneed for silt fence installation on the frozen for silt fence installation fence install	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot is ont. 3/22/2018.	Active s presently flat. Ea Active ot is presently flat	No &A will contin		
Lot 30 Current Condition: Lot 31 Current Condition:	Inlet filters can be red Terri Krasne was info Silt Fence Active- Lot was excava monitor need for silt fe Silt Fence Active- Lot was excava continue to monitor in Dirt needs to be remo Terri Krasne was info Silt Fence	202nd Street vated by Steve Champour avated by Steve Champour vated by Steve C	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot is ont. 3/22/2018.	Active Active Active of is presently flat Active	No &A will contin		
Lot 30 Current Condition: Lot 31 Current Condition:	Inlet filters can be reconstructed to the continue to monitor and the continue to moni	202nd Street vated by Steve Champour avated by Steve Champour vated by Steve C	3/22/2018. 10/25/2017 x prior to 10/25/2017. Lot is ont. 3/15/2018 oux prior to 3/15/2018. Lot is ont. 3/22/2018. 10/9/2017 to 10/25/2017 by Legacy H	Active Active Active of is presently flat Active	No &A will contin		

Lot 44	Silt Fence	Miami Circle	10/9/2017	Active	No		
Current Condition:	Active- Dirt was remov	ed from the ROW prior to	o 11/2/2017 by Legacy Ho	mes. Due to the lot	being flat, BMF		
		ed as of 1/17/2018. E&A					
Lot 45	Silt Fence	Miami Circle	10/9/2017	Active	No.		
Current Condition:		ed from the ROW prior to ed as of 1/17/2018. E&A	o 11/2/2017 by Legacy Ho will monitor.	omes. Due to the lot	being flat, BMF		
Lot 46	Silt Fence	Miami Circle	3/15/2018	Active	Yes		
Current Condition:			ux prior to 3/15/2018. L	ot is presently flat.	E&A will		
	continue to monitor need for silt fence installation on the front.						
	Dirt needs to be removed from ROW.						
	Terri Krasne was info	ormed to complete by 3/	/22/2018.				
	Stream Outlet Rip						
RR-1-2	Rap	Drainage way	9/7/2016	Active	No		
Current Condition:		ap 1 was installed prior to installed from outfall #3.	10/2/2017 inspection. E	&A will continue to m	nonitor. RR 2 i		
RW-1-8	Rock Weirs	Site	9/7/2016	Active	No		
Current Condition:			or to 10/2/2017 inspection.				
	5 have been removed Erosion Control	prior to the inspection on	10/2/2017. RW 6-8 will b	e verified during the	next inspectio		
ECB-1-15	Blanket	Site	9/7/2016	Active	No		
Current Condition:	Good Condition- Erosic Champoux.	on Control Blanket has be	een installed on the site p	rior to 10/2/2017 by	Developer Ste		
Silt Fence 1-4	Silt Fence	West side of project	9/7/2016	Active	No		
Current Condition:			the west side & repaired				
			ed to the east of lot 39; Sil				
			by RR1 was repaired due				
			ctor retied the silt fence to				
	3/2/2018.			. 5			
Silt Fence 5-10	Silt Fence	East side of project	9/7/2016	Active	No		
Current Condition:			alled by Developer Steve				
	was repaired by Comm the inspection on 3/2/2	• •	1/29/2017. E&A inspector	retied the silt fence	to the posts du		
Sediment Basin 1	Sediment Basin	West side-entrance	9/7/2016	Active	No		
Current Condition:			x device was installed price	the state of the s	,		
	The second secon		slopes. Riser is beginnin	ig to become unde	rmined. E&A		
	continue to monitor a	IS Of 3/15/2018.					
Sediment Basin 2	Sediment Basin	East side-Central	9/7/2016	Active	Yes		
Current Condition:			device was installed prior	to 10/2/2017 inspec	tion by Develo		
	Steve Champoux. SR	R 7 & 8 are in place on the	ne slopes.				
	Sodiment Penin ricer i	s undermined and repair	is pooded				
		diacininea ana repair	is riccucu.				
		·		done as of the last i	nspection		
	Developer Steve Chan	npoux was informed to co	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1				
	Developer Steve Chan	npoux was informed to co	omplete by 10/9/2017.Not				
Sediment Basin 3	Developer Steve Chan Developer Steve Chan 2/27/2018.	npoux was informed to co	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1	11/21/2017, 12/20/20	017, 1/30/2018,		
Sediment Basin 3 Current Condition:	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 1	npoux was informed to conpoux was reminded on a	omplete by 10/9/2017.Not	1/21/2017, 12/20/20 Active)17, 1/30/2018, Yes		
	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 10 to 10/2/2017.	npoux was informed to conpoux was reminded on a second control of the second control of	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1 9/7/2016 e slopes, although SRR 1.	Active 2 is missing. Basin b	917, 1/30/2018 Yes nas been dug p		
	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 10 to 10/2/2017.	npoux was informed to conpoux was reminded on a second control of the second control of	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1 9/7/2016	Active 2 is missing. Basin b	917, 1/30/2018 Yes nas been dug p		
	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 1 to 10/2/2017. Sediment Basin needs	East side 0 & 11 are in place on the	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1 9/7/2016 e slopes, although SRR 1.	Active 2 is missing. Basin h	Yes nas been dug p		
	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan	East side 0 & 11 are in place on the to be installed per plan, npoux was informed to co	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1 9/7/2016 e slopes, although SRR 1 including riser, anti-vortex	Active 2 is missing. Basin has device, outfall and the done as of the last	Yes nas been dug prip rap per planinspection.		
Current Condition:	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan Developer Steve Chan	East side Description to be installed per plan, appoux was reminded on a side to be installed per plan, appoux was informed to compoux was reminded on a side of the side of	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1 9/7/2016 e slopes, although SRR 1. including riser, anti-vortex omplete by 10/9/2017. No 10/10/2017, 10/20/2017, 1	Active 2 is missing. Basin had device, outfall and toone as of the last 1/21/2017, 1/30/201	Yes nas been dug prip rap per plar inspection.		
Current Condition: Sediment Trap 1	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan Developer Steve Chan Sediment Trap	East side Description of the compount was informed to compount was reminded on the compount was informed to compount was informed to compount was reminded on the compount was reminded on th	omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2016 e slopes, although SRR 1. including riser, anti-vortex omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2016	Active Active 2 is missing. Basin by device, outfall and to done as of the last 11/21/2017, 1/30/201 Active	Yes nas been dug prip rap per plar inspection. 8, 2/27/2018.		
Current Condition:	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan Developer Steve Chan Sediment Trap	East side East side 0 & 11 are in place on the to be installed per plan, poux was reminded on a	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 1 9/7/2016 e slopes, although SRR 1. including riser, anti-vortex omplete by 10/9/2017. No 10/10/2017, 10/20/2017, 1	Active Active 2 is missing. Basin by device, outfall and to done as of the last 11/21/2017, 1/30/201 Active	Yes nas been dug prip rap per plar inspection. 8, 2/27/2018.		
Current Condition: Sediment Trap 1	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan Developer Steve Chan Developer Steve Chan Good Condition-20% fr	East side East side 0 & 11 are in place on the to be installed per plan, poux was reminded on a	omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2016 e slopes, although SRR 1. including riser, anti-vortex omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2016	Active Active 2 is missing. Basin by device, outfall and to done as of the last 11/21/2017, 1/30/201 Active	Yes nas been dug prip rap per plantinspection. 8, 2/27/2018.		
Sediment Trap 1 Current Condition:	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan Developer Steve Chan Developer Steve Chan Sediment Trap Good Condition-20% fi SRR 1 & 2 are in place Sediment Trap	East side Description To be installed per plan, Description SW corner SW corner Ull- Trap was installed presented on the slopes.	omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2017, 10/20/2016 e slopes, although SRR 1 including riser, anti-vortex omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2017 inspectio	Active	Yes has been dug prip rap per plantinspection. 18, 2/27/2018. No re Champoux.		
Sediment Trap 1 Current Condition: Sediment Trap 2 Sediment Traps 2-8	Developer Steve Chan Developer Steve Chan 2/27/2018. Sediment Basin Poor Condition-SRR 11 to 10/2/2017. Sediment Basin needs Developer Steve Chan Developer Steve Chan Developer Steve Chan Developer Steve Chan Sediment Trap Good Condition-20% fi SRR 1 & 2 are in place Sediment Trap Good Condition- Sediment Trap	East side Description and the state of the	omplete by 10/9/2017.Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2017, 10/20/2016 e slopes, although SRR 1 including riser, anti-vortex omplete by 10/9/2017. Not 10/10/2017, 10/20/2017, 10/20/2017, 10/20/2017 inspectio 9/7/2016	Active 2 is missing. Basin for device, outfall and at done as of the last 11/21/2017, 1/30/201 Active n by Developer Stev Active nt on the west side.	Yes nas been dug prip rap per plantinspection. No e Champoux. No ST 6-8 have b		

SRR-1-12	Slope Outlet Rip Rap	Site	9/7/2016	Active	No		
Current Condition:	Good Condition- Rip rap 1,2, 4-8, 10-11 were installed prior to 10/2/2017 inspection. Rip rap 3, 9 and 12 are						
	currently missing or need to be verified. E&A will continue to monitor.						
STR	Streets	Site	9/7/2016	Active	Yes		
Current Condition:	Fair Condition-						
	Streets-including North 202nd Street and North 202nd Avenue needs to be cleaned, including in front of active lots. Developer Steve Champoux and Terri Krasne was informed to steet clean by 2/28/2018. Not done as of the last inspection. Terri Krasne was reminded on 3/2/2018.						
SWPPP Sign	Misc/Other	Blondo Parkway	10/9/2017	Active	No		
Current Condition:	Good Condition- 2 SWPPP signs were installed by the entrances prior to 10/19/2017 by E&A.						
Inspector Signature:	Get Soll		·	Reviewed By:	Add Vien		